

ASPEN









Disclaimer



Inspection Details

Observations / Comments

The thumb has been chained up in place and appears to be missing the retainer pin and linkage for the thumb. The thumb also appears to be slightly bent. The pin from the arm to the bucket appears to be worn, with a visible gap around the pin. The tooth adapters on the bucket appear to be worn down. The left cab mirror appears to be damaged. The rear counterweight paint on the unit is scratched. The right lower sheetmetal is dented. The blade cylinder cover is bent. The small oil cooler is dented. The A/C condenser appears to be oily and possibly leaking, or there may be a leak in the compartment. The washer fluid reservoir appears to be laving inside the engine cooler compartment and is cracked. The exhaust tip is bent. The paint on the rear of the cab is cracking. The hose in the engine conpartment appears to be rubbing on the hood. The overflow tube is missing from the coolant reservoir cap. The coolant reservoir appears to be starting to fall off the retainer bracket. There appears to be no coolant in the reservoir. The engine oil is dark in color. The operator seat material is stained, with small holes in the bottom seat material, and the material on the lower cushion is peeling off. The right pedal is missing the rubber cover. The front right lower part of the cab is missing paint, and the metai is forming rust. The left grab handle on the cab has scratched-off paint. The boom cylinder paint is scratched and worn off the cylinder, and the shield is missing. The grease lines on the front lower part of the cab are cut and hanging on the frame. The sprockets on the right and left side are showing wear. The track pads have cuts and gouges, and some of the pads appear to be breaking off. The right track master link for the tracks appears to be coming out of the housing. The rear right enclosure door sheetmetal appears to be dented.

Unit Information									
Engine Hours:	2,654		154		EN	EMS Warning Lights:		No	
Interior Details									
Interior Condition:	No Damages Observed		Operator's Seat:		See	Notes	Radio:		No
A/C:	Yes		Travel Controls:		No	Damages Observed	Pedals:		See Notes
Floorboard:	No Damages Observed		Power Mirrors:		No		Heated Mirrors:		No
Switches and Controls:	No Damages Observed		Cab Mirror:		N/A	N/A Bacl		Camera:	No
Exterior Details									
Mirrors:	See Notes		Steps:		No	Damages Observed	Handrails:		See Notes
Exhaust System:	See Notes		ROPS:		No	Damages Observed	Undercarriage:		No Damages Observed
Front Lights:	No Damages Observed		Rear Lights:		N/A	Δ	Engine Serial Plate:		Obstructed
Bucket:	Yes		Bucket Condition:		See	Notes	Bucket Cylinder Condition:		No Damages Observed
Blade:	Yes		Blade Condition:		No	Damages Observed	Blade Cylinder Condition:		See Notes
Thumb:	Yes		Thumb Condition:		See	Notes	Thumb Cylinder Condition:		No Damages Observed
Swing Tower Cylinder:	No		Swing Tower Cylinder Condition:		N/A	A	Stick Cylinder:		Yes
Boom Cylinder:	Yes		Boom Cylinder Condition:		See	See Notes		al Cylinders:	No
Additional Cylinders Condition:	N/A		Additional Cylinders Name:		N/A	N/A			
Attachment Type:	N/A		Attachment Condition:		N/A	N/A			
Engine Details									
Engine Compartment: See Notes					Oil	Oil Dipstick:		Good Level / Dark in Color	
				Tr	ack	s			
Right Track Condition:	See Notes			Right Track Brand:		Obstructed	Right	Track Size:	Obstructed
Right Track Tread Depth Measurement:	N/A			Right Track-Idler:		No Damages Observed Right T		Track-Sprocket:	See Notes
Right Track Rollers:	No Damages Observed								
Left Track Condition:	See Notes			Left Track Brand:		Obstructed L		rack Size:	Obstructed
Left Track Tread Depth Measurement:	N/A			Left Track-Idler:		No Damages Observed		rack-Sprocket:	See Notes

Disclaimer

No Damages Observed

Measurement: Left Track Rollers:







































































































































































