

# FAA-28

Analog Amplifier

---

## User Manual



## Table of Contents

<b>1.</b>	<b>Safety Instructions .....</b>	<b>2</b>
<b>2.</b>	<b>Front View, Features and Specifications .....</b>	<b>3</b>
<b>3.</b>	<b>Installation and Commissioning.....</b>	<b>6</b>
3.1	Mechanical Installation .....	7
3.2	Load Cell Connection .....	7
3.3	Analogue Output Connection .....	8
3.4	Changing the Analogue Output .....	9
3.5	Serial Port Connection.....	9
3.6	Commissioning .....	9
<b>4.</b>	<b>Adjustments .....</b>	<b>10</b>
4.1	Adjustment with Rotary Switches .....	10
4.2	Fast Adjustment to Nominal Output Range .....	12
4.3	eCal Electronic Adjustment Via xFace Software.....	12
4.4	Adjustment (eCal) With PLC.....	13
4.5	Testing the Scale Performance.....	15
<b>5.</b>	<b>Setpoints .....</b>	<b>16</b>
5.1	Setpoint Connection .....	16
5.2	Setpoint Adjustment .....	16
5.3	Adjustment to the Load on the Scale .....	16
5.4	Adjustment by Measuring the Analog Output .....	16
<b>6.</b>	<b>Operation Mode .....</b>	<b>18</b>
<b>7.</b>	<b>Programming With xFace Software Over RS232 .....</b>	<b>19</b>
7.1	Installation of xFace Software.....	19
7.2	xFace Software .....	19
<b>8.</b>	<b>Trouble Shooting .....</b>	<b>21</b>

## Disclaimer

### All rights reserved.

No part of this publication may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, mechanical, photocopying, recording, or otherwise, without the prior written permission of Flintec.

No patent liability is assumed with respect to the use of the information contained herein. While every precaution has been taken in the preparation of this book, Flintec assumes no responsibility for errors or omissions. Neither is any liability assumed for damages resulting from the use of the information contained herein.

The information herein is believed to be both accurate and reliable. Flintec, however, would be obliged to be informed if any errors occur. Flintec cannot accept any liability for direct or indirect damages resulting from the use of this manual.

Flintec reserves the right to revise this manual and alter its content without notification at any time. Neither Flintec nor its affiliates shall be liable to the purchaser of this product or third parties for damages, losses, costs, or expenses incurred by purchaser or third parties because of: accident, misuse, or abuse of this product or unauthorized modifications, repairs, or alterations to this product, or failure to strictly comply with Flintec operating and maintenance instructions.

Flintec shall not be liable against any damages or problems arising from the use of any options or any consumable products other than those designated as Original Flintec Products.

**NOTICE:** The contents of this manual are subject to change without notice.

## 1. Safety Instructions



**CAUTION:** READ this manual BEFORE operating or servicing this equipment. FOLLOW these instructions carefully. SAVE this manual for future reference. DO NOT allow untrained personnel to operate, clean, inspect, maintain, service, or tamper with this equipment. ALWAYS DISCONNECT this equipment from the power source before cleaning or performing maintenance.

CALL Flintec for parts, information, and service.



**WARNING:** Only permit qualified personnel to service this equipment. Exercise care when making checks, tests and adjustments that must be made with power on. Failing to observe these precautions can result in bodily harm.



**WARNING:** For continued protection against shock hazard connect to properly grounded outlet only. Do not remove the ground prong.



**WARNING:** Disconnect all power to this unit before removing the fuse or servicing.



**WARNING:** Before connecting/disconnecting any internal electronic components or interconnecting wiring between electronic equipment always remove power and wait at least thirty (30) seconds before any connections or disconnections are made. Failure to observe these precautions could result in damage to or destruction of the equipment or bodily harm.



**CAUTION:** Observe precautions for handling electrostatic sensitive devices.


## 2. Front View, Features and Specifications

High speed analog load cell transmitter FT-28 has very high accuracy and long-term stability with its high-tech design. Its high-performance electronic calibration via RS232C serial port without any test weight and fast calibration without measuring output signal reduces commissioning and service times.

This high-tech instrument gives the system designers a lot of advantages to increase the system reliability and to reduce the installation and service times. Besides the traditional analog output adjustment with any test weight, the electronic calibration eCal and fast calibration with 20% max. test load reduces the calibration time.


All analog outputs of the instruments are matched in the production to perform calibration at PLC and for changing the instrument without recalibration in service.

There are 8 positioned rotary switches and annunciator LEDs in front of the instrument. The front view and pin descriptions of FAA-28 is shown below.

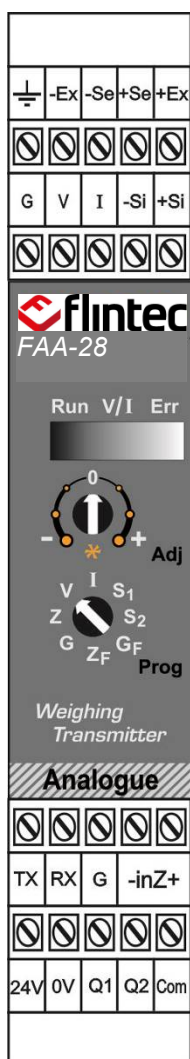

Pin Name	Definition
<b>LOAD CELL CONNECTION</b>	
+ Ex	+ Excitation
- Ex	- Excitation
+Se	+Sense
-Se	-Sense
+ Si	+ Signal
- Si	- Signal
Shield	Shield and Protective ground
<b>ANALOGUE OUTPUT</b>	
I	Current output
V	Voltage output
G	GND
<b>SERIAL CONNECTION</b>	
TX	TxD ( RS232C )
RX	RxD ( RS232C )
G	Ground ( RS232C )
-	Zeroing input (0V)
+	Zeroing input (+24V)
<b>SETPOINT CONNECTION</b>	
Q1	Digital Output 1
Q2	Digital Output 2
Com	Digital Outputs Common
<b>POWER SUPPLY</b>	
24V	+24VDC
0V	0VDC

## Meanings of the positions of rotary switches

Programming (Prog) switch	V	Voltage output type run	(refer to page 9)
	I	Current output type run	(refer to page 9)
	S1	Setpoint 1 adjustment	(refer to page 17)
	S2	Setpoint 2 adjustment	(refer to page 17)
	Z	Zero adjustment	(refer to page 11)
	G	Gain adjustment with test weight	(refer to page 11)
	ZF	Fast zero adjustment	(refer to page 13)
	GF	Fast gain adjustment with 20% test weight of Maximum scale capacity	(refer to page 13)
Adjustment (Adj) switch	0	Operation mode (Run)	
		Special Functions in “Fast Adjustment, “Setpoint Adjustment”	
LEDs		Annunciator LEDs (Run, Output type, Error). Refer to <a href="#">section 9</a>	

## Features

- Minimized zero and span drifts due to its microcontroller technology and high accuracy, very low temperature drift, 24 bits ADC and 16 bits DAC converters.
- Long time stability and low temperature drifts eliminate the frequent readjustment period.
- Very easy and user-friendly digital adjustment via rotary switches located on the front of the instrument.
- Programmable digital adaptive anti-vibration filters to minimize environmental vibrations.
- eCal- electronic calibration without weights and digital filter adjustment via RS232C port and xFace PC software.
- Fast calibration feature to reduce the adjustment time and to minimize adjustment error.
- Calibration at PLC does not require readjustment after changing instrument because of matching in the production.
- 1 zeroing input and 2 free relay contact outputs for alarm or controlling valves, gate etc.

TECHNICAL SPECIFICATIONS	
Analogue input range	-18 mV ... +18 mV
Min. input range	< 0.8 mV
Linearity	< % 0.01
Temperature drift	< 0.005 % FSR / °C
Converters	24-bit Delta-Sigma ratiometric ADC with integral analog and digital filters, high EMC immunity 16-bit very low drift DAC
Internal resolutions	16 000 000 counts ADC
External resolution	Analogue output changes up to 60000 steps
Output update rate	Up to 800 conversions per second
Calibration	With rotary switches in the front with test load. Fast calibration with 20% of max. weighing range Electronic calibration via PC. Preadjusted instrument for calibration at PLC
Digital Filter	Programmable 9 step adjustable digital adaptive filter.
Analogue outputs	Current output for 0-20 mA and 4-20 mA or voltage output or 0- 5 V and 0-10 V.
Max. cable length	300 meters
Max. load resistance (voltage output)	500 Ω
Set point	2 free programmable setpoints.
Digital Output	2 relay contacts for setpoints, 230 VAC or 30 VDC, 1 A.
Digital Input	1 opto-isolated input for zeroing, 12 ... 28 VDC, 10mA
Load cell excitation	5 VDC
Number of load cells	Up to 8 units of 350 Ω or 18 units of 1100 Ω (min. 43 Ω)
Load cell connection	4- or 6- wire technique
Power supply	12 ... 28 VDC, 0.2 A
Operation Temperature	-15°C ... +55°C at 85% RH max, non-condensing
EMC Immunity	Class E2
Enclosure	Polyamide, for DIN-rail mount, IP20
Dimensions	Front Width:22,5 mm, Front Length: 99 mm, Height:114,5mm

### 3. Installation and Commissioning

#### Recommendations

**Warning:** Please care the following warnings for designing the control cabinet which will increase your system reliability.

The control cabinet should be designed so that instrument can operate safely.

The panel should be placed in clean area, if possible, not getting direct sun light, with a temperature between -15 °C and +55 °C, humidity not exceeding 85% non-condensing. All external cables should be installed safely to avoid mechanical damages.

FAA-28 instruments are very low level signal measuring instruments. To avoid electrical noise, FAA-28 should be separated from equipment that produce electrical noise. Preferable use metal cabinet against radio frequency interference and the cabinet shall be connected to ground against the electromagnetic disturbances. Load cell cable and analog output cable trays must be separated from others, if possible. If there are noise-generating equipment such as heavy load switches, motor control equipment, inductive loads etc., please be careful against the EMC interference in the cabinet. Connect parallel reverse diodes to the DC inductive loads like relays, solenoids etc. to minimize voltage peaks on the DC power lines.

All load cell and analogue output cables coming to the control cabinet shall be shielded.


**Warning:** Control cabinet design and proper installation increase reliability and performance of the instrument. Please do not forget that the instrument must be powered off before inserting or removing any peripheral connector.

Follow the installation and commissioning steps described below carefully to prevent unwanted results after installation.

### 3.1 Mechanical Installation


The place where you will use/install your instrument should be clean, not getting direct sunlight, if possible, with a temperature between -15°C and +55°C, 85% maximum relative humidity non-condensing. Install the instrument on the DIN rail in the cabinet.

The instrument mechanical drawing

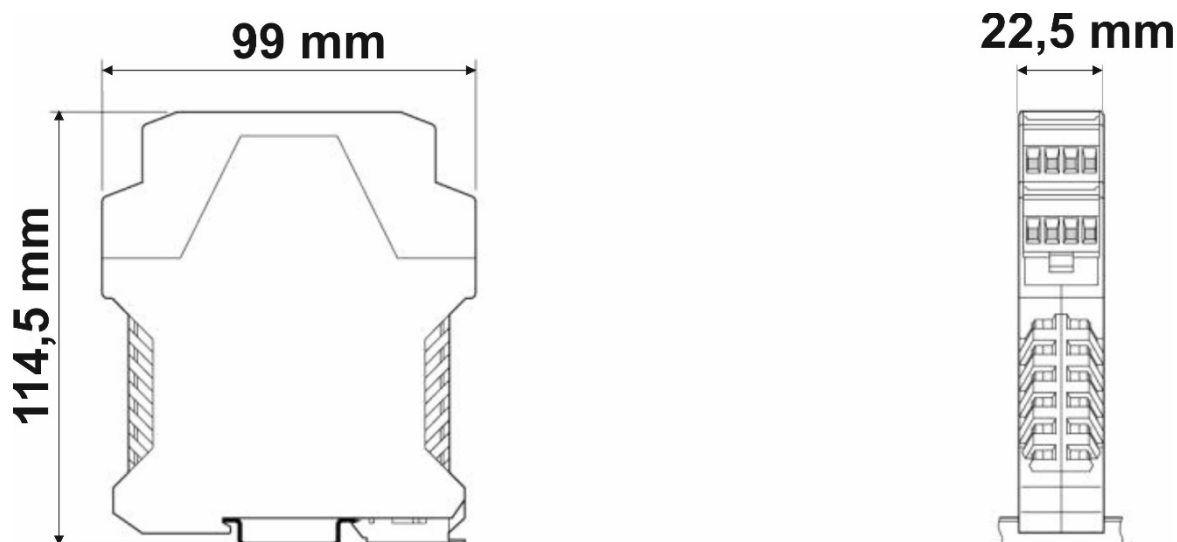

### 3.2 Load Cell Connection


The load cell wiring should be made carefully before energizing to avoid damages of the instrument and load cells. In 4-wire installations the sense and excitation pins with the same polarity should be short circuited at the connector side. If you have junction box, use 6 wire cable between FAA28 and the junction box, and short circuit these pins at junction box for better performance. The input resistance of the load cells that you want to connect should be more than 43  $\Omega$ .


Pin Name	6 Wire Load Cell Connection	4 Wire Load Cell Connection
+Ex	+ Excitation	+ Excitation
+Se	+ Sense	Short circuit to + Excitation
-Ex	- Excitation	- Excitation
-Se	- Sense	Short circuit to - Excitation
+Si	+ Signal	+ Signal
-Si	- Signal	- Signal
	Shield	Shield




### 3.3 Analogue Output Connection

Only one of the analog output types can be used at the same time and has to be selected in the setup type. Install the analog output measuring instrument for adjustment, e.g. multimeter.

Pin Name	Definition
I	Current Output
V	Voltage Output
G	GND
	Shield

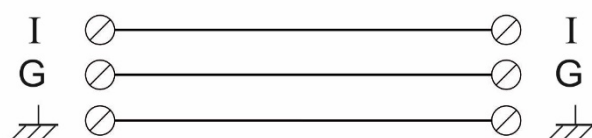

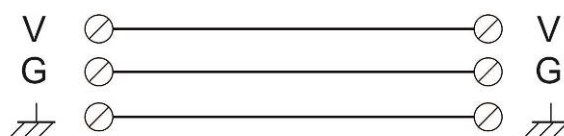

Current output connection



Voltage output connection

### 3.4 Changing the Analogue Output

FAA-28 sets its analog output according to the table below at power on. Turn the programming switch and connect TxD and RxD pins as indicated in the table below before power on the instrument to set analog output type and its signal level.

Analogue Output Range	Prog. Switch Position	TxD & RxD pins	V / I LED
4 - 20 mA		Open circuited	On
0 - 20 mA		Short circuited	Off
0 - 10 VDC		Open circuited	Flash
0 - 5 VDC		Short circuited	Blinking


You can also set the analog output type after power on as:

- Turn the programming switch to the analog output type (to V or I position)
- Connect or disconnect TxD and RxD pins according to the table above to set the output range
- Turn the adjustment switch to the \* position. After 2 seconds turn in back to the "0" - position (if the instrument is powered on before)

The analogue output type can be followed by the V/I LED on front of the instrument after running it (refer to table above) .

After setting up the analog output of the instrument according to the table above go to the next step.

### 3.5 Serial Port Connection

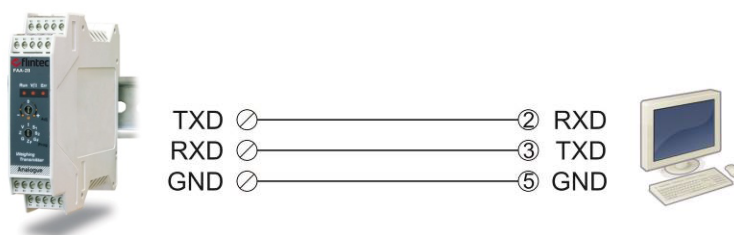

### 3.6 Commissioning

Double check the following issues before energizing the instrument.








- Check Mechanical installation, grounding, load cell connection and power supply connection
- Check the analogue output set up described in [section 4.4](#)
- The analogue output cabling should be done for the same analogue output type
- The adjustment (Adj) rotary switch shall be at "0" - position

## 4. Adjustments

### 4.1 Adjustment with Rotary Switches

To start the adjustment the programming switch should be at analog output type position, **V** or **I**.

**Z** and **G** positions of the programming switch are used for performing zero and gain adjustments in sequence. Analog output is changed by turning the adjustment switch as described in the table below.

Adjustment rotary switch position	Rotary switch description	Run LED
	No change, operation mode	On
 	Decrease ( - ) / Increase ( + ) in slow steps	Flash
 	Decrease ( - ) / Increase ( + ) in medium steps	Flash
 	Decrease ( - ) / Increase ( + ) in big steps	Flash

RUN LED flashes to indicate the instrument is not in operation mode.

#### Zero Adjustment

- Connect the measurement instrument (Multimeter is recommended) to the analog output
- Unload the scale (the scale must be empty)
- Turn the programming switch to the **Z** position from the analog output type position
- Increase or decrease the analog output by adjustment rotary switch.  
Never bring the adjustment switch to \* position in this adjustment. Turn the adjustment switch to **0** - position at the end of the adjustment.
- Turn the programming switch to analog output type position (**V** or **I**) to start the operation mode or to the **G** position to start gain adjustment

#### Gain Adjustment

- Connect the measurement instrument (Multimeter is recommended) to the analog output
- Load the scale with a known load
- The analog output value should be calculated for the applied load

Use the following formula for calculating the analog output value

$$\text{Analog Output} = \text{Minimum output} + \frac{\text{Maximum output} - \text{Minimum output}}{\text{Scale capacity}} * \text{Load}$$

**Example:**


Scale capacity	100kg
Output range	4 – 20 mA
Known Load	25kg

The 4-20mA analog output current will be at 25kg ;

$$I_{\text{out}} = 4\text{mA} + ((20\text{mA} - 4\text{mA}) / 100\text{kg}) * 25\text{kg} = 4 + 0.16 * 25 =$$
$$I_{\text{out}} = \underline{8\text{mA}}$$

The 0 – 10VDC analog output voltage will be at 25kg:

$$V_{\text{out}} = 0 + (10\text{V} / 100\text{kg}) * 25\text{kg} = 0,1 * 25 =$$
$$V_{\text{out}} = \underline{2.5\text{VDC}}$$


- Turn the adjustment switch to the **G** position from the analog output type position you set before
  - Increase or decrease the analog output by adjustment rotary switch to the calculated output value
- Never bring the adjustment switch to  position in this adjustment. Turn the adjustment switch to **0** - position at the end of the adjustment
- Turn the programming switch to analog output type position for operation mode (to V or I)

**Important note:** The instrument saves 4 different adjustments in its memory for the voltage and current outputs and their ranges. Changing the analog output type it automatically set the adjustment to the output range used before.

## 4.2 Fast Adjustment to Nominal Output Range


You may perform fast adjustment method if you will set zero and gain to analog output nominal values. This feature gives advantage to the instrument for small and medium capacity weighing systems' fast and easy adjustment.

### Fast Zero Adjustment:

- Unload the scale
- Turn the programming switch to **ZF** position
- Turn the Adj. switch to  position and turn it back to **0** - position 2 seconds later
- Turn the programming switch to analog output type position to start operation mode or to **GF** position for gain adjustment.

For example, for 4 – 20mA range and for 100kg capacity scale, unload the scale and perform fast adjustment to set the output to 4mA.

### Fast Gain Adjustment:

- Load the scale to the 20% of the maximum capacity (if scale capacity is 100kg, load 20 kg)
- Turn the programming switch to **GF** position.
- Turn the Adj. switch to  position and turn it back to “**0**” - position 2 seconds later
- Turn the programming switch to analog output type position for operation

For example, for 4 – 20mA range and for 100kg capacity scale, load the scale 20kg test weight and perform fast gain adjustment to set the output to 7,2mA at this load. The output will be 20mA at 100kg loading.

## 4.3 eCal Electronic Adjustment Via xFace Software

The adjustment of high capacity tanks and silos are very difficult in practice and takes very long time. You may save a lot of time by eCal adjustment by entering theoretical scale and load cell values to the instrument instead of loading the scale. Due to the production process of FAA-28, eCal accuracy is very high. Adjustment with eCal is performed via RS232 port of the instrument and can be comfortable executed with xFace software. Refer to [section 8](#) for installation and using the software.

For increasing the eCal accuracy you must enter the specific load cell rated output, which is printed on “Final Data Summary” attached to every Flintec load cell. Using more than one load cell an arithmetic average of all load cells must be calculated.

## 4.4 Adjustment (eCal) With PLC

All instruments are adjusted in the production to operate in its analog output range between 0mV and 10mV load cell signal as default. For example, if the instrument is at factory default values and programmed to operate 4 – 20mA output range, the output will be 4mA at 0mV and 20mA at 10mV load cell signal (only for 2mV/V load cells).

Changing the FAA-28 instrument a recalibration is not required due to matching instruments in production by Flintec.

**Warning:** *If the instrument was adjusted before and its factory defaults are changed, you should load factory defaults with xFace.*

### FAA-28 Programming via RS232C

FAA-28 can be electronically calibrated via RS232C serial interface by commands or by xFace software. If you want to use your own software to calibrate the FAA-28 from your PLC or PC, you may use the commands below. The yellow colored bytes are the data in the command and blue colored bytes are check sum in this document.

Output type setting and eCal electronic calibration should be done in sequence.

#### RS232C PORT SETTING :

Adjust your PC or PLC serial port as 9600, 8 None 1.

#### DATA STRUCTURE :

ASCII, HEX DATA and CR (Carriage Return) at the end of the command.

#### COMMANDS:

#### Descriptions

##### 1. Analog output type setting:

###### a) 4 - 20mA setting:

Command: @01100000000102000BE1

Set to 4-20 mA range

Response: @011000000001EE

ACK

###### b) 0 - 20mA setting:

Command: @011000000001020014D8

Set to 0-20 mA range

Response : @011000000001EE

ACK

###### c) 0 - 10VDC setting :

Command: @01100000000102000AE2

Set to 0-10 VDC range

Response : @011000000001EE

ACK

###### d) 0 - 5VDC setting :

Command: @011000000001020013D9

Set to 0-5 VDC range

Response : @011000000001EE

ACK

## 2. eCal procedure steps:

## Descriptions

Step 1.	START eCal		
	Command:	@011000000001020001EB	Start the eCal process.
	Response:	@011000000001EE	ACK
Step 2.	Total Load cell Emax entry		
	Command:	@01100003000204000001F4F1	Total LC is 500kg.
	Response:	@011000030002EA	ACK
Step 3.	Average Load cell mV/V entry		
	Command:	@0110000500020400004E2F67	LC sensitivity: 2.0015mV/V.
	Response:	@011000050002E8	ACK
Step 4.	Estimated Dead load entry		
	Command:	@0110000700020400000000E2	Dead load is 0kg.
	Response:	@011000070002E6	ACK
Step 5.	Scale Capacity entry		
	Command:	@01100009000204000000FAE6	Scale capacity is 250kg.
	Response:	@011000090002E4	ACK
Step 6.	SAVE with estimated dead load value		
	Command:	@011000000001020007E5	Save the eCal values.
	Response:	@011000000001EE	ACK
	Or SAVE with automatic zero adjustment. Unload the scale and send the command below to start the zero adjustment.		
	Command:	@011000000001020015D7	Save eCal with Zero Adj
	Response:	@011000000001EE	ACK
Step 7.	APPLY		
	Command:	@011000000001020009E3	Apply the calibration.
	Response:	@011000000001EE	ACK
Step 8.	STOP eCal		
	Command:	@011000000001020002EA	Stop the eCal process
	Response:	@011000000001EE	ACK

## 3. Digital Filter Setting:

Command:	@011000220001020000CA	Set the Fast filter
Command:	@011000220001020001C9	Set to Medium filter
Command:	@011000220001020002C8	Set to Slow filter
Response:	@011000220001CC	ACK

#### 4. Load Factory Defaults:

#### Descriptions

Command: @011000240001025AA5C9  
Response: @011000240001CA

Set to factory default.  
ACK

#### CHECKSUM CALCULATION :

CSUM = 0 – (Slave\_Add + Function + ... + Last\_data)  
(STX and CSUM are neglected while calculating CSUM)

#### Example

For Medium (1) filter: @011000220001020001XX

CSUM = 0 – ( 01+10+00+22+00+01+02+00+01)  
= 0 – 37  
= C9

Command is @011000220001020001C9 < Carriage Return >

### 4.5 Testing the Scale Performance


You have to check the scale performance by testing the scale eccentricity, scale linearity at loading up to maximum loading value, repeatability etc. before using it.



## 5. Setpoints

### 5.1 Setpoint Connection

FAA-28 has 2 free relay contact output. These outputs can be connected to maximum 230VAC or maximum 30VDC, maximum 1A loads. Reverse diode connection to the DC loads is recommended to increase the relay contact life and to reduce the disturbances. Outputs connection is;

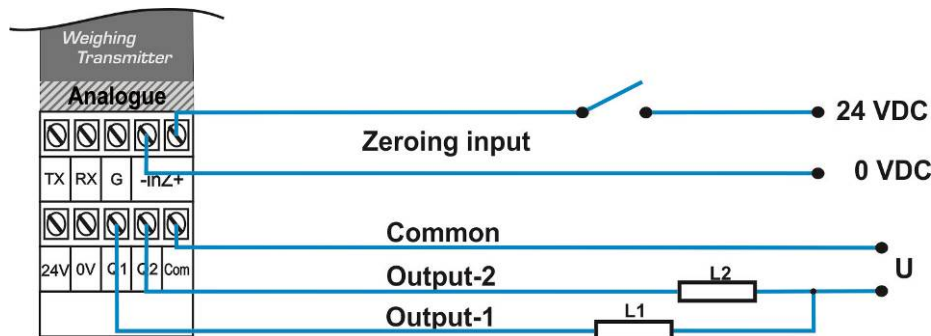

### 5.2 Setpoint Adjustment

The instrument closes the relay contacts if the weight value is higher than the adjusted setpoint. These contact signals can be used to stop charging or discharging or produce alarm signal. You can apply two methods to adjust setpoints.

### 5.3 Adjustment to the Load on the Scale

Setpoint can be adjusted to the load value on the scale:

- Load the scale to the value you want to produce setpoint signal
- Turn the programming switch to **S1** (or **S2**) position from operation position (from **V** or **I** position)
- Turn the Adj. switch to positions **\*** position and turn it back to **0** - position 2 seconds later
- Turn the programming switch to analog output type position for operation mode (**V** or **I** position) or to other setpoint position to adjust it

### 5.4 Adjustment by Measuring the Analog Output

You can adjust the setpoint by measuring the analogue output value without loading the scale:

- Connect the measuring instrument to the analog output.
- Turn the programming switch to **S1** (or **S2**) position from operation position (from **V** or **I** position).
- Increase or decrease the analog output by adjustment rotary switch (refer to table in [section 5.1](#) ).





Do not bring the adjustment switch position to **\*** position in this adjustment. The adjustment switch must be at **0** - position at the end of the adjustment.

- Turn the programming switch to analog output type position to start operation (**V** or **I** position) or to other setpoint position to adjust it.



## 6. Operation Mode

There are 3 LEDs and 2 rotary switches on the front panel of FAA-28. The rotary switches are being used for adjustment as described in [section 4.4](#) and the LEDs have different meanings in operation and setup type as indicated below.

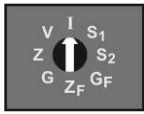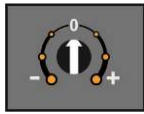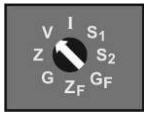Analogue Output Range	Prog. Switch position	Adj. Switch position	TxD & Rx pins	V / I LED (after power on)
4 - 20mA			Open circuited	On
0 - 20mA			Short circuited	Off
0 - 10VDC			Open circuited	Flash
0 - 5VDC			Short circuited	Blinking

The status of the LEDs in the operation type is given in the table below. Refer to [section 9](#) in case of the Err LED turns on.

The analogue output signal also gives information about the status of the system and the weighing process to inform PLC as:

Condition	4-20mA output	0-20mA output	0 – 10V output	0 – 5V output
Operation mode	X	X	X	X
Programming	X	X	X	X
The weight is over the range (Over signal to PLC)	24mA	24mA	11V	5,5V
The weight is under the range (Under signal to PLC)	0mA	0mA	-4.0V	-4.0V
“Error” signal to PLC	0mA	0mA	0V	0V
“ADC is out of operating range” error to PLC	24mA	24mA	11V	5,5V

## 7. Programming With xFace Software Over RS232

FAA-28 has RS232C serial interface to perform eCal electronic calibration and to adjust filter, setpoint values and to follow status by using **xFace** software installed on a PC.

The software xFace can be downloaded from [www.flintec.com](http://www.flintec.com), follow the steps described below.



### 7.1 Installation of xFace Software

- Close all applications on your PC
- Double click “Setup.exe” to start the installation. The setup Wizard will be displayed
- Follow the menus in the setup wizard step by step
- After finishing the installation, the Setup Wizard will inform you about the success of the software installation. Click the OK button
- After closing the Setup Wizard you can start to use the xFace software


### 7.2 xFace Software

For programming instrument via xFace follow the instructions below:

1. Power off the instrument.
2. Connect the instrument to PC as shown in [section 4.5](#) to use xFace software and run the software. Select FAA-28 and press “OK” button.
3. Select the Com-port and press on “Connect” to connect to the instrument.

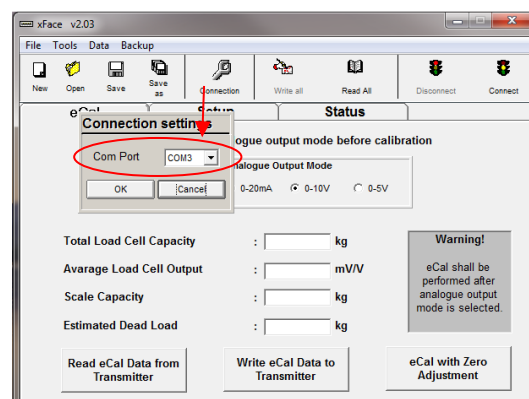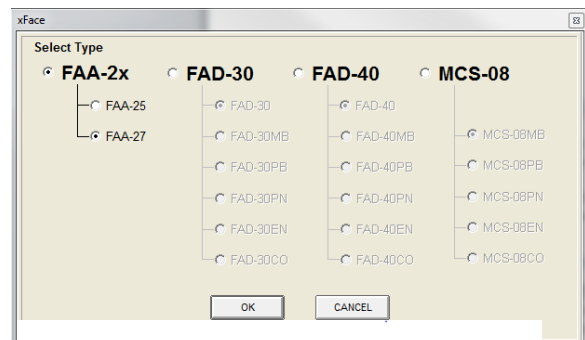

4. Select the analog output type.
5. Enter Total Load Cell capacity, Average Load Cell Output, Scale Capacity and Estimated Dead Load.
6. Press “Write eCal Data to Transmitter” button on the monitor to perform eCal.
7. Unload the scale and Press “eCal with Zero Adjustment” button on the monitor.

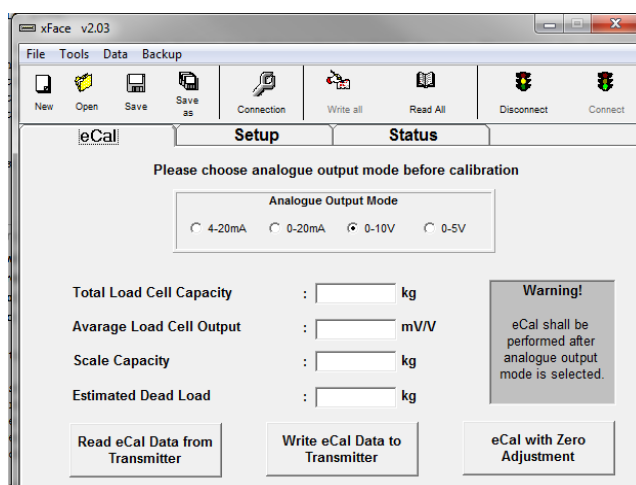

8. Adjust filter value and setpoints in section “Setup”.
9. In section “Status” instrument information are available.
10. Power off the instrument before disconnecting from PC. Bring the programming switch to the analog output type position and apply the connection between TxD and RxD pins which is described in [section 7](#) to set the analog output type.
11. Turn the adjustment switch position to “0” - position.
12. Power on the instrument for operation.

After performing eCal as described in the software, check the performance of your system.

You may adjust to instrument to factory default by xFace, if it is changed before.

## 8. Trouble Shooting

The type FAA-28 amplifier is designed as a very reliable and virtually error free instrument. However, if an error occurs, do not attempt to repair the equipment before you understand what caused the error. Note the status of the front panel LEDs, and try to find the problem with the help of the table given below. Do not let unauthorized people interfere with the instrument.

FRONT PANEL LEDS			DEFINITION
Run	V/I	Err	
Off	Off	Off	<ul style="list-style-type: none"><li>- No power</li><li>- Board failure</li></ul>
On	On	Off	<ul style="list-style-type: none"><li>- Operation in 4 – 20mA output type</li></ul>
On	Off	Off	<ul style="list-style-type: none"><li>- Operation in 0 – 20mA output type</li></ul>
On	Flash	Off	<ul style="list-style-type: none"><li>- Operation in 0 – 10VDC output type</li></ul>
On	Blinking	Off	<ul style="list-style-type: none"><li>- Operation in 0 – 5VDC output type</li></ul>
On	X	On	<ul style="list-style-type: none"><li>- Input signal is out of range</li><li>- Calibration needed</li><li>- Check output circuit and cabling</li><li>- Check voltage of power supply</li><li>- Board failure</li></ul>
Flash	On	On	<ul style="list-style-type: none"><li>- Calibration mode</li><li>- Setting mode</li></ul>

The analogue output also give additional information about the weighing system as described in [section 7](#).



Flintec  
[www.flintec.com](http://www.flintec.com)