

Make Life Easy 

User Manual

Closed-Loop Stepper System

AiC-D Series

MMD-AiCU1-V1.5-2009US

Thank you for purchasing an Autonics product.
This user manual contains information about the product and its proper use,
and should be kept in a place where it will be easy to access.

www.autonics.com

Autonics

Preface

Thank you for purchasing Autonics product.





Please familiarize yourself with the information contained in the Safety Considerations section before using this product.

This user manual contains information about the product and its proper use, and should be kept in a place where it will be easy to access.

User Manual Guide


- Please familiarize yourself with the information in this manual before using the product.
- This manual provides detailed information on the product's features. It does not offer any guarantee concerning matters beyond the scope of this manual.
- This manual may not be edited or reproduced in either part or whole without permission.
- A user manual is not provided as part of the product package. Visit our website (www.autonics.com) to download a copy.
- The manual's content may vary depending on changes to the product's software and other unforeseen developments within Autonics, and is subject to change without prior notice. Upgrade notice is provided through our website.
- We contrived to describe this manual more easily and correctly. However, if there are any corrections or questions, please notify us through our website.


User Manual Symbols

Symbol	Description
 Note	Supplementary information for a particular feature.
 Warning	Failure to follow instructions can result in serious injury or death.
 Caution	Failure to follow instructions can lead to a minor injury or product damage.
 Ex.	An example of the concerned feature's use.
※1	Annotation mark.

Safety Considerations

- Following these safety considerations will ensure the safe and proper use of the product and help prevent accidents, as well as minimizing possible hazards.
- Safety considerations are categorized as Warnings and Cautions, as defined below:

 Warning	Warning	Failure to follow these instructions may result in serious injury or death.
--	----------------	---

 Caution	Caution	Failure to follow these instructions may result in personal injury or product damage.
--	----------------	---

Warning

- Fail-safe device must be installed when using the unit with machinery that may cause serious injury or substantial economic loss. (e.g. nuclear power control, medical equipment, ships, vehicles, railways, aircraft, combustion apparatus, safety equipment, crime/disaster prevention devices, etc.)
Failure to follow this instruction may result in personal injury, economic loss or fire.
- Do not use the unit in the place where flammable/explosive/corrosive gas, high humidity, direct sunlight, radiant heat, vibration, impact, or salinity may be present.
Failure to follow this instruction may result in explosion or fire.
- Do not connect, repair, or inspect the unit while connected to a power source.
Failure to follow this instruction may result in fire or electric shock.
- Install the unit after considering counter plan against power failure.
Failure to follow this instruction may result in personal injury, or economic loss or fire.
- Check 'Connections' before wiring.
Failure to follow this instruction may result in fire.
- Do not disassemble or modify the unit.
Failure to follow this instruction may result in fire or electrical shock.
- Install the driver in the grounded housing or ground it directly.
Failure to follow this instruction may result in personal injury, fire or electric shock.
- Do not touch the unit during or after operation for a while.
Failure to follow this instruction may result in burn or electric shock due to high temperature of the surface.
- Emergency stop directly when error occurs.
Failure to follow this instruction may result in personal injury or fire.

**Caution**

- When connecting the power input, use AWG 18(0.75mm²) cable or over.
- Brake is non-polar. When connecting the brake, use AWG 24 (0.2mm²) cable or over.
Failure to follow this instruction may result in fire or malfunction due to contact failure.
- To use the motor safely, do not apply external force to the motor.
- It is recommended to use STOPPER for the vertical load.
- Install over-current prevention device (e.g. the current breaker, etc.) to connect the driver with power.
Failure to follow this instruction may result in fire.
- Check the control input signal before supplying power to the driver.
Failure to follow this instruction may result in personal injury or product damage by unexpected signal.
- Install a safety device to maintain the vertical position after turn off the power of this driver.
Failure to follow this instruction may result in personal injury or product damage by releasing holding torque of the motor.
- Use the unit within the rated specifications.
Failure to follow this instruction may result in fire or product damage.
- Use dry cloth to clean the unit, and do not use water or organic solvent.
Failure to follow this instruction may result in fire or electric shock.
- The driver may overheat depending on the environment.
Install the unit in the well ventilated place and forced cooling with a cooling fan.
Failure to follow this instruction may result in product damage or degradation by heat.
- Keep the product away from metal chip, dust, and wire residue which flowing into the unit.
Failure to follow this instruction may result in fire or product damage.
- Use the designated motor only.
Failure to follow this instruction may result in fire or product damage.

The above specifications are subject to change and some models may be discontinued without notice.

Be sure to follow cautions written in the instruction manual, user manual and the technical descriptions (catalog, website).

Cautions during Use

- Follow instructions in 'Cautions during Use'.
Otherwise, it may cause unexpected accidents.
- 24VDC power supply should be insulated and limited voltage/current or Class 2, SELV power supply device.
- Re-supply power after min. 1 sec from disconnected power.
- In case communication is unstable due to the noise generated by supplied power or peripheral device, use ferrite core at communication line.
- It is recommended to use 485 converter with the separate power.
(Autonics product, SCM-38I, recommended)
- The thickness of cable should be same or thicker than the motor cable's when extending the motor cable.
 - ① CN1 (power connector): AWG18
 - ② CN2 (motor+encoder connector): AWG22, AWG24
 - ③ CN3 (I/O connector): AWG28
- Keep the distance between power cable and signal cable more than 10cm.
- Motor vibration and noise can occur in specific frequency period
 - ① Change motor installation method or attach the damper.
 - ② Use the unit out of the dedicated frequency range when vibration and noise occurs due to changing motor RUN speed.
- For using motor, it is recommended to maintenance and inspection regularly.
 - ① Unwinding bolts and connection parts for the unit installation and load connection
 - ② Strange sound from ball bearing of the unit
 - ③ Damage and stress of lead cable of the unit
 - ④ Connection error with motor
 - ⑤ Inconsistency between the axis of motor output and the center, concentric (eccentric, declination) of the load, etc.
- This product does not prepare protection function for a motor.
- This unit may be used in the following environments.
 - ① Indoors (in the environment condition rated in 'Specifications')
 - ② Altitude max. 2,000m
 - ③ Pollution degree 2
 - ④ Installation category II

Table of Contents

Preface	iii
User Manual Guide.....	iv
User Manual Symbols	v
Safety Considerations.....	vi
Cautions during Use.....	viii
Table of Contents	ix
1 Product Overview	12
1.1 Features.....	12
1.2 Configuration Diagram and Components.....	13
1.2.1 Configuration Diagram	13
1.2.2 Components.....	13
1.3 Ordering Information	14
1.3.1 Driver	14
1.3.2 Motor	16
1.4 Models.....	18
1.4.1 Standard Type	18
1.4.2 Built-in Brake Type.....	18
2 Specifications	20
2.1 Driver.....	20
2.1.1 Factory Default.....	21
2.2 Motor	22
2.2.1 Frame Size 20mm.....	22
2.2.2 Frame Size 28mm.....	22
2.2.3 Frame Size 35mm.....	22
2.2.4 Frame Size 42mm.....	23
2.2.5 Frame Size 56mm.....	23
2.2.6 Frame Size 60mm.....	23
2.2.7 Common Specifications	24
2.2.8 Brake.....	25
2.2.9 Encoder.....	26
3 Dimensions	27
3.1 Driver.....	27
3.2 Motor	28
3.2.1 Standard Type	28
3.2.2 Built-in Brake Type.....	32
4 Installation of Motor	35
4.1 Mounting Direction of Motor.....	35
4.2 Mounting of Motor	36
4.2.1 Frame Size 20mm.....	36
4.2.2 Frame Size 28mm.....	36
4.2.3 Frame Size 35mm.....	36
4.2.4 Frame Size 42mm.....	37
4.2.5 Frame Size 56mm / Frame Size 60mm	37

4.3	Connection with Load	38
4.3.1	Direct Load Connection with Coupling.....	38
4.3.2	Load Connection with Pulley, Belt, and Wire	38
4.3.3	Load Connection with Gear	38
4.4	Installation Conditions.....	39
5	Connection	40
5.1	Standard Type	40
5.2	Built-in Brake Type	41
6	Characteristics	42
6.1	Standard Type	42
6.1.1	Frame Size 20mm.....	42
6.1.2	Frame Size 28mm.....	42
6.1.3	Frame Size 35mm.....	42
6.1.4	Frame Size 42mm.....	43
6.1.5	Frame Size 56mm.....	43
6.1.6	Frame Size 60mm.....	43
6.2	Built-in Brake Type	44
6.2.1	Frame Size 42mm.....	44
6.2.2	Frame Size 56mm.....	44
6.2.3	Frame Size 60mm.....	44
7	Driver Unit Descriptions	46
7.1	Connectors.....	47
7.1.1	CN1: Power Connector.....	47
7.1.2	CN2: Motor+Encoder Connector	47
7.1.3	CN3: I/O Connector	48
7.1.4	CN4: RS485 Communication Cable Connector	49
7.2	Connector Specifications.....	50
7.3	Switches.....	50
7.3.1	SW1: ID Setting Switch.....	50
7.3.2	SW2: ID Setting/Terminating Resistance DIP Switch	51
7.4	Driver Status Indicator	51
7.5	Sold Separately.....	52
7.5.1	I/O Cable (CO50-MP□-R, standard: AiC TAG).....	52
7.5.2	Power Cable (CJ-PW-□)	53
7.5.3	Motor+Encoder Cable (normal: C1D14M-□/moving: C1DF14M-□).....	53
8	Control Input/Output.....	54
8.1	Input.....	54
8.1.1	Exclusive Input (20)	54
8.1.2	General Input (9)	60
8.1.3	Example of Input Circuit Connection	60
8.2	Output.....	61
8.2.1	Exclusive Output (AiC-D: 4, AiC-D-B: 6).....	61
8.2.2	General Output (AiC-D: 10, AiC-D-B: 9).....	63
8.2.3	Example of Output Circuit Connection	63
8.2.4	Brake Output	63
9	Drive.....	64

9.1	I/O Signal Control Drive	64
9.1.1	Index Drive.....	64
9.1.2	Jog Drive.....	66
9.1.3	Continuous Drive	68
9.1.4	Program Drive	70
9.1.5	Home Search.....	70
9.2	atMotion Control Drive.....	76
9.2.1	Jog Mode.....	80
9.2.2	Continuous Mode.....	81
9.2.3	Position Mode	82
9.2.4	Program Mode.....	84
9.2.5	Home Search Mode.....	85
10	Program Instructions.....	90
10.1	Drive Instruction	91
10.1.1	ABS (absolute position move)	91
10.1.2	INC (relative position move).....	93
10.1.3	HOM (home search)	94
10.2	Input/Output Instruction	95
10.2.1	ICJ (input condition jump)	95
10.2.2	IRD (input wait)	95
10.2.3	OPC (output port ON/OFF)	95
10.2.4	OPT (output port ON pulse)	96
10.2.5	CMP (compare output)	96
10.3	Program Control Instruction.....	97
10.3.1	JMP (jump).....	97
10.3.2	REP (repeat start).....	97
10.3.3	RPE (repeat end)	98
10.3.4	END (program end)	98
10.3.5	POS (position set)	98
10.3.6	TIM (ready).....	98
11	Driver Function.....	99
11.1	General Drive	99
11.1.1	Fixed Pulse and Continuous Pulse Drive	99
11.1.2	Speed Curve	101
11.2	Other Functions.....	106
11.2.1	Limit Operation.....	106
11.2.2	Position Control Gain Setting.....	107
11.2.3	Stop Current	108
11.2.4	Stop Current Fix	108
11.2.5	Speed Filter	108
11.2.6	In-Position	109
11.2.7	Servo Off.....	110
11.2.8	Motor Direction	110
11.2.9	Position Override	110
12	Protection Function.....	111
12.1	Alarm	111
12.2	Warning.....	114
13	Troubleshooting.....	115

1 Product Overview


1.1 Features

AiC Series is 2-phase closed-loop stepper motor drivers feature integrated controllers, which allow direct control via network connection with master control devices, offering easy programming, connection, and installation. The drivers offer a low cost closed-loop system compared to servo motors, with quick response rates for better continuous operation. This series also features encoder resolution upto 16,000 pulses per revolution, offering high precision control down to 0.0225°. 17 alarm outputs are available for safe and stable operation.

- Motor+driver integrated controller type
- Low cost closed loop system compared to servo motors with quick response rates for better continuous drive operation
- Brakes are applied during sudden power outages, allowing safe control of vertical loads (built-in brake type)
- Control up to 31 axes with RS485 communication
- 14 control commands and up to 256 steps of operation programming
- 4 operation modes: jog mode, continuous mode, index mode, program mode
- 50-pin I/O offers flexible wiring options
- C language library provided (32-bit, 64-bit)
- Windows-based motion control software (atMotion) provided
- Low vibration during low speed drive and high torque during high speed drive
- No tuning required (easy gain setting using adjuster)
- Holding torque and no vibration (hunting) during position hold make it ideal for precision machines including optical inspection
- 10-stage resolution setting
- Various alarm outputs: overcurrent, overspeed, overheating, motor connection error, encoder connection error, etc. (17 alarms)
- Supported motor frame sizes: 20 mm, 28 mm, 35 mm, 42 mm, 56 mm, 60 mm

1.2 Configuration Diagram and Components


1.2.1 Configuration Diagram

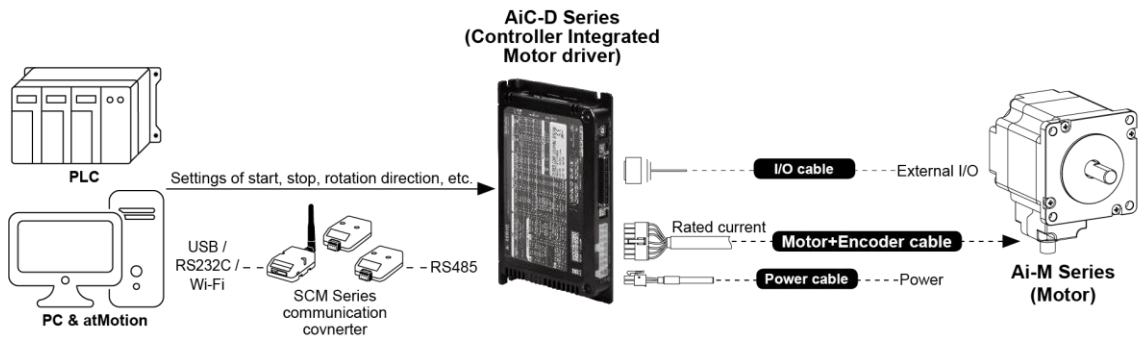


※ I/O cable, motor+encoder cable and power cable are sold separately.
For more information, refer to the '7.5 Sold Separately'.

1.2.2 Components

1.2.2.1 Driver

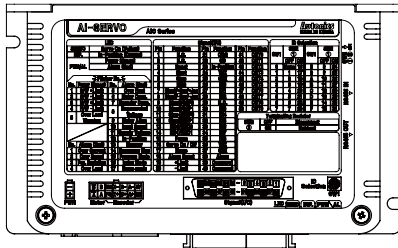


AiC-D Series

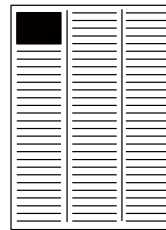


Instruction manual

1.2.2.2 Motor

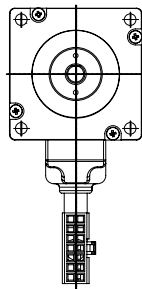

Ai-M Series

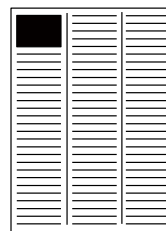

Instruction manual



 
Note

Make sure all of the above components are included with your product package before use.
If a component is missing or damaged, please contact Autonics or your distributor.

1.3 Ordering Information


1.3.1 Driver

(1) Frame size 20 / 28 / 35mm



Item	Description	
① Series	Ai	Artificial intelligent
② Category	C	Controller
③ Item	D	Driver
④ Motor frame size	20	20×20mm
	28	28×28mm
	35	35×35mm
⑤ Motor length	S	Short - Frame size 28mm: 46mm, Frame size 35mm: 41.5mm
	M	Middle - Frame size 20mm: 41.2mm, Frame size 28mm: 59mm, Frame size 35mm: 52mm
	L	Long - Frame size 20mm: 53.1mm, Frame size 28mm: 65mm, Frame size 35mm: 68.5mm
⑥ Encoder resolution	A	4,000PPR (1,000PPR x 4-multiply)
	B	16,000PPR (4,000PPR x 4-multiply)

 
(2) Frame size 42 / 56 / 60mm



Item	Description		
① Series	Ai	Artificial intelligent	
② Category	C	Controller	
③ Item	D	Driver	
④ Motor frame size	42	42×42mm	
	56	57.2×57.2mm	
	60	60×60mm	
⑤ Motor length	Standard Type	S	Short - Frame size 42mm: 67.5mm, Frame size 56mm: 77.3mm, Frame size 60mm: 81.9mm
		M	Middle - Frame size 42mm: 73.5mm, Frame size 56mm: 90.3mm, Frame size 60mm: 102.8mm
		L	Long - Frame size 42mm: 81.5mm, Frame size 56mm: 111.3mm, Frame size 60mm: 119.8mm
	Built-in Brake type	S	Short - Frame size 42mm: 102.3mm, Frame size 56mm: 112.1mm, Frame size 60mm: 116.7mm
		M	Middle - Frame size 42mm: 108.3mm, Frame size 56mm: 125.1mm, Frame size 60mm: 137.6mm
		L	Long - Frame size 42mm: 116.3mm, Frame size 56mm: 146.1mm, Frame size 60mm: 154.6mm
⑥ Encoder resolution	A	10,000PPR (2,500PPR x 4-multiply)	
⑦ Brake	No mark	Standard Type	
	B	Built-in Brake type	


1.3.2 Motor

 (1) Frame size 20 / 28 / 35mm



Item	Description	
① Series	Ai	Artificial intelligent
② Item	M	Motor
③ Motor frame size	20	20×20mm
	28	28×28mm
	35	35×35mm
④ Motor length	S	Short - Frame size 28mm: 46mm, Frame size 35mm: 41.5mm
	M	Middle - Frame size 20mm: 41.2mm, Frame size 28mm: 59mm Frame size 35mm: 52mm
	L	Long - Frame size 20mm: 53.1mm, Frame size 28mm: 65mm, Frame size 35mm: 68.5mm
⑤ Encoder resolution	A	4,000PPR (1,000PPR x 4-multiply)
	B	16,000PPR (4,000PPR x 4-multiply)

 (2) Frame size 42 / 56 / 60mm



Item		Description		
①	Series	Ai	Artificial intelligent	
②	Item	M	Motor	
③	Motor frame size	42	42×42mm	
		56	57.2×57.2mm	
		60	60×60mm	
④	Motor length	Standard Type	S	Short - Frame size 42mm: 67.5mm, Frame size 56mm: 77.3mm, Frame size 60mm: 81.9mm
			M	Middle - Frame size 42mm: 73.5mm, Frame size 56mm: 90.3mm, Frame size 60mm: 102.8mm
			L	Long - Frame size 42mm: 81.5mm, Frame size 56mm: 111.3mm, Frame size 60mm: 119.8mm
	Built-in Brake type	S	Short - Frame size 42mm: 102.3mm, Frame size 56mm: 112.1mm, Frame size 60mm: 116.7mm	
		M	Middle - Frame size 42mm: 108.3mm, Frame size 56mm: 125.1mm, Frame size 60mm: 137.6mm	
		L	Long - Frame size 42mm: 116.3mm, Frame size 56mm: 146.1mm, Frame size 60mm: 154.6mm	
⑤	Encoder resolution	A	10,000PPR (2,500PPR x 4-multiply)	
⑥	Brake	No mark	Standard Type	
		B	Built-in Brake type	

1.4 Models

1.4.1 Standard Type

(1) Frame size 20 / 28 / 35mm

Set	Driver	Motor
AiC-20MA	AiC-D-20MA	Ai-M-20MA
AiC-20LA	AiC-D-20LA	Ai-M-20LA
AiC-28SB	AiC-D-28SB	Ai-M-28SB
AiC-28MB	AiC-D-28MB	Ai-M-28MB
AiC-28LB	AiC-D-28LB	Ai-M-28LB
AiC-35SB	AiC-D-35SB	Ai-M-35SB
AiC-35MB	AiC-D-35MB	Ai-M-35MB
AiC-35LB	AiC-D-35LB	Ai-M-35LB

(2) Frame size 42 / 56 / 60mm

Set	Driver	Motor
AiC-42SA	AiC-D-42SA	Ai-M-42SA
AiC-42MA	AiC-D-42MA	Ai-M-42MA
AiC-42LA	AiC-D-42LA	Ai-M-42LA
AiC-56SA	AiC-D-56SA	Ai-M-56SA
AiC-56MA	AiC-D-56MA	Ai-M-56MA
AiC-56LA	AiC-D-56LA	Ai-M-56LA
AiC-60SA	AiC-D-60SA	Ai-M-60SA
AiC-60MA	AiC-D-60MA	Ai-M-60MA
AiC-60LA	AiC-D-60LA	Ai-M-60LA

1.4.2 Built-in Brake Type

Set	Driver	Motor
AiC-42SA-B	AiC-D-42SA-B	Ai-M-42SA-B
AiC-42MA-B	AiC-D-42MA-B	Ai-M-42MA-B
AiC-42LA-B	AiC-D-42LA-B	Ai-M-42LA-B
AiC-56SA-B	AiC-D-56SA-B	Ai-M-56SA-B
AiC-56MA-B	AiC-D-56MA-B	Ai-M-56MA-B
AiC-56LA-B	AiC-D-56LA-B	Ai-M-56LA-B
AiC-60SA-B	AiC-D-60SA-B	Ai-M-60SA-B
AiC-60MA-B	AiC-D-60MA-B	Ai-M-60MA-B
AiC-60LA-B	AiC-D-60LA-B	Ai-M-60LA-B

2 Specifications

2.1 Driver

Model ^{※1}	–	AiC-D-28SB	AiC-D-35SB	AiC-D-42SA(-B)	AiC-D-56SA(-B)	AiC-D-60SA(-B)	
	AiC-D-20MA	AiC-D-28MB	AiC-D-35MB	AiC-D-42MA(-B)	AiC-D-56MA(-B)	AiC-D-60MA(-B)	
	AiC-D-20LA	AiC-D-28LB	AiC-D-35LB	AiC-D-42LA(-B)	AiC-D-56LA(-B)	AiC-D-60LA(-B)	
Power supply	24VDC \equiv						
Allowable voltage range	90 to 110% of the rated voltage						
Power consumption	STOP ^{※2}	Max. 10W			Max. 10W	Max. 12W	Max. 15W
	Max. during operation ^{※3}	Max. 60W			Max. 60W	Max. 120W	Max. 240W
Max. RUN current ^{※4}	0.6A/Phase	1.0A/Phase	1.2A/Phase	1.7A/Phase	3.5A/Phase		
STOP current ^{※4}	20 to 100% of max. RUN current (factory default: 50%)						
Rotation speed	0 to 3000rpm						
Resolution ^{※5}	500, 1000, 1600, 2000, 3600, 4000, 5000, 6400, 7200, 10000 PPR	500, 1000, 1600, 2000, 3600, 5000, 6400, 7200, 10000, 16000 PPR		500, 1000, 1600, 2000, 3200, 3600, 5000, 6400, 7200, 10000 PPR			
Speed filter ^{※5}	0 (disable), 2, 4, 6, 8, 10, 20, 40, 60, 80, 100, 120, 140, 160, 180, 200 ms						
Positioning gain ^{※5}	(P Gain, I Gain) = (1, 1), (2, 1), (3, 1), (4, 1), (5, 1), (1, 2), (2, 2), (3, 2), (4, 2), (5, 2), (1, 3), (2, 3), (3, 3), (4, 3), (5, 3), user setting						
Positioning range	-2,147,483,648 to +2,147,483,647						
In-Position	Fast Response: 0 to 7 or Accurate Response: setting range among 0 to 7						
Motor rotation direction ^{※5}	CW, CCW						
Status indicator	<ul style="list-style-type: none"> Power/Warning indicator: green LED In-Position indicator: yellow LED RS485 DATA IN/OUT indicator: green/yellow LED 			<ul style="list-style-type: none"> Alarm indicator: red LED Servo On/Off indicator: orange LED 			
I/O voltage level	[H]: 5-30VDC \equiv , [L]: 0-2VDC \equiv						
I/O	Input ^{※6}	Exclusive input: 20, general input: 9					
	Output	<ul style="list-style-type: none"> Standard type - exclusive output: 4, general output: 10 Built-in brake type - exclusive output: 6, general output: 9 					
External power supply	VEX (recommended: 24VDC \equiv): 2, GEX (GND): 2						
Operation mode	Jog / Continuous / Index / Program mode						
Index step numbers	64 steps						
Program function	Steps	256 steps					
	Control command	ABS (move absolute position), INC (move incremental position), HOM (home search), ICJ (jump input condition), IRD (waiting input), OPC (on/off of output port), OPT (on pulse from output port), JMP (jump), REP (start repetition), RPE (end repetition), END (end program), POS (position set), TIM (timer), CMP (compare output)					
	Start	Power ON program start function					
	Home search	Power ON home search function					
Home search mode	Home, limit home, zero home, torque home						

RS485 comm.	Comm. speed ※5	9600, 19200, 38400, 57600, 115200(factory default) bps
Multiaxial control		31-axis
ID setting switch		16-bit rotary switch (0 to F), 1-bit piano switch
Alarm output		Over current, over speed, position tracking, over load, over heat, motor connection, encoder connection, regenerative voltage, motor misalignment, command speed, input voltage, in-position, memory, emergency stop, program drive, index drive, home search drive
Warning output		+software limit, +hardware limit, -software limit, -hardware limit, over load, position override
Insulation resistance		Over 100MΩ (at 500VDC megger)
Dielectric strength		1,000VAC 60Hz for 1 min
Vibration		1.5mm amplitude at frequency of 10 to 55Hz (for 1 min) in each X, Y, Z direction for 2 hours
Shock		300m/s ² (approx. 30G) in each X, Y, Z direction for 3 times
Environment	Ambient temp.	0 to 50°C, storage: -10 to 60°C
	Ambient humi.	35 to 85%RH, storage: 10 to 90%RH
Approval		CE
Protection structure		IP20 (IEC standard)
Weight ※7		Approx. 460g (approx. 300g)

※1: The model name indicates driver type (none: standard type, B: built-in brake type)

E.g.) AiC-D-60MA-B: built-in brake type stepping motor driver.

※2: Based on the ambient temperature 25°C, ambient humidity 55%RH, and STOP current 50%.

※3: Max. power consumption during operation. When changing the load rapidly, instantaneous peak current may increase. The capacity of power supply should be over 1.5 to 2 times of max. power consumption.

※4: RUN current varies depending on the input RUN frequency and max. RUN current at the moment varies also.

※5: Settable with the dedicated program.

※6: Brake ON/OFF function can be changed in general input IN8 in case of built-in brake type only.

※7: The weight includes packaging. The weight in parenthesis is for unit only.

※Environment resistance is rated at no freezing or condensation.

2.1.1 Factory Default

Function		Factory default
Resolution		500 PPR
Speed filter		0
Motor GAIN		60 ms
In-Position		0
Communication speed		115,200 bps
Communication ID setting switch (ID Sel)		1
Communication ID setting / Terminating resistance setting DIP switch (ID, TERM)	Communication ID setting (ID)	OFF

2.2 Motor

2.2.1 Frame Size 20mm

Model	Ai-M-20MA	Ai-M-20LA
Max. stop torque ^{※1}	0.183kgf·cm(0.018N·m)	0.357kgf·cm(0.035N·m)
Rotor moment of inertia	2g·cm ² (2 x 10 ⁻⁷ kg·m ²)	
Rated current	0.6A/Phase	
Resistance	6.6Ω/Phase ±10%	10.5Ω/Phase ±10%
Inductance	2.1mH/Phase ±20%	4.0mH/Phase ±20%
Weight ^{※2}	Approx. 0.192kg (approx. 0.092kg)	Approx. 0.219kg (approx. 0.120kg)

2.2.2 Frame Size 28mm

Model	Ai-M-28SB	Ai-M-28MB	Ai-M-28MB
Max. stop torque ^{※1}	0.51kgf·cm(0.05N·m)	1.42kgf·cm(0.14N·m)	1.63kgf·cm(0.16N·m)
Rotor moment of inertia	9g·cm ² (9 x 10 ⁻⁷ kg·m ²)	12g·cm ² (12 x 10 ⁻⁷ kg·m ²)	18g·cm ² (18 x 10 ⁻⁷ kg·m ²)
Rated current	1.0A/Phase		
Resistance	5.78Ω/Phase ±10%	8.8Ω/Phase ±10%	10.1Ω/Phase ±10%
Inductance	3.2mH/Phase ±20%	6.0mH/Phase ±20%	6.2mH/Phase ±20%
Weight ^{※2}	Approx. 0.260kg (approx. 0.162kg)	Approx. 0.318kg (approx. 0.222kg)	Approx. 0.342kg (approx. 0.248kg)

2.2.3 Frame Size 35mm

Model	Ai-M-35SB	Ai-M-35MB	Ai-M-35LB
Max. stop torque ^{※1}	0.714kgf·cm(0.07N·m)	1.326kgf·cm(0.13N·m)	3.162kgf·cm(0.31N·m)
Rotor moment of inertia	8g·cm ² (8 x 10 ⁻⁷ kg·m ²)	14g·cm ² (14 x 10 ⁻⁷ kg·m ²)	22g·cm ² (22 x 10 ⁻⁷ kg·m ²)
Rated current	1.2A/Phase		
Resistance	2.1Ω/Phase ±10%	3.25Ω/Phase ±10%	5.0Ω/Phase ±10%
Inductance	1.25mH/Phase ±20%	2.85mH/Phase ±20%	5.6mH/Phase ±20%
Weight ^{※2}	Approx. 0.278kg (approx. 0.180kg)	Approx. 0.347kg (approx. 0.250kg)	Approx. 0.456kg (approx. 0.366kg)

※1: Max. holding torque is standard torque when supplying the rated current (2-phase holding) and stopping the motor for comparing the specifications of motors.

※2: The weight includes packaging. The weight in parenthesis is for unit only.

2.2.4 Frame Size 42mm

Model		Ai-M-42SA-□	Ai-M-42MA-□	Ai-M-42LA-□
Max. stop torque ^{*1}		2.55kgf.cm (0.25N.m)	4.08kgf.cm (0.4N.m)	4.89kgf.cm (0.48N.m)
Rotor moment of inertia		35g.cm ² (35 x 10 ⁻⁷ kg.m ²)	54g.cm ² (54 x 10 ⁻⁷ kg.m ²)	77g.cm ² (77 x 10 ⁻⁷ kg.m ²)
Rated current		1.7A/Phase		
Resistance		1.7Ω/Phase ±10%	1.85Ω/Phase ±10%	2.1Ω/Phase ±10%
Inductance		1.9mH/Phase ±20%	3.5mH/Phase ±20%	4.4mH/Phase ±20%
Weight ^{*2}	Standard Type	Approx. 0.45kg (approx. 0.34kg)	Approx. 0.52kg (approx. 0.41kg)	Approx. 0.59kg (approx. 0.48kg)
	Built-in brake type	Approx. 0.77kg (approx. 0.67kg)	Approx. 0.83kg (approx. 0.73kg)	Approx. 0.90kg (approx. 0.80kg)

2.2.5 Frame Size 56mm

Model		Ai-M-56SA-□	Ai-M-56MA-□	Ai-M-56LA-□
Max. stop torque ^{*1}		6.12kgf.cm (0.6N.m)	12.24kgf.cm (1.2N.m)	20.39kgf.cm (2.0N.m)
Rotor moment of inertia		140g.cm ² (140 x 10 ⁻⁷ kg.m ²)	280g.cm ² (280 x 10 ⁻⁷ kg.m ²)	480g.cm ² (480 x 10 ⁻⁷ kg.m ²)
Rated current		3.5A/Phase		
Resistance		0.55Ω/Phase ±10%	0.57Ω/Phase ±10%	0.93Ω/Phase ±10%
Inductance		1.05mH/Phase ±20%	1.8mH/Phase ±20%	3.7mH/Phase ±20%
Weight ^{*2}	Standard Type	Approx. 0.76kg (approx. 0.62kg)	Approx. 0.99kg (approx. 0.85kg)	Approx. 1.36kg (approx. 1.22kg)
	Built-in brake type	Approx. 1.30kg (approx. 1.15kg)	Approx. 1.52kg (approx. 1.38kg)	Approx. 1.90kg (approx. 1.75kg)

2.2.6 Frame Size 60mm

Model		Ai-M-60SA-□	Ai-M-60MA-□	Ai-M-60LA-□
Max. stop torque ^{*1}		11.22kgf.cm (1.1N.m)	22.43kgf.cm (2.2N.m)	29.57kgf.cm (2.9N.m)
Rotor moment of inertia		240g.cm ² (240 x 10 ⁻⁷ kg.m ²)	490g.cm ² (490 x 10 ⁻⁷ kg.m ²)	690g.cm ² (690 x 10 ⁻⁷ kg.m ²)
Rated current		3.5A/Phase		
Resistance		1.0Ω/Phase ±10%	1.23Ω/Phase ±10%	1.3Ω/Phase ±10%
Inductance		1.5mH/Phase ±20%	2.6mH/Phase ±20%	3.8mH/Phase ±20%
Weight ^{*2}	Standard Type	Approx. 0.89kg (approx. 0.75kg)	Approx. 1.27kg (approx. 1.13kg)	Approx. 1.58kg (approx. 1.44kg)
	Built-in brake type	Approx. 1.53kg (approx. 1.36kg)	Approx. 1.90kg (approx. 1.74kg)	Approx. 2.23kg (approx. 2.07kg)

※1: Max. holding torque is standard torque when supplying the rated current (2-phase holding) and stopping the motor for comparing the specifications of motors.


※2: The weight includes packaging. The weight in parenthesis is for unit only.

2.2.7 Common Specifications

Standard step angle	1.8° / 0.9° (Full / Half step)	
Motor phase	2 phase	
Run method	Bipolar	
Insulation class	B type (130°C)	
Insulation resistance	Over 100MΩ (at 500VDC megger) between motor coil-case	
Dielectric strength	500VAC 50/60Hz for 1 min between motor coil-case	
Vibration	1.5mm amplitude at frequency of 10 to 55Hz (for 1 min) in each X, Y, Z direction for 2 hours	
Shock	Approx. max. 50G	
Environment	Ambient temperature	0 to 50°C, storage: -20 to 70°C
	Ambient humidity	20 to 85%RH, storage: 15 to 90%RH
Approval	CE	
Protection structure	IP30 (IEC34-5 standard)	
Stop angle error ^{※1}	±0.09°	
Shaft vibration ^{※2}	0.03mm T.I.R.	
Radial movement ^{※3}	Frame size 20 / 28 / 35mm	Max. 0.025mm (load 450g)
	Frame size 42 / 56 / 60mm	Max. 0.025mm (load 25N)
Axial movement ^{※4}	Frame size 20 / 28 / 35mm	Max. 0.005mm (load 920g)
	Frame size 42 / 56 / 60mm	Max. 0.01mm (load 50N)
Concentricity for shaft of setup in-low	0.05mm T.I.R.	
Perpendicularity of set-up plate shaft	0.075mm T.I.R.	

※1: Specifications are for full-step angle, without load. (Values may vary by load size)

※2: T.I.R. (Total Indicator Reading): Indicate total dial gauge quantity in case of one complete rotating monitored reference around a base point.

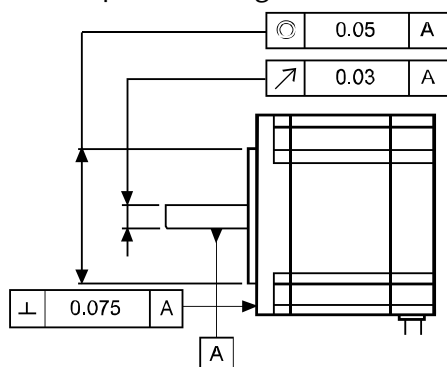

※3: Amount of radial shaft displacement when adding a radial load (450g – frame size 20 / 28 / 35mm, 25N – frame size 42 / 56 / 60mm) to the tip of the motor shaft.

※4: Amount of axial shaft displacement when adding an axial load (920g – frame size 20 / 28 / 35mm, 50N – frame size 42 / 56 / 60mm) to the shaft.

※Environment resistance is rated at no freezing or condensation.

2.2.8 Brake

Model	Frame size 42mm	Frame size 56mm	Frame size 60mm
Rated excitation voltage ^{※1}	24VDC \pm 10%		
Rated excitation current	0.208A	0.275A	
Static friction torque	Min. 1.8kgf.cm	Min. 8.0kgf.cm	
Rotation part inertia	6 g.cm ²	19 g.cm ²	
Insulation class	B type (130°C)		
B type brake	Power on: brake is released, power off: brake is operating		
Operating time	Max. 25ms	Max. 30ms	
Releasing time	Max. 10ms	Max. 20ms	

※1: Driver reduces power voltage from 24VDC to 11.5VDC and control the motor to reduce heat generation in the brake which is connected with the motor.

2.2.9 Encoder

(1) Frame size 20 / 28 / 32mm

Item		Magnetic INCREMENTAL rotary encoder		
Resolution	Frame size 20mm		4,000PPR (1,000PPR x 4-multiply)	
	Frame size 28 / 35mm		16,000PPR (4,000PPR x 4-multiply)	
Electrical specification	Output phase		A, \bar{A} , B, \bar{B} , Z, \bar{Z}	
	Output duty ratio		$\frac{T}{2} \pm \frac{T}{3}$ (T = 1 cycle of A phase)	
	Phase difference of output		Output between A and B phase: $\frac{T}{4} \pm \frac{T}{4}$ (T = 1 cycle of A phase)	
	Control output	Line driver output	<ul style="list-style-type: none"> • [Low] – Load current: max. 20mA, Residual voltage: max. 0.5VDC • [High] – Load current: max. -20mA, Output voltage: max. 2.5VDC 	
	Response time (rise, fall)	Frame size 20mm	Max. 1.5 μ s (cable length: 2m, I sink=20mA)	
		Frame size 28 / 35mm	Max. 1 μ s (cable length: 2m, I sink=20mA)	
	Max. response frequency	Frame size 20mm	200kHz	
		Frame size 28 / 35mm	1,000kHz	
	Power supply		5VDC \pm 5% (ripple P-P: max. 5%)	
	Current consumption		Max. 50mA (disconnection of the load)	


(2) Frame size 42 / 56 / 60mm

Item		INCREMENTAL rotary encoder		
Resolution		10,000PPR (2,500PPR x 4 -multiply)		
Electrical specification	Output phase		A, \bar{A} , B, \bar{B} , Z, \bar{Z}	
	Output duty ratio		$\frac{T}{2} \pm \frac{T}{4}$ (T = 1 cycle of A phase)	
	Phase difference of output		Output between A and B phase: $\frac{T}{4} \pm \frac{T}{8}$ (T = 1 cycle of A phase)	
	Control output	Line driver output	<ul style="list-style-type: none"> • [Low] – Load current: max. 20mA, Residual voltage: max. 0.5VDC • [High] – Load current: max. -20mA, Output voltage: max. 2.5VDC 	
	Response time (rise, fall)		Max. 0.5 μ s (cable length: 2m, I sink=20mA)	
	Max. response frequency		300kHz	
	Power supply		5VDC \pm 5% (ripple P-P: max. 5%)	
	Current consumption		Max. 50mA (disconnection of the load)	

3 Dimensions

3.1 Driver

(unit: mm)

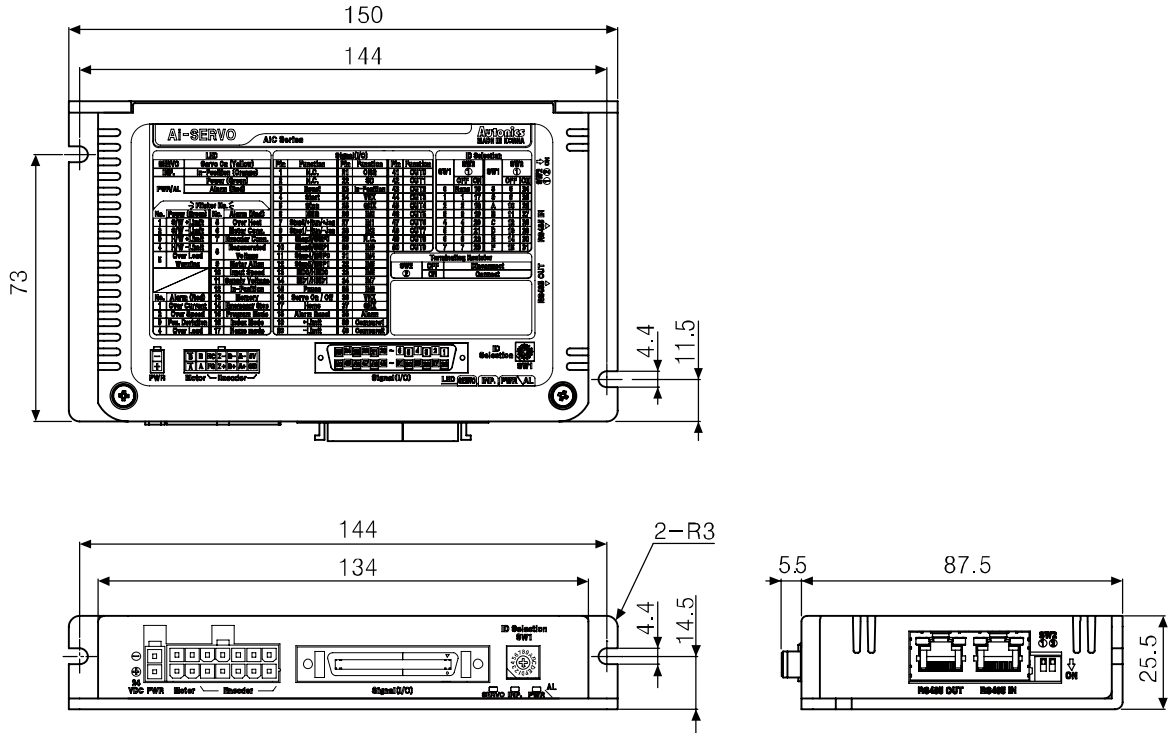


Note

Be sure that these figures may differ from the actual units.


3.2 Motor

3.2.1 Standard Type


3.2.1.1 Frame Size 20mm

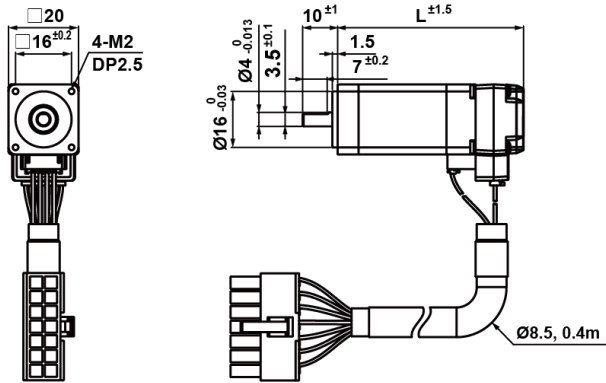

3.2.1.2 Frame Size 28mm

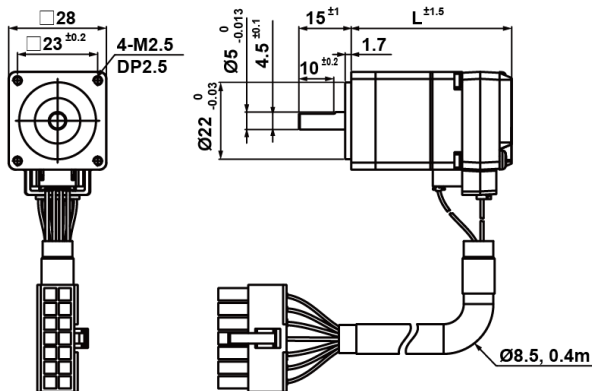



3.2.1.3 Frame Size 35mm

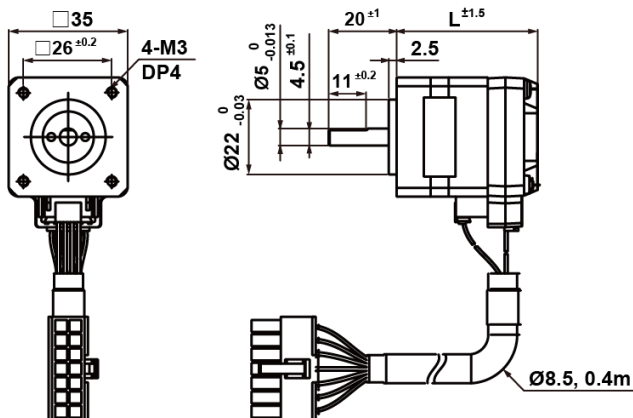



**Note**

Model	L	Model	L	Model	L
—		Ai-M-28SB	46	Ai-M-35SB	41.5
Ai-M-20MA	41.2	Ai-M-28MB	59	Ai-M-35MB	52
Ai-M-20LA	53.1	Ai-M-28LB	65	Ai-M-35LB	68.5



3.2.1.4 Frame Size 42mm

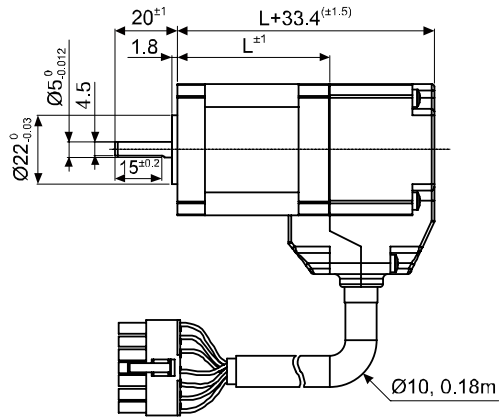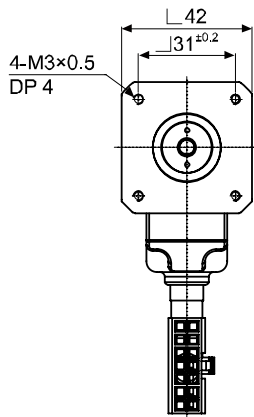

3.2.1.5 Frame Size 56mm

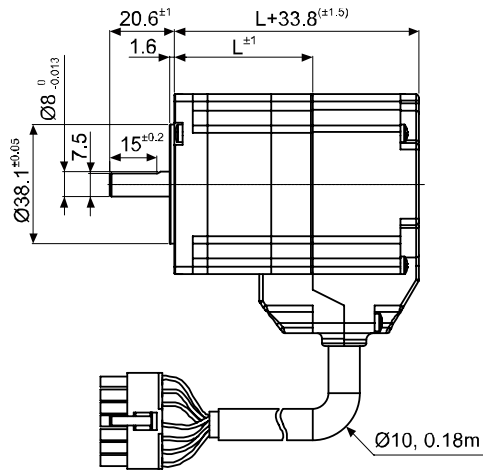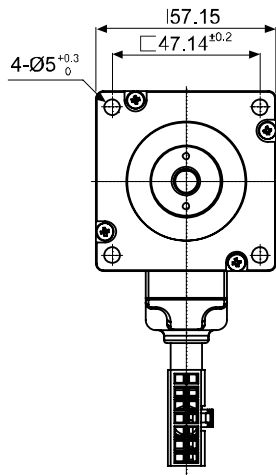

3.2.1.6 Frame Size 60mm

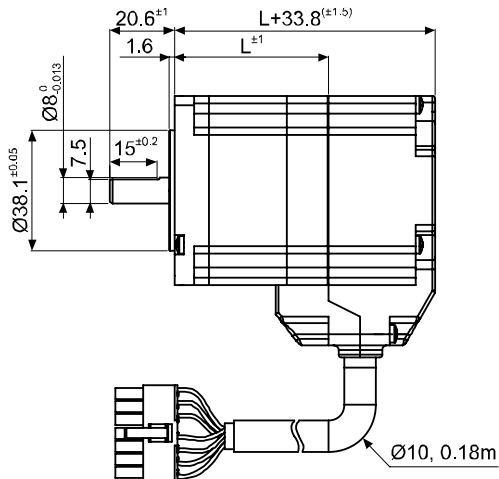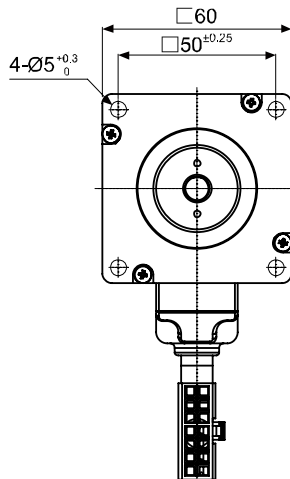


**Note**


Model	L	Model	L	Model	L
Ai-M-42SA	34.1	Ai-M-56SA	43.5	Ai-M-60SA	48.1
Ai-M-42MA	40.1	Ai-M-56MA	56.5	Ai-M-60MA	69
Ai-M-42LA	48.1	Ai-M-56LA	77.5	Ai-M-60LA	86

3.2.2 Built-in Brake Type


3.2.2.1 Frame Size 42mm

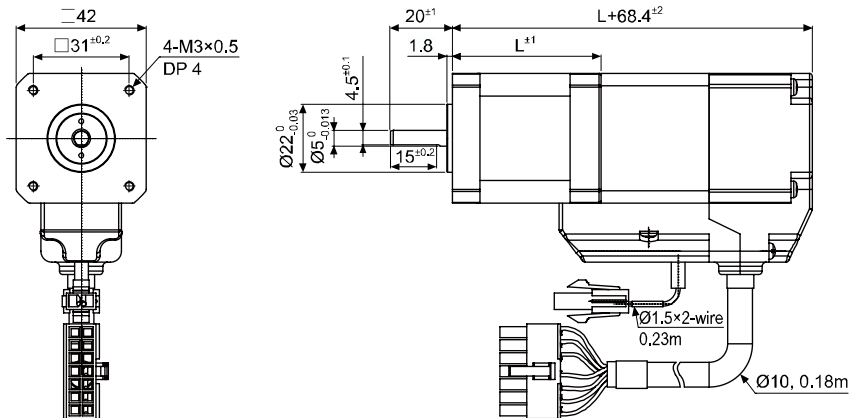

3.2.2.2 Frame Size 56mm

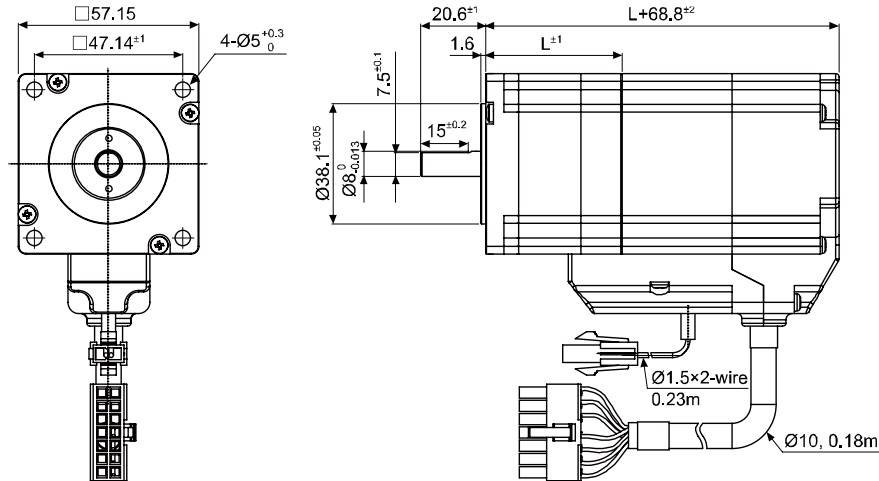

3.2.2.3 Frame Size 60mm

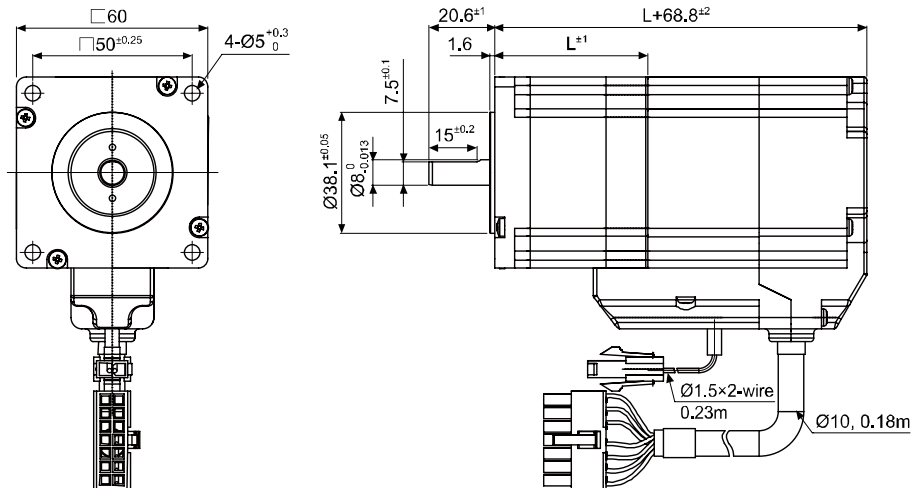

**Note**


Model	L	Model	L	Model	L
Ai-M-42SA-B	33.9	Ai-M-56SA-B	43.3	Ai-M-60SA-B	47.9
Ai-M-42MA-B	39.9	Ai-M-56MA-B	56.3	Ai-M-60MA-B	68.8
Ai-M-42LA-B	47.9	Ai-M-56LA-B	77.3	Ai-M-60LA-B	85.8

4 Installation of Motor

4.1 Mounting Direction of Motor

Motor can be mounted in any directions-facing up, facing down and side ways. No matter which direction motors to be mounted, be sure not to apply overhung or thrust load on the shaft.

Refer to the table below for allowable shaft overhung load / thrust load.

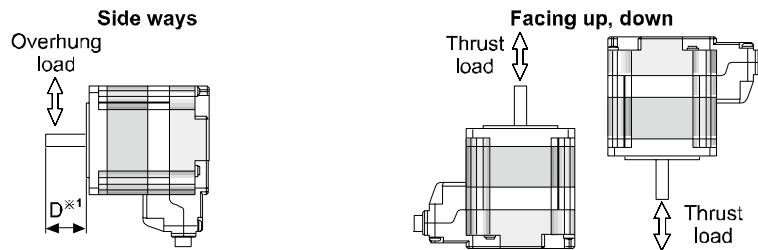


※1: The distance from the shaft in front (mm)

Motor size	The distance from the shaft in front (mm), Allowable overhung load [kgf (N)]				Allowable thrust load
	D=0	D=5	D=10	D=15	
Frame size 42mm	2 (20)	2.6 (25)	3.5 (34)	5.3 (52)	Below motor weight
Frame size 56mm	5.5 (54)	6.8 (67)	9.1 (89)	13.3 (130)	
Frame size 60mm					

Do not apply excessive force on motor cable when mounting motors.



Do not forcibly pull or insert the cable. It may cause poor connection or disconnection of the cable.

In case of frequent cable movement required application, proper safety countermeasures must be ensured.


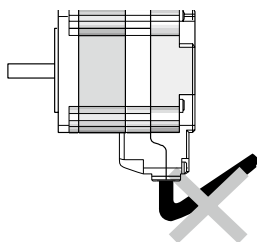


4.2 Mounting of Motor



4.2.1 Frame Size 20mm

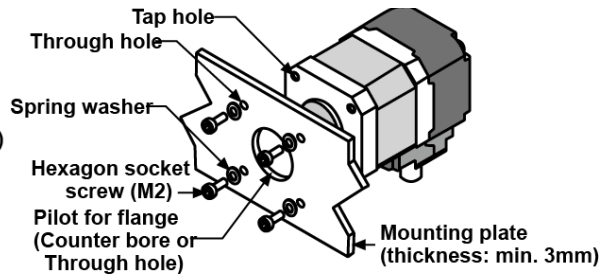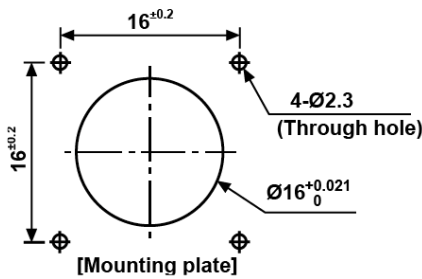



4.2.2 Frame Size 28mm

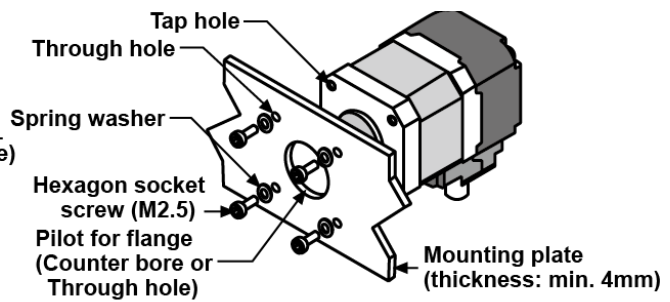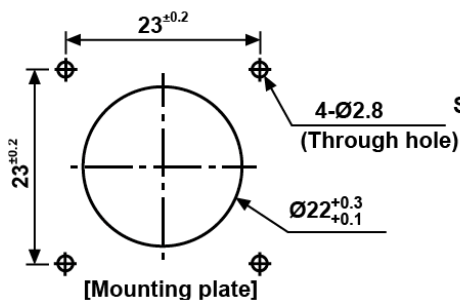





4.2.3 Frame Size 35mm

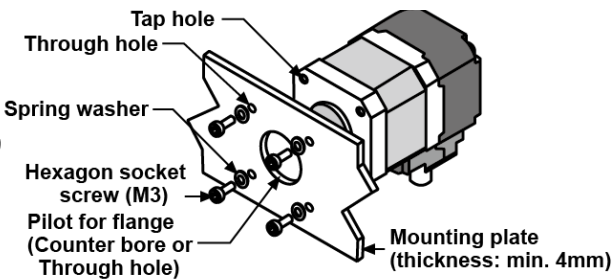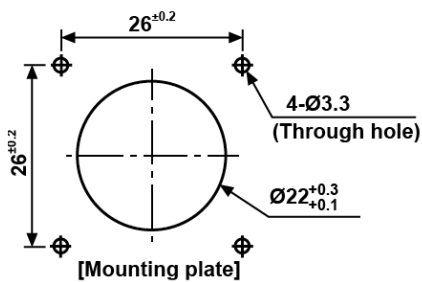

4.2.4 Frame Size 42mm

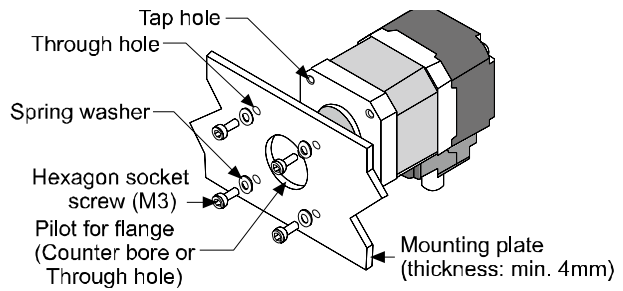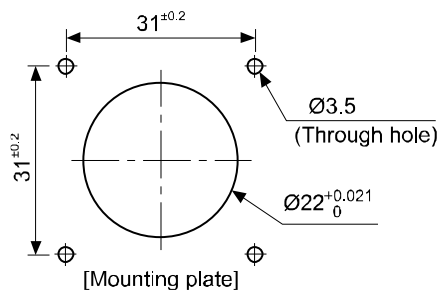

4.2.5 Frame Size 56mm / Frame Size 60mm

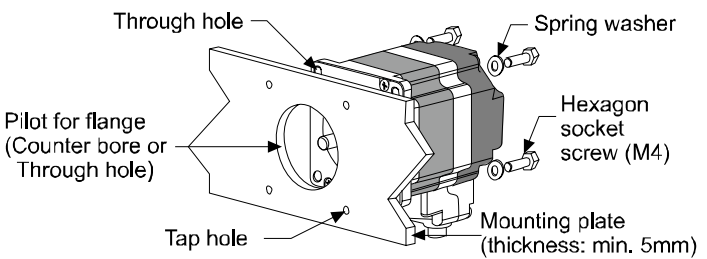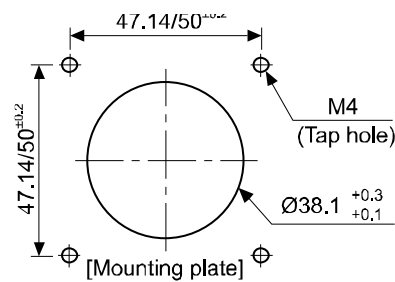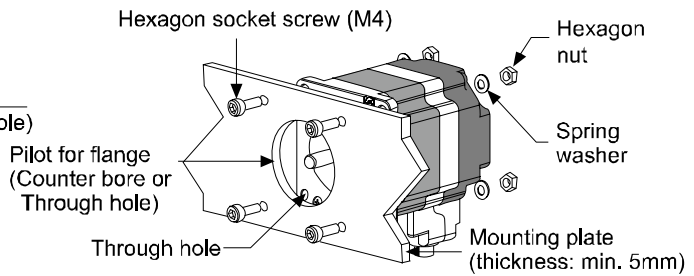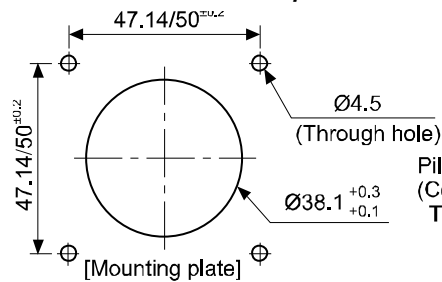


With considering heat radiation and vibration isolation, mount the motor as tight as possible against a metal panel having high thermal conductivity such as iron or aluminum. When mounting motors, use hexagon socket screws, spring washers and flat washers. Do not draw the wire with over strength 30N after wiring the encoder.

4.3 Connection with Load

When connecting the load, be sure of alignment of the center, tension of the belt, and parallel of the pulley. When connecting the load such as a pulley or a belt, be cautious of the allowable thrust load, radial load, and shock, as well as tighten the screw for a coupling or a pulley not to be unscrewed.

When attach a coupling or a pulley to the shaft, be cautious of damage on shaft or bearings and it is banned to disassemble or change structure of the device or the shaft for connecting with a load.

4.3.1 Direct Load Connection with Coupling

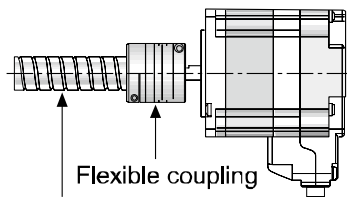


Ball screw or TM screw

※Use Autonics flexible coupling (ERB Series).


When connecting a load such as Ball screw or Tm screw directly to the shaft of the motor, use flexible coupling as image showing above. If the center of the load and the shaft is not aligned, it may cause severe vibration, damage on shaft or shortened life cycle of bearings.

4.3.2 Load Connection with Pulley, Belt, and Wire

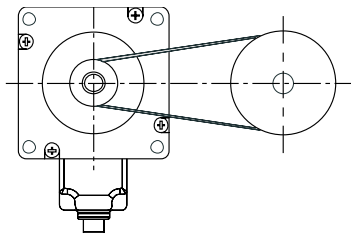

The motor shaft and the load shaft should be parallel. Connect the motor shaft and the line which connects the center of two pulleys to a right angle.

4.3.3 Load Connection with Gear

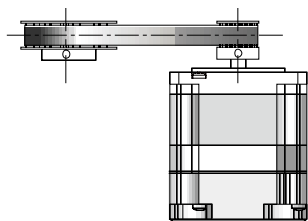

The motor shaft and the load shaft should be parallel. Connect the motor shaft to the center fo gear teeth side to be interlocked.


4.4 Installation Conditions

Install the motor in a place that meets certain conditions specified below.
It may cause product damage if instructions are not following.


- ① The inner housing installed indoor
(This unit is manufactured and designed for attaching to equipment. Install a ventilation device.)
- ② Within 0 to 50°C (at non-freezing status) of ambient temperature
- ③ Within 35 to 85%RH (at non-dew status) of ambient humidity
- ④ The place without explosive, flammable and corrosive gas
- ⑤ The place without direct ray of light
- ⑥ The place where dust or metal scrap does not enter into the unit
- ⑦ The place without contact with water, oil, or other liquid
- ⑧ The place without contact with strong alkali or acid material
- ⑨ The place where easy heat dissipation could be made
- ⑩ The place where no continuous vibration or severe shock
- ⑪ The place with less salt content
- ⑫ The place with less electronic noise occurs by welding machine, motor, etc.
- ⑬ The place where radioactive substances and magnetic fields does not exist and is not in the vacuum status

5 Connection

5.1 Standard Type

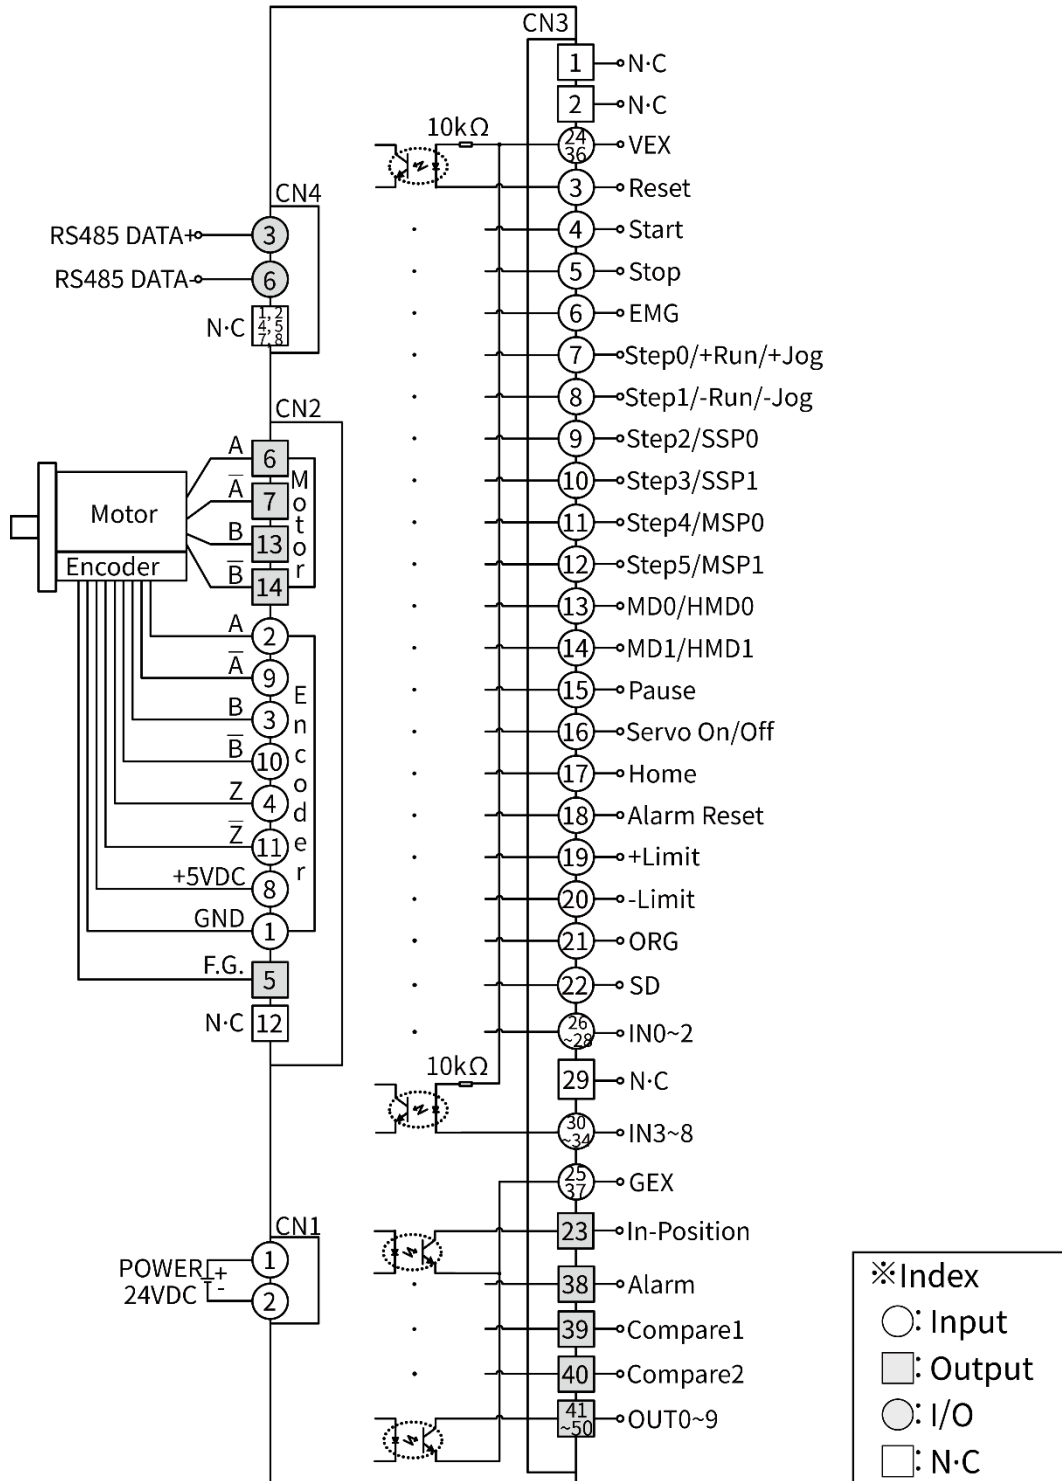


5.2 Built-in Brake Type

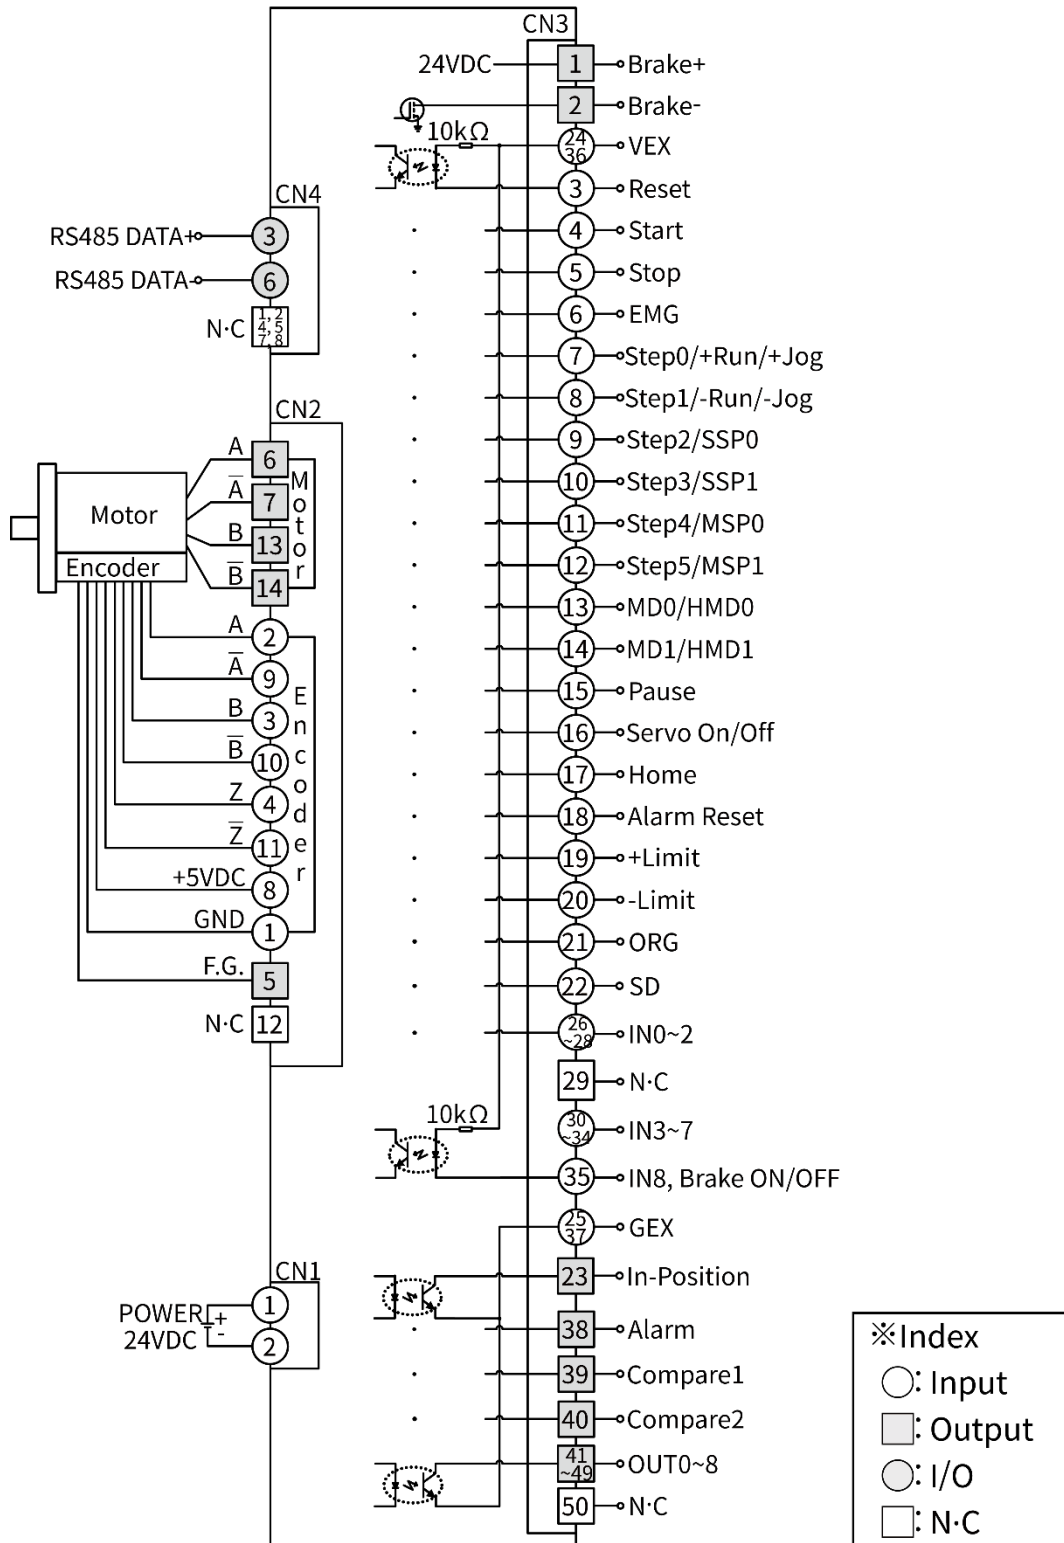


6 Characteristics

6.1 Standard Type


6.1.1 Frame Size 20mm

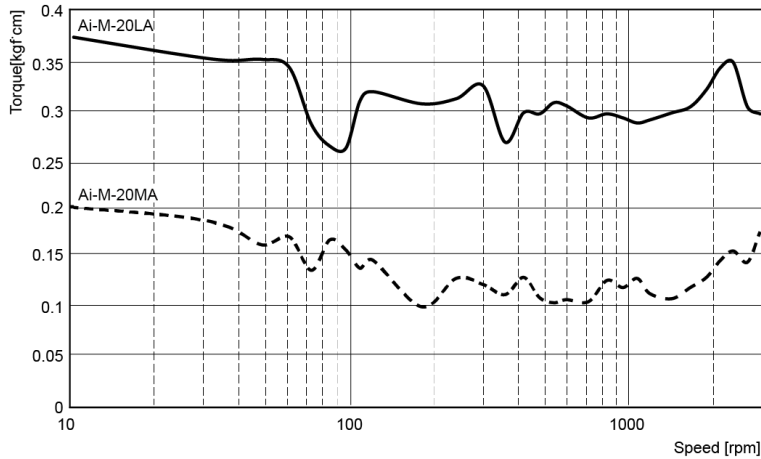


6.1.2 Frame Size 28mm

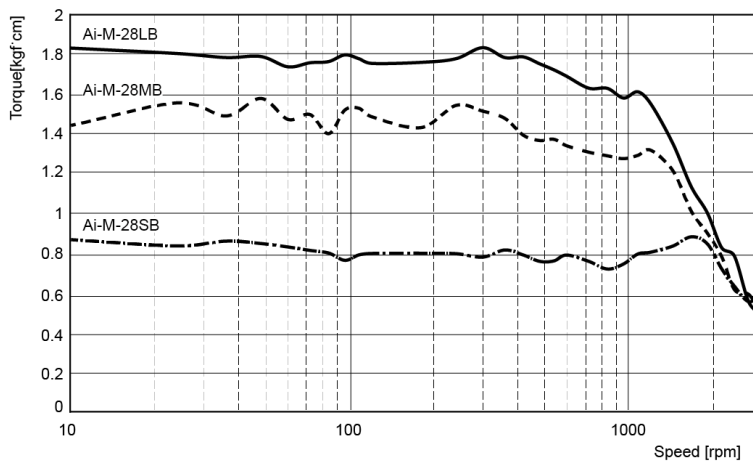


6.1.3 Frame Size 35mm

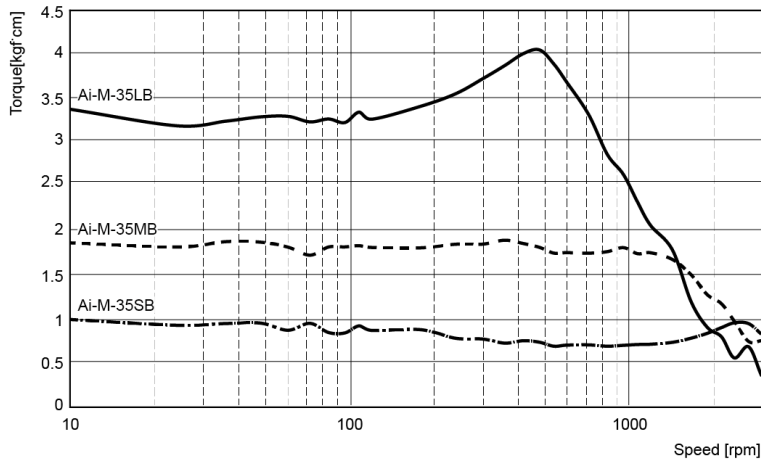


6.1.4 Frame Size 42mm

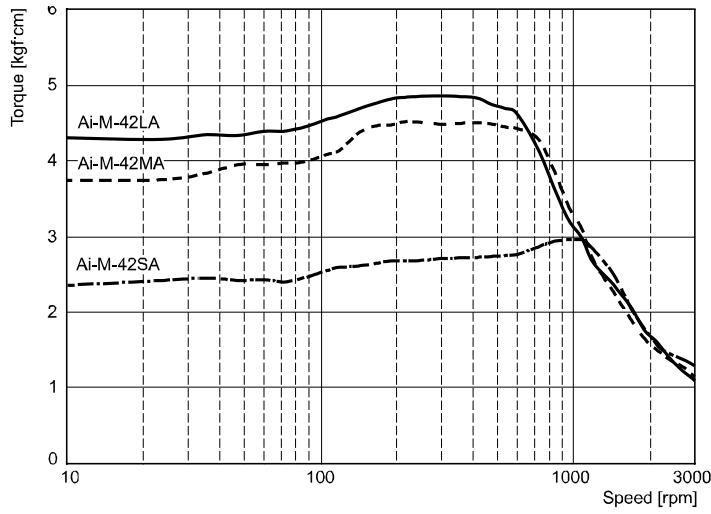

6.1.5 Frame Size 56mm

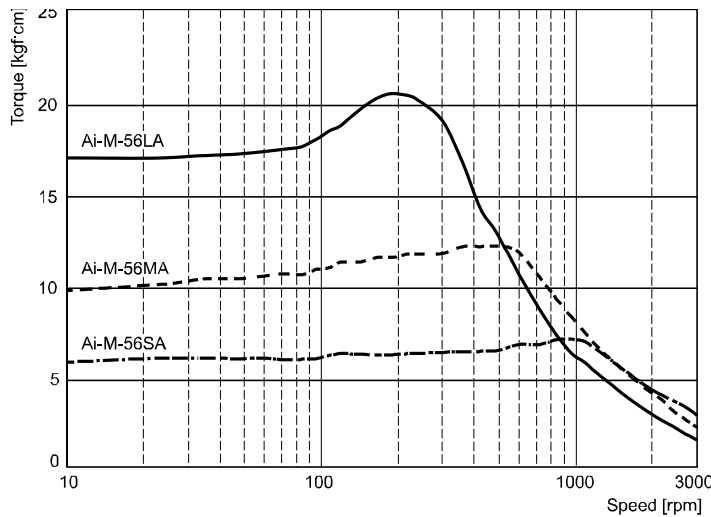


6.1.6 Frame Size 60mm

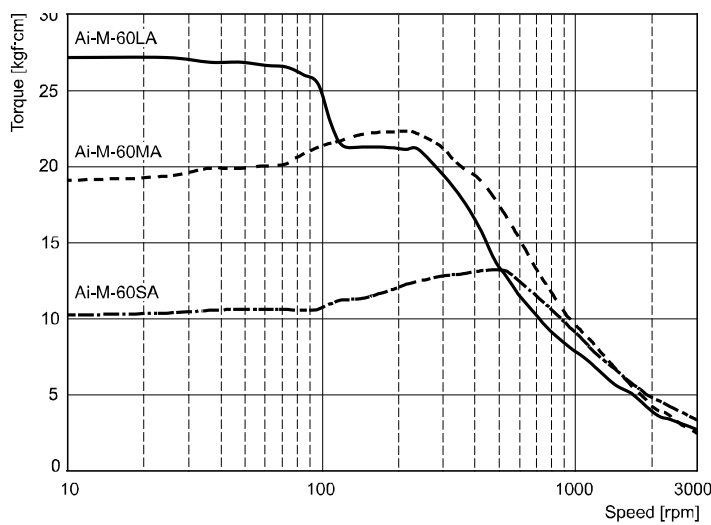


6.2 Built-in Brake Type


6.2.1 Frame Size 42mm

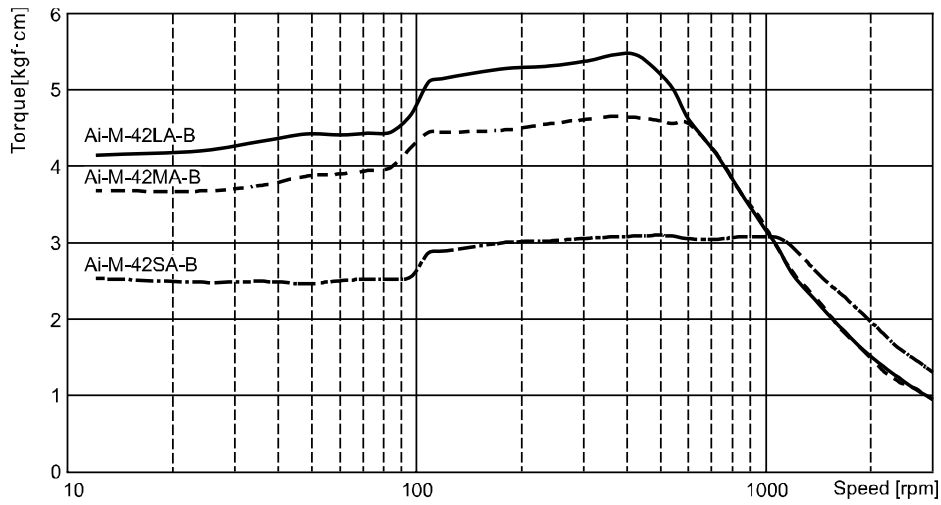


6.2.2 Frame Size 56mm

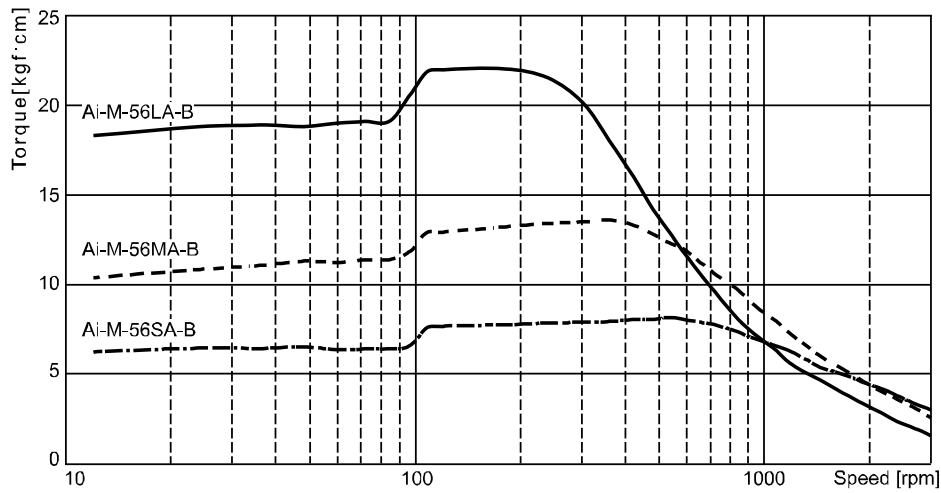

6.2.3 Frame Size 60mm

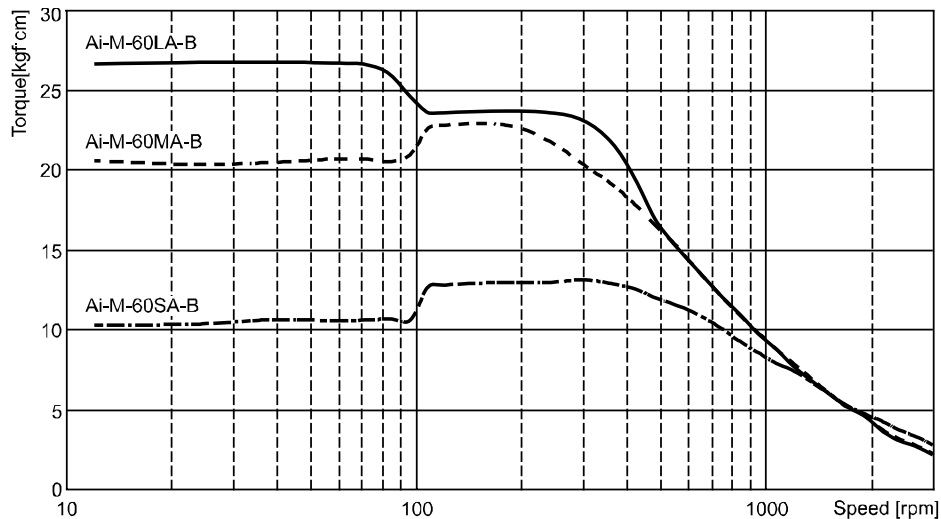

7 Driver Unit Descriptions

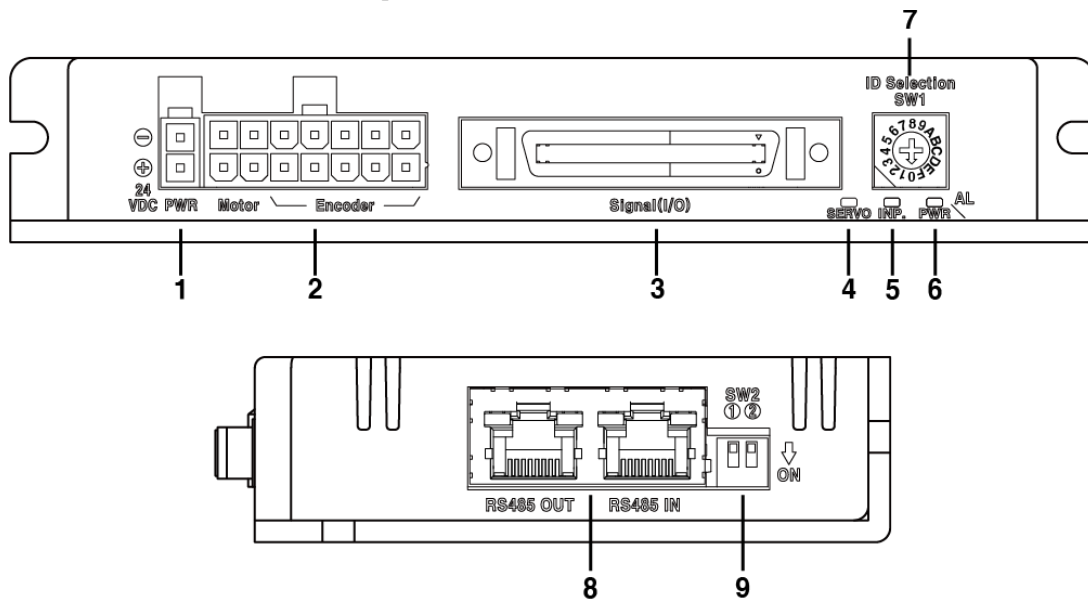


1. Power connector (CN1: PWR)
2. Motor+Encoder connector (CN2: Motor / Encoder)
3. I/O connector (CN3: Signal I/O)
4. Servo On/Off indicator (Servo, Orange)
5. In-Position indicator (INP., Yellow)
6. Power/Alarm indicator (PWR/AL, Green/Red)
7. Communication ID setting rotary switch (ID Selection SW1)
8. RS485 Communication connector (CN4: RS485 OUT / RS485 IN)
9. Communication ID setting/Terminating resistance setting DIP switch (SW2)

7.1 Connectors

7.1.1 CN1: Power Connector


Connects with 24VDC power. Be sure to the polarity to correct connection.

 When polarity direction is reversed, power is not turned on.


Pin arrangement	Pin	Function
	2	GND
	1	24VDC

7.1.2 CN2: Motor+Encoder Connector

Connects the motor and the encoder to the driver.

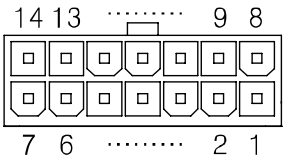Pin arrangement	Pin	Function	Pin	Function
	1	GND	8	+5VDC
	2	Encoder A	9	Encoder \bar{A}
	3	Encoder B	10	Encoder \bar{B}
	4	Encoder Z	11	Encoder \bar{Z}
	5	F.G.	12	N.C
	6	Motor A	13	Motor B
	7	Motor \bar{A}	14	Motor \bar{B}

 7.1.3 CN3: I/O Connector



Pin	I/O	Signal	Filter*1	Active*2	Function
1*3	Output	Brake+	-	-	Brake output (24VDC)
2*3	Output	Brake-	-	-	Brake output (GND)
3	Input	Reset	1.5, 10ms	[L]	Reset
4	Input	Start	1.5, 10ms	[L], [H]	Start drive
5	Input	Stop	1.5, 10ms	[L], [H]	Stop drive
6	Input	EMG	1.5, 10ms	[L], [H]	Emergency stop drive
7	Input	Step0/+Run/+Jog	1.5, 10ms	[L], [H]	Step designate0 / +Continuous / +Jog
8	Input	Step1/-Run/-Jog	1.5, 10ms	[L], [H]	Step designate1/-Continuous/-Jog
9	Input	Step2/SSP0	1.5, 10ms	[L], [H]	Step designate2/Start speed designate 0
10	Input	Step3/SSP1	1.5, 10ms	[L], [H]	Step designate3/Start speed designate 1
11	Input	Step4/MSP0	1.5, 10ms	[L], [H]	Step designate4/Max. speed designate 0
12	Input	Step5/MSP1	1.5, 10ms	[L], [H]	Step designate5/speed designate 1
13	Input	MD0/HMD0	1.5, 10ms	[L], [H]	Run mode designate0/ Home search mode designate0
14	Input	MD1/HMD1	1.5, 10ms	[L], [H]	Run mode designate 1/ Home search mode designate 1
15	Input	Pause	1.5, 10ms	[L], [H]	Pause
16	Input	Servo On/Off	1.5, 10ms	[L], [H]	Servo On/Off
17	Input	Home	1.5, 10ms	[L], [H]	Home search
18	Input	Alarm Reset	1.5, 10ms	[L], [H]	Alarm reset
19	Input	+Limit	1.5ms	[L], [H]	+ direction limit sensor
20	Input	-Limit	1.5ms	[L], [H]	- direction limit sensor
21	Input	ORG	1.5ms	[L], [H]	Home sensor
22	Input	SD	1.5ms	[L], [H]	deceleration drive signal
23	Output	In-Position	-	-	Drive end pulse
24	Input	VEX	-	-	External input power (24VDC)
25	Input	GEX	-	-	External input GND (0VDC)
26	Input	IN0	1.5, 10ms	[L], [H]	General input0
27	Input	IN1	1.5, 10ms	[L], [H]	General input1
28	Input	IN2	1.5, 10ms	[L], [H]	General input2
29	-	N.C	-	-	Disable
30	Input	IN3	1.5, 10ms	[L], [H]	General input3
31	Input	IN4	1.5, 10ms	[L], [H]	General input4
32	Input	IN5	1.5, 10ms	[L], [H]	General input5
33	Input	IN6	1.5, 10ms	[L], [H]	General input6
34	Input	IN7	1.5ms	[L], [H]	General input7
35*4	Input	IN8, Brake ON/OFF	1.5ms	[L], [H]	General input8, Brake ON/OFF
36	Input	VEX	-	-	External input power (24VDC)
37	Input	GEX	-	-	External input GND (0VDC)
38	Output	Alarm	-	-	Alarm output
39	Output	Compare1	-	-	Comparison output1
40	Output	Compare2	-	-	Comparison output2
41	Output	OUT0	-	-	General output0

Pin	I/O	Signal	Filter ^{※1}	Active ^{※2}	Function
42	Output	OUT1	-	-	General output1
43	Output	OUT2	-	-	General output2
44	Output	OUT3	-	-	General output3
45	Output	OUT4	-	-	General output4
46	Output	OUT5	-	-	General output5
47	Output	OUT6	-	-	General output6
48	Output	OUT7	-	-	General output7
49	Output	OUT8	-	-	General output8
50 ^{※5}	Output	OUT9	-	-	General output9

※1: It is software input filter to set 10ms or 1.5ms of parameter 'Input Filter'. The filter of +Limit, ORG, SD, IN7 to 9 is fixed as 1.5ms. When input turns ON over the set time, it recognizes as normal signal input.


※2: It is voltage level to recognize input signal as ON. It is available to set each input.
[H]: 5-30VDC, [L]: 0-2VDC (however, reset is fixed as [L].)

※3: N.C for standard type motor.

※4: Brake ON/OFF function can be switched in built-in brake type.

※5: N.C for built-in brake type motor.

7.1.4 CN4: RS485 Communication Cable Connector

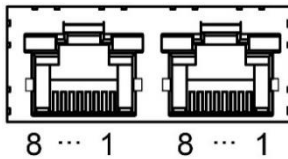

Pin	Input/Output	Function
1	-	N.C
2	-	N.C
3	Input/Output	RS485 DATA+
4	-	N.C
5	-	N.C
6	Input/Output	RS485 DATA-
7	-	N.C
8	-	N.C

7.2 Connector Specifications

Type		Specifications			Manufacture
		Connector	Connector terminal	Housing	
CN1	Driver	3930-1020 (5569-02A2)	-	-	Molex
	Power	CHD1140-02	CTD1140	-	HANLIM
CN2	Driver	35318-1420	-	-	Molex
	Motor+Encoder	5557-14R	5556T2 ^{※1} 5556T		
CN3	Driver	10250-52A2 PL	-	-	3M
	I/O connector	10150-3000PE		10350-52F0-008	
CN4	Driver	KRM-U-02-8-8-4-7M5	-	-	KINNEXA

※1. It depends on the frame size of the motor.

5556T2: 20, 28, 35mm

5556T: 42, 56, 60mm




Note

Above connectors are suitable for AiC-D Series. You can use equivalent or substitute connectors.

7.3 Switches

7.3.1 SW1: ID Setting Switch

Setting switch	Setting	ID		Setting	ID	
		SW2 1 OFF	SW2 1 ON		SW2 1 OFF	SW2 1 ON
 <p>ID Selection SW1</p>	0	Disable	16	8	8	24
	1	1 (factory default)	17	9	9	25
	2	2	18	A	10	26
	3	3	19	B	11	27
	4	4	20	C	12	28
	5	5	21	D	13	29
	6	6	22	E	14	30
	7	7	23	F	15	31




Note

※Set Node ID of the driver.

※Depending on the 1 switch setting of the SW2, it is possible to connect max. 31-axis.

※ID setting value is applied when motor is stopped or excitation is released.

7.3.2 SW2: ID Setting/Terminating Resistance DIP Switch

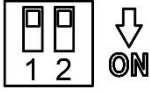	No.	Function	Switch position	
			ON	OFF (factory default)
	1	ID setting	ID: 16 to 31	ID: 1 to 15
	2	Terminating resistance	Use terminating resistance (120Ω)	Do not use terminating resistance



Note

- ※Set Node ID of the driver.
- ※Set to use terminating resistance.

7.4 Driver Status Indicator

Status indicator	Location	LED color	Function	Descriptions
PWR	Front	Green	Power indicator	Turns ON when the unit operates normally after supplying power.
			warning indicator	Flashes when limit signal is input or overload, status is maintained.
AL		Red	Alarm indicator	When alarm occurs, it flashes in various ways depending on the situation. Refer to '8.2.1 Exclusive Output (AiC-D: 4, AiC-D-B: 6)'. Turns ON when motor is placed at command position after positioning input.
INP.		Yellow	In-Position indicator	Turns ON when Servo is operating, turns OFF when servo is not operating.
SERVO		Orange	Servo On/Off indicator	Flashes when receiving data. Flashes when sending data.
RXD IN* ¹	Right side	Yellow	RS485 Data I/O display	Flashes when receiving data.
TXD OUT* ¹		Green		Flashes when sending data.

 


Note

- ※1: Although RS485 OUT is disconnected, RXD IN/TXD OUT operates normally, if RS485 IN is communicating.

7.5 Sold Separately

7.5.1 I/O Cable (CO50-MP□-R, standard: AiC TAG)




Pin	Function (name tag)	Cable color	Dot line color-numbers	Pin	Function (name tag)	Cable color	Dot line color-numbers
1※1	BRAKE+	Orange	Black-1	26	IN0	White	Red-3
2※1	BRAKE-		Red-1	27	IN1		Black-4
3	RESET		Black-2	28	IN2		Red-4
4	START		Red-2	29	N.C		Black-5
5	STOP		Black-3	30	IN3		Red-5
6	EMG		Red-3	31	IN4	Gray	Black-1
7	STEP0/+RUN/+JOG		Black-4	32	IN5		Red-1
8	STEP1/-RUN/-JOG		Red-4	33	IN6		Black-2
9	STEP2/SSP0		Black-5	34	IN7		Red-2
10	STEP3/SSP1	Red-5	35	IN8 Brake ON/OFF	Black-3		
11	STEP4/MSP0	Yellow	Black-1	36	VEX		Red-3
12	STEP5/MSP1		Red-1	37	GEX		Black-4
13	MD0/HMD0		Black-2	38	ALARM		Red-4
14	MD1/HMD1		Red-2	39	COMPARE1	Black-5	
15	PAUSE		Black-3	40	COMPARE2	Red-5	
16	SERVO ON/OFF		Red-3	41	OUT0	Pink	Black-1
17	HOME		Black-4	42	OUT1		Red-1
18	ALARM RESET		Red-4	43	OUT2		Black-2
19	+LIMIT		Black-5	44	OUT3		Red-2
20	-LIMIT	Red-5	45	OUT4	Black-3		
21	ORG	Black-1	46	OUT5	Red-3		
22	SD	Red-1	47	OUT6	Black-4		
23	IN POSITION	Black-2	48	OUT7	Red-4		
24	VEX	Red-2	49	OUT8	Black-5		
25	GEX	Black-3	50※2	OUT9	Red-5		



Note

- ※1: N.C for standard type motor.
- ※2: N.C for built-in brake type motor.
- ※□ of model name indicates cable length (010, 020, 030, 050, 070, 100, 150, 200).
E.g.) CO50-MP070-R: 7m I/O cable
- ※It is recommended to use ferrite core at I/O cable.

 
7.5.2 Power Cable (CJ-PW-□)



Note

- ※□ of model name indicates cable length (010, 020).
E.g.)CJ-PW-010: 1m power cable
- ※It is recommended to use ferrite core at Power cable.

7.5.3 Motor+Encoder Cable (normal: C1D14M-□/moving: C1DF14M-□)

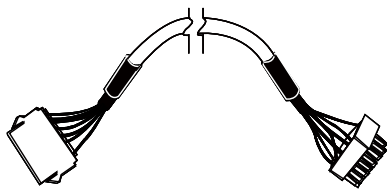

Note

- ※□ of model name indicates cable length (1, 2, 3, 5, 7, 10, 15, 20).
E.g.)C1DF14M-10: 10m moving type motor+encoder cable
- ※It is recommended to use ferrite core at Motor+Encoder cable.

8 Control Input/Output

Inner signal of all input/output consists of photocoupler.

ON, [H]: photocoupler power ON

OFF, [L]: photocoupler power OFF

8.1 Input

8.1.1 Exclusive Input (20)

Signal name	Descriptions	Pin
Reset	Reset command	3
Start	Drive start command	4
Stop	Drive stop command	5
EMG	Drive emergency stop command	6
Step0/+Run/+Jog	Step designate0/+Continuous/+Jog	7
Step1/-Run/-Jog	Step designate1/-Continuous/-Jog	8
Step2/SSP0	Step designate2/ Start speed designate 0	9
Step3/SSP1	Step designate3/ Start speed designate 1	10
Step4/MSP0	Step designate4/ Max. speed designate 0	11
Step5/MSP1	Step designate5/ Max. speed designate 1	12
MD0/HMD0	Operation mode designate 0/Home search mode designate 0	13
MD1/HMD1	Operation mode designate 1/Home search mode designate 1	14
Pause	Pause	15
Servo On/Off	Servo On/Off	16
Home	Home search	17
Alarm Reset	Alarm reset command	18
+Limit	+ direction limit sensor	19
-Limit	- direction limit sensor	20
ORG	Home sensor	21
SD	Deceleration (Deceleration stop) signal	22
Brake ON/OFF	Brake ON/OFF	35

8.1.1.1 Reset

When driver is reset, it operates same as resupplying the power.

The parameter which is saved at atMotion is not reset.

During motor driving, it stops immediately and the driver is reset.

8.1.1.2 Start

It starts drive as the set mode; index mode or program mode.

**Note**

- When it stops by stop instruction during driving with program mode, supplying start input, it starts drive from the first step.
- When it pauses by pause instruction during driving with program mode, supplying start input, it starts drive from the next step of the paused one.

8.1.1.3 Stop

During continuous driving, it decelerates and stops the motor according to 'Deceleration Time 1' parameter setting.

**Note**

- During program mode driving, it stops after complete the current step.
- During home search, it decelerates and stops according to 'Home Search Deceleration Time' parameter setting. In this case, home search mode error alarm occurs.

8.1.1.4 EMG (emergency)

Motor stops immediately, emergency stop alarm occurs.

The current of motor is not blocked.

During stopping motor, EMG instruction does not run.

**Note**

- When emergency stop alarm occurs, all drive stops and all output turn OFF regardless of the output remain setting.

8.1.1.5 Step0, 1/±Run/±Jog**(1) Step0, 1**

It is available to set the start address of program mode among 0 to 63 range by 6-digit bit of Step0 to Step5.

- Step0=Least significant bit
- Step5=Most significant bit

(2) ±Run

According to the set parameter, it drives to CW (+Run) / CCW (-Run) direction as continuous mode.

(3) ±Jog

According to the set parameter, it drives to CW (+Jog) / CCW (-Jog) direction during ON jog signal.

**Note**

If +Jog signal and -Jog signal are supplied at the same time, the motor stops.

8.1.1.6 Step2, 3/SSP0, 1 (start speed)**(1) Step2, 3**

It is available to set the start address of program mode among 0 to 63 range by 6-digit bit of Step0 to Step5.

- Step0=Least significant bit
- Step5=Most significant bit

(2) SSP0, 1

It is available to set the start drive speed of jog mode, continuous mode by 2-digit bit of SSP0, SSP1.

	SSP1	SSP0
Start speed 1	OFF	OFF
Start speed 2	OFF	ON
Start speed 3	ON	OFF
Start speed 4	ON	ON

**Note**

Start speed 5 is not available.

8.1.1.7 Step4, 5/MSP0, 1 (max speed)**(1) Step4, 5**

It is available to set the start address of program mode among 0 to 63 range by 6-digit bit of Step0 to Step5.

- Step0=Least significant bit
- Step5=Most significant bit

(2) MSP0, 1

It is available to set the max. drive speed of jog mode, continuous mode by 2-digit bit of MSP0, MSP1.

	MSP1	MSP0
Max speed 1	OFF	OFF
Max speed 2	OFF	ON
Max speed 3	ON	OFF
Max speed 4	ON	ON

**Note**

- Max speed 5 is not available.
- If MSP0/MSP1 is changed during continuous drive or jog drive, Max speed is changed immediately during operation.

8.1.1.8 MD0, 1/HMD0, 1 (mode/home mode)**(1) MD0, 1**

When it is not home search mode, it is available to set the drive mode among 4 types.

	MD1	MD0
Index mode	OFF	OFF
Jog mode	OFF	ON
Continuous mode	ON	OFF
Program mode	ON	ON


(2) HMD0, 1

When home signal is ON, it is available to set the home search mode among 4 types.

	HMD1	HMD0
Home search	OFF	OFF
Limit home search	OFF	ON
Zero home search	ON	OFF
Torque home search	ON	ON

8.1.1.9 Pause

- When pause signal is ON during program mode drive, it pauses after completing the current step driving.
After start signal is ON, it starts drive from the next step of the paused one.
- During continuous mode driving, it decelerates and stops when pause signal is ON.
When pause signal is OFF, it starts drive.
If pause signal is OFF before stopping the motor, the motor stops and it starts drive as continuous mode.

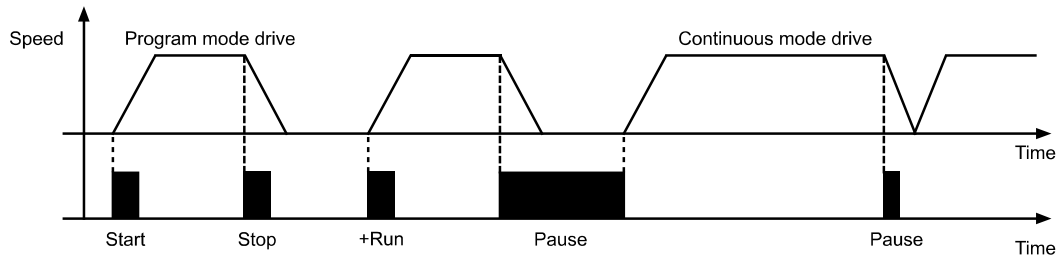**8.1.1.10 Servo On/Off**

- It is for adjusting shaft position of motor by external force manually.
- Servo On/Off signal is [H] over 1ms.
: It recognizes as servo off signal and the phase current of motor is blocked and torque is released.
Servo On indicator, In-Position Output and the indicator turn OFF.
- Servo On/Off signal is [L] over 1ms.
: It recognizes as servo on signal and the phase current of motor is supplied and torque is return.
Servo On indicator, In-Position Output and the indicator turn ON.

**Note**

The motor must stop.

8.1.1.11 Home

Home search mode is set at 'Home Search Method' parameter.

As below 4 parameters, it is available to set home search speed and acceleration/deceleration time.

→Home Search High Speed / Home Search Low Speed

Home Search Acceleration Time / Home Search Deceleration Time

8.1.1.12 Alarm Reset

- It is for alarm reset.
- When alarm reset signal is [H],
: alarm is reset and the alarm indicator and alarm output turn OFF.
The driver returns to normal status.

**Note**

If alarm causes are not removed, the driver does not return to normal status.

8.1.1.13 ±Limit

When supplying the \pm limit signal over 1.5ms, it recognizes as \pm hardware limit input and it decelerates and stops or stops immediately according to the set parameter.

- +Limit=CW direction limit sensor signal
- -Limit=CCW direction limit sensor signal


8.1.1.14 ORG (origin)

During driving as general home search mode, it is used as home sensor input.

When supplying ORG signal over 1.5ms, it recognizes as home sensor.

8.1.1.15 SD (slow down)

When supplying SD signal over 1.5ms, the set the start drive speed decelerates.

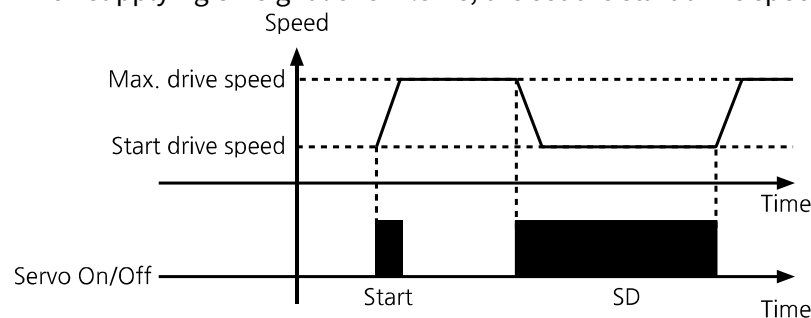
**8.1.1.16 Brake ON/OFF**

IN8 input can be selected as Brake ON/OFF through the parameter selection.

- When Brake ON/OFF signal remains ON more than 1.5 msec or 10 msec, Brake is released.
- When Brake ON/OFF signal remains OFF more than 1.5 msec or 10 msec, Brake is locked.

**Note**

Brake ON/OFF is only available in Servo Off status. When servo is On, this function will be disabled for safety.

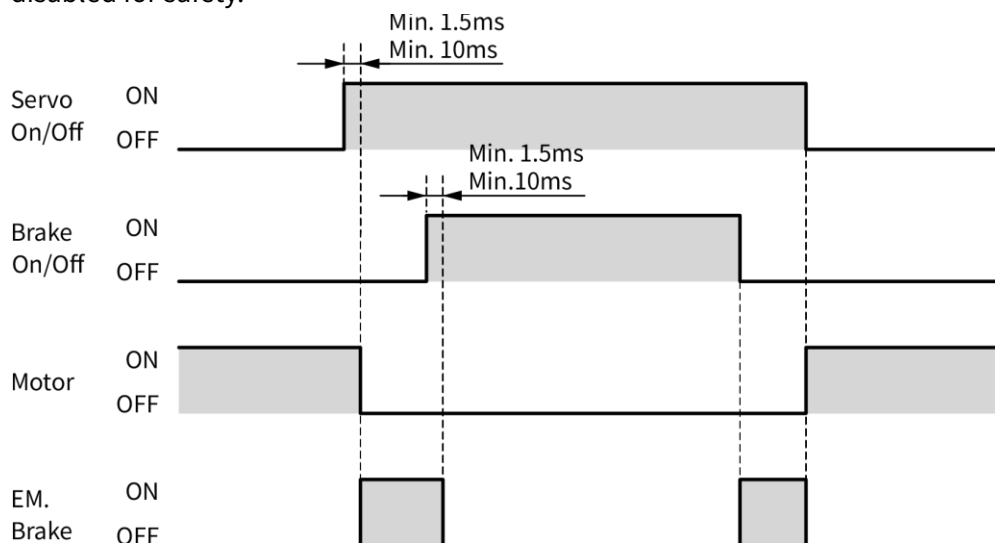

8.1.2 General Input (9)

Signal name	Descriptions	Pin
IN0 to IN2	General input 0 to 2	26 to 28
IN3 to IN8	General input 3 to 8	30 to 35

It is general input at program mode.

It is used with ICJ, IRD instruction.


- IN0 to IN5
When supplying over 10ms or 1.5ms (set at 'Input Filter' parameter), it recognizes as input.
- IN6 to IN8
When supplying over 1.5ms, it recognizes as input.

8.1.3 Example of Input Circuit Connection

All input circuits are insulated with photocoupler. It is recommended to use 24VDC at VEX and short RL.

In case using external power over 24VDC power, select RL value that IF (forward current of primary LED) of photocoupler to be around 2.5mA (max. 10mA).

$$R_L = \frac{VEX - 1.25V}{0.0025A} - 10 \times 10^3 \Omega$$

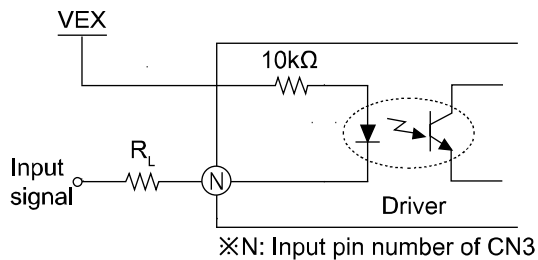

8.2 Output

※ Brake operation is only for built-in brake type.

8.2.1 Exclusive Output (AiC-D: 4, AiC-D-B: 6)

Signal name	Descriptions	Pin
Brake+	Brake output (24VDC)	1
Brake-	Brake output (GND)	2
In-Position	Drive ending pulse	23
Alarm	Alarm output	38
Compare 1 (Trigger)	Compare output 1	39
Compare 2 (Trigger)	Compare output 2	40

8.2.1.1 In-Position

In-Position output is output condition of the positioning complete signal.

If the gap between target position and real position is under in-position setting value after position command pulse has finished, in-position output turns to [H] and the in-position indicator turns ON.

In reverse, when the gap is over in-position setting value, in-position output turns to [L] and the in-position indicator turns OFF.

For more accurate control, check the in-position output before operating the next one.

For more information, refer to '11.2.6 In-Position'.

8.2.1.2 Alarm / Warning

In normal state, output is ON and when alarm occurs, output is OFF.

Depending on the alarm type, it flashes as much as the alarm number on the alarm indicator.

In connected communication, Alarm can be displayed in atMotion program.

For more information, refer to '12 Protection Function'.

8.2.1.3 Compare1, Compare2

It outputs trigger pulse at the designated cycle.

Mode	Description
0	It is not use compare output and outputs [L].
1	When the current absolute position value is higher than or same as the set position value (Compare 1 Position or Compare 2 Position), it outputs [H].
2	When the current absolute position value is lower than or same as the set position value (Compare 1 Position or Compare 2 Position), it outputs [H].
3	Trigger pulse outputs as the set period (Compare 1 Period or Compare 2 Period) and width (Compare 1 Pulse Width or Compare 2 Pulse Width).




Note

- ※Setting range of Compare 1 Position, Compare 2 Position: -2,147,483,648 to +2,147,483,647
- ※Setting range of Compare 1 Period, Compare 2 Period: 1 to 2,147,483,648 [pulse]
- ※Setting range of Compare 1 Pulse Width, Compare 2 Pulse Width : 1 to 1,000 [ms]




Ex.


- Compare 1 Mode=1 / Compare 1 Position=5000,

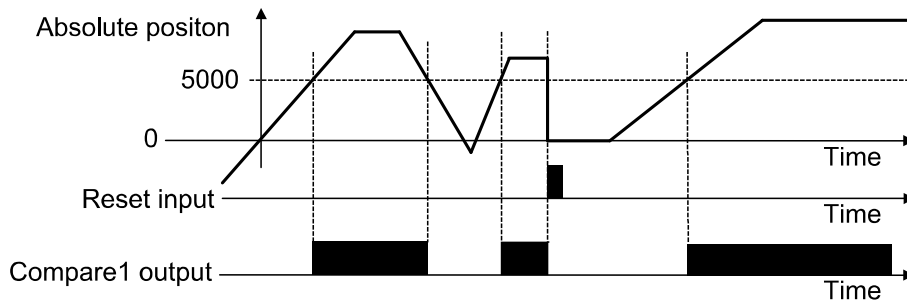

- Compare 1 Mode=2 / Compare 1 Position=-2000,

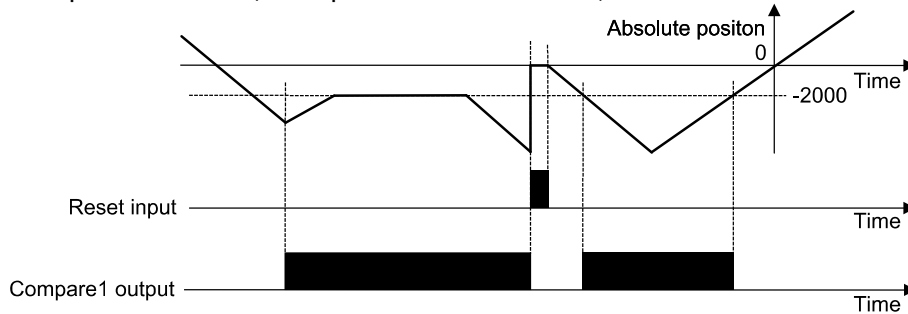

- Compare 1 Mode=3,

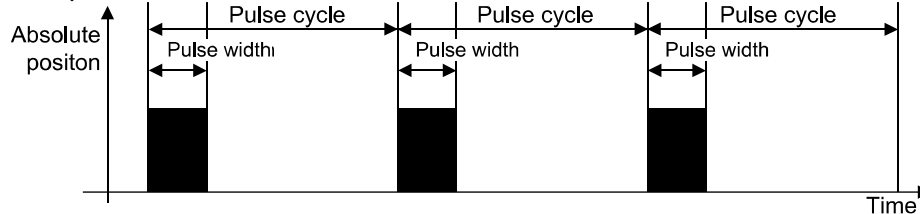

8.2.2 General Output (AiC-D: 10, AiC-D-B: 9)

8.2.2.1 Standard type

Signal name	Description	Pin
OUT0 to OUT9	General Output 0 to 9	41 to 50

8.2.2.2 Built-in brake type

Signal name	Description	Pin
OUT0 to OUT8	General Output 0 to 8	41 to 49

It is general output at program mode.

It is used with OPC, OPT instruction.


8.2.3 Example of Output Circuit Connection

All output circuits are insulated with photocoupler.

External power input is available from 5VDC to 80VDC with the open collector method.


Select R_L value that I_c (collector current of secondary LED) of photocoupler to be around 10mA.

$$R_L = \frac{VEX - 0.7V}{0.01A}$$

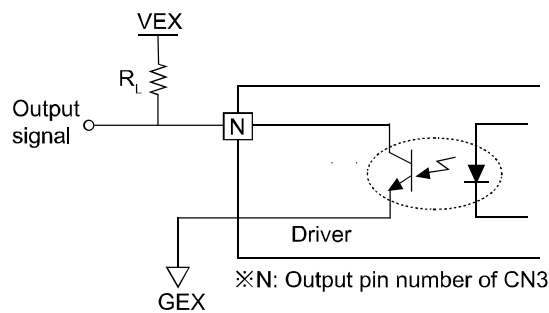

8.2.4 Brake Output

In order to reduce heat in the brake, connected to the motor, the driver outputs DC power to turn off the brake.

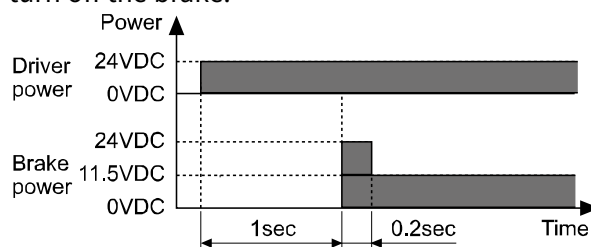

When supplying power to the driver after connecting the driver and brake, the rated excitation voltage is supplied and the brake power is released after approx. 1 sec.

Then after approx. 0.2 sec, the excitation voltage is decreased to 11.5VDC and the released brake power is maintained.

※ While power is supplied to the driver, the brake is kept turning on, except in the Servo On status.

9 Drive

As below, AiC Series has 4 drive modes and home search.

It operates each drive mode by I/O.

Drive mode name	Descriptions
Index drive	Designates and operates the one step among the saved instruction of the program
Jog drive	Outputs drive while instruction input signal is ON to \pm direction
Continuous drive	Starts drive output when instruction input signal turns ON once to \pm direction. Stops it when the signal turns stop.
Program drive	Operates by the designated program.
Home search	Operates home search



Caution

Do not operate instructions by I/O during communication between the driver and the PC (atMotion) (only monitoring is available.)

It may cause malfunction due to double input.

9.1 I/O Signal Control Drive

9.1.1 Index Drive

At index mode, it operates the one step of “ABS” or “INC” instruction from the program.

- Index mode drive

For operating index mode drive, the designated program step must have the instruction.

When operating the other instruction, error occurs.

1st Drive mode: “MD0”=0, “MD1”=0

2nd Select Index mode.

: It is available to set the step number from 0 to 63 combining with “Step0” to “Step5”.

3rd Start drive.

: When “Start” input signal turns ON, the designated one step operates.

4th Emergency stop

: When “EMG” signal inputs, it stops emergently.




Note

- For index mode drive by I/O control, “MD0/HMD0”, “MD1/HMD1” are turn OFF and it selects index drive.



Caution

- When it stops by stop signal input, Index drive error occurs.
- When driving the step which does not have “ABS” or “INC” instruction, Index drive error occurs.
- The specified step operates repeatly if the “Start” signal is input continuously.

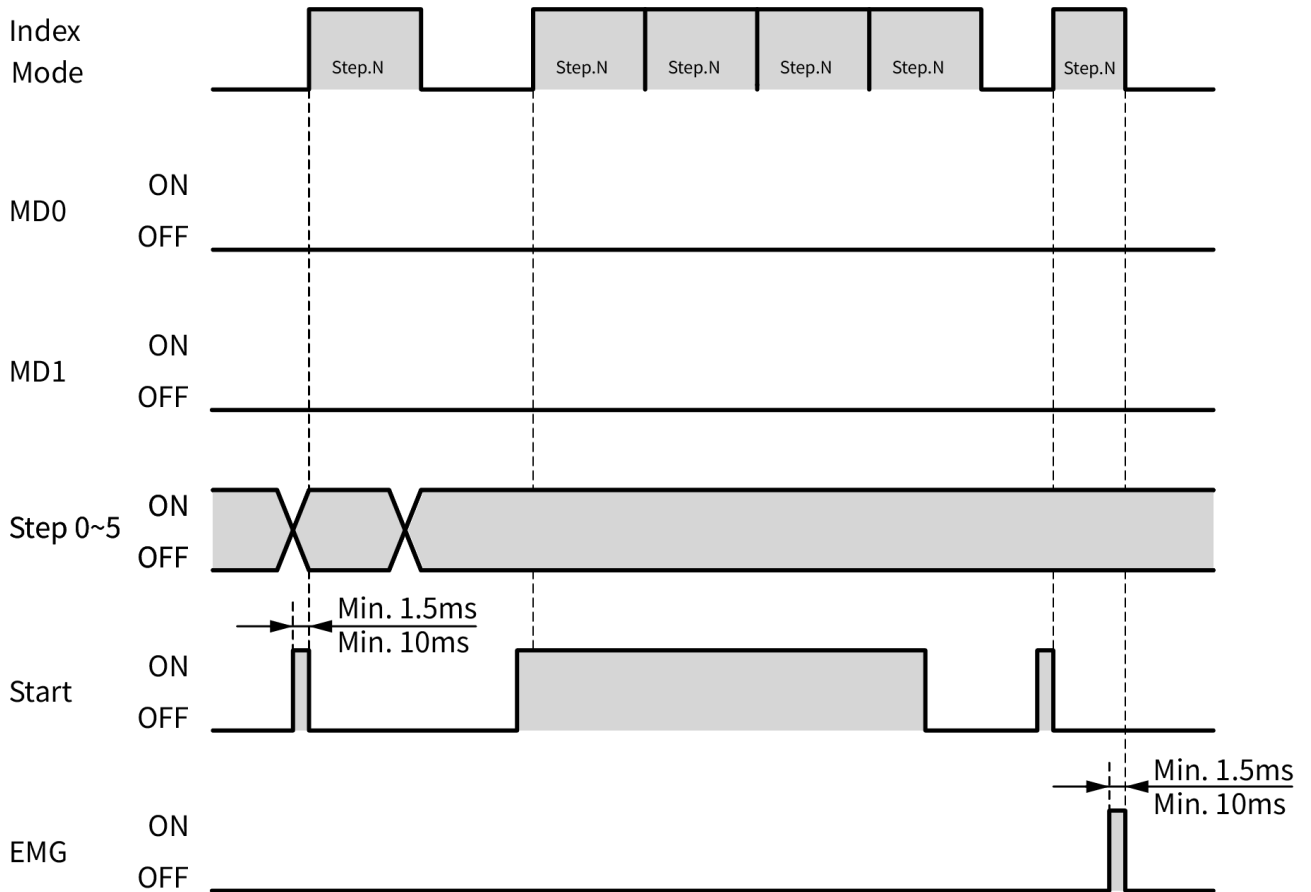

9.1.2 Jog Drive

At jog mode, it operates motor to CW direction or CCW direction while “+Jog” or “-Jog” signal is ON.

- Jog mode drive

1st Drive mode: “MD0”=1, “MD1”=0

2nd Select start drive speed.

: It is available to set the start drive speed combining with “SSP0”, “SSP1”.


3rd Select max. drive speed.

: It is available to set the max. drive speed combining with “MSP0”, “MSP1”.

4th Drive: It drives to CW direction or CCW direction while “+Jog” or “-Jog” signal inputs.

5th Emergency stop

: When “EMG” signal inputs, it stops emergently.

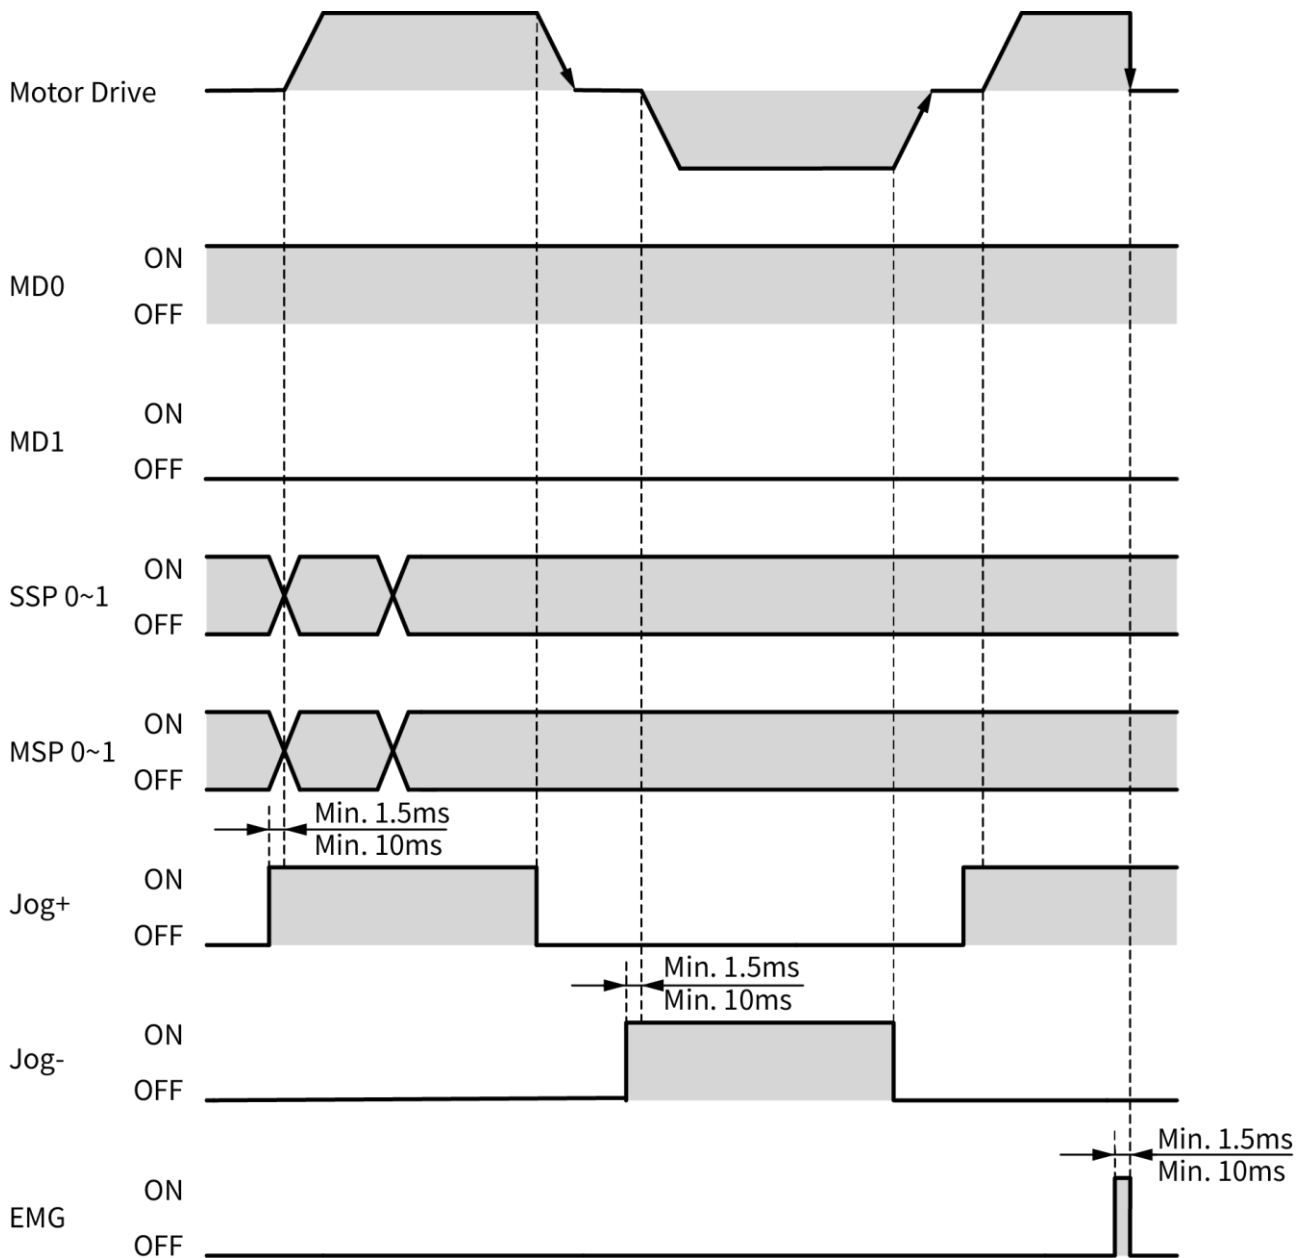

Note

- For jog mode drive by I/O control, “MD0/HMD0” turns ON, “MD1/HMD1” turns OFF and it selects jog drive.
- It cannot stop by “Stop” signal input.

9.1.3 Continuous Drive

At continuous mode, it operates motor continuously when drive signal inputs to the designated direction.

When STOP signal inputs or limit signal of the direction inputs, it stops.

- Continuous mode drive

- 1st Drive mode: “MD0”=0, “MD1”=1

- 2nd Select start drive speed.

- : It is available to set the start drive speed combining with “SSP0”, ”SSP1”.


- 3rd Select max. drive speed.

- : It is available to set the max. drive speed combining with “MSP0”, ”MSP1”.

- 4th Drive: When “+Run” or “-Run” signal inputs, it drives to CW direction or CCW direction.

- 5th Stop: When “STOP” signal inputs or limit signal of the direction inputs, it stops.

- 6th Emergency stop: When “EMG” signal inputs, it stops emergently.

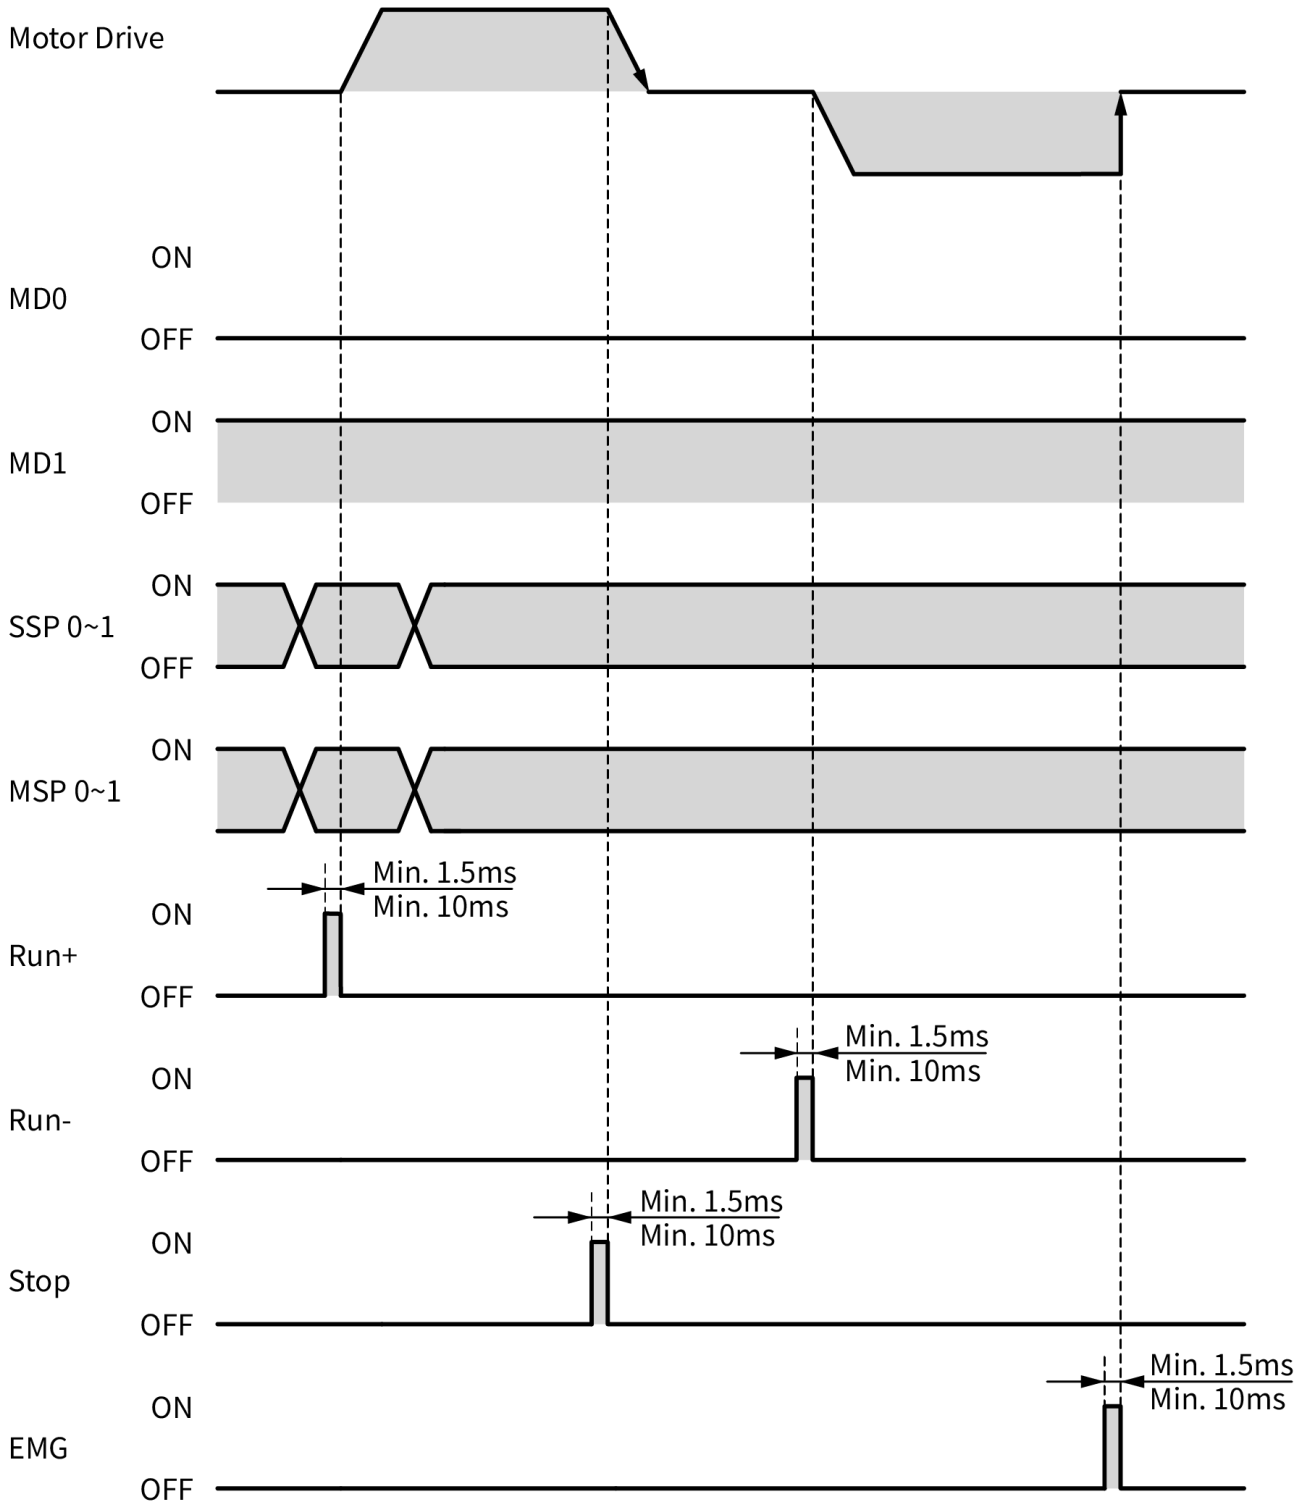

Note

For continuous mode drive by I/O control, “MD0/HMD0” turns OFF, “MD1/HMD1” turns ON, and it selects continuous drive.

9.1.4 Program Drive

At program mode, it operates the designated program from pre-selected step to 255-step sequentially.

- Program mode drive

The saved program should exist at memory.

1st Drive mode: “MD0”=1, “MD1”=1

2nd Drive

: When “Start” input signal turns ON, it drives according to the set program.

3rd Pause

: When “Pause” signal inputs, it stops after completing the step.

When “Start” signal inputs again, it drives from the completed next step.

4th Stop

: When “Stop” signal inputs, it stops after completing the step.

When “Start” signal inputs again, it drives from the first step.

While Program mode is in pause, when “STOP” signal inputs, program mode will return to ready status.

5th When “EMG” signal inputs, it stops emergently.

6th Program end: When “END” signal inputs, program mode drive is end.



Note

When “Power On Program Start” parameter is Enable, it operates program mode drive when resupplying power.



Caution

- For end of program mode, “END” signal must be input.
If there is no “END” instruction input, Program drive error occurs.

9.1.5 Home Search

According to the setting of “HOME Active Level” parameter, it operates home search drive by [H] or [L] input.

- Home search drive

1st Drive mode

: It is available to set the home search mode combining with “HMD0”, “HMD1”.

2nd Drive

: When “HOME” signal inputs, it operates home search according to the set mode.

3rd Stop

: When “STOP” signal inputs or limit signal of the direction inputs, it stops.

4th Emergency stop

: When “EMG” signal inputs, it stops emergently.

9.1.5.1 General Home Search (home search method=0)

It operates home search by home sensor.

Assigns the home by receiving the output signal from the sensor by connecting external home sensor on exclusive input “ORG” (pin 21).

There are two types of general home search as below, it can be set by setting value in “Home search completion method” parameter.

Parameter	Setting range	Description
Home search completion method	0 : Home sensor OFF complete 1 : Home sensor ON complete	Factory default: 0

- General Home Search Drive

Home search completion method: 0 (Home sensor OFF complete)

1st It operates home search drive to the set direction at “Home Search Direction”.

2nd It starts drive with the set start drive speed at “Home Search Start Speed” and operates acceleration drive with the set acceleration time at “Home Search Acceleration Time”.


3rd When acceleration drive is completed, it operates constant speed drive until “ORG (home sensor)” signal inputs with the set max. drive speed at “Home Search Max speed”.

4th If “±Limit (±direction limit sensor)” signal inputs before “ORG (home sensor)” signal inputs, it decelerates and stops drive to the reverse direction to find home.

5th If “ORG (home sensor)” signal inputs, it decelerates with the set deceleration time at the “Home Search Deceleration Time” and stops.

6th After stops, it moves home sensor to the reverse direction for the passing distance from home with the set start drive speed at “Home Search Start Speed”, finds home sensor and stops when ORG (home sensor) signal is OFF.

7th After finding home, “In-Position” signal outputs and the “INP. indicator (orange)” turns ON.

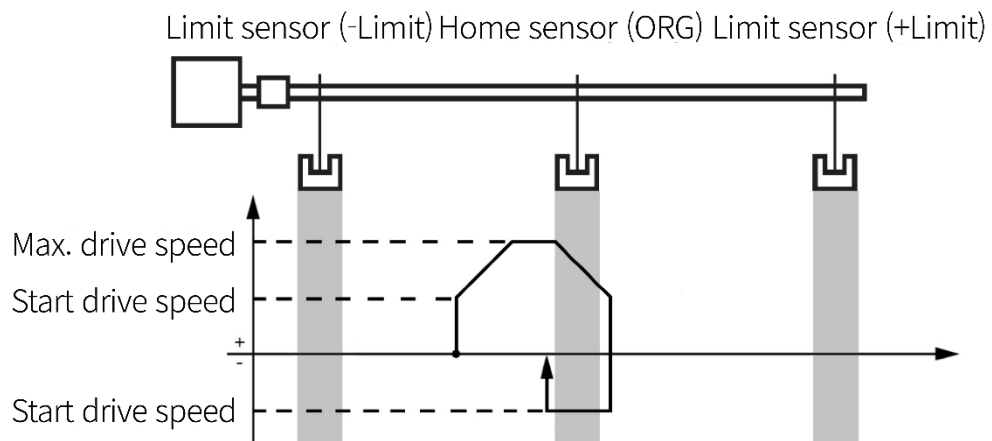

- General Home Search Drive

Home search completion method: 1 (Home sensor ON complete)

1st It operates home search drive to the set direction at “Home Search Direction”.

2nd It starts drive with the set start drive speed at “Home Search Start Speed” and operates acceleration drive with the set acceleration time at “Home Search Acceleration Time”.


3rd When acceleration drive is completed, it operates constant speed drive until “ORG (home sensor)” signal inputs with the set max. drive speed at “Home Search Max speed”.

4th If “ \pm Limit (\pm direction limit sensor)” signal inputs before “ORG (home sensor)” signal inputs, it decelerates and stops drive to the reverse direction to find home.

5th If “ORG (home sensor)” signal inputs, it decelerates with the set deceleration time at the “Home Search Deceleration Time” and stops.

6th After stops, it moves home sensor to the reverse direction for the passing distance from home with the set start drive speed at “Home Search Start Speed”, finds home sensor and stops when ORG (home sensor) signal is ON.

7th After finding home, “In-Position” signal outputs and the “INP. indicator (orange)” turns ON.

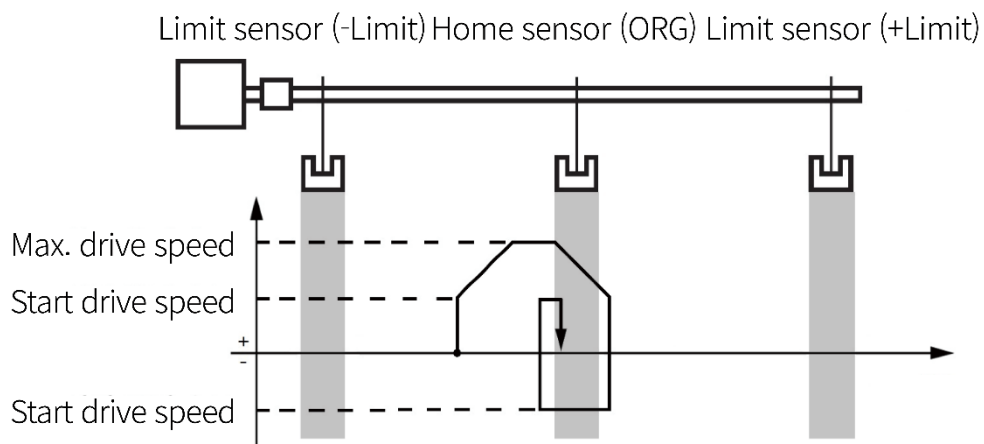

9.1.5.2 Limit Home Search (home search method=1)

It operates home search by limit sensor.


Assigns the home by receiving the output signal from the sensor by connecting external limit sensor on exclusive input “ \pm Limit” (pin 19 and 20).

- Limit Home Search Drive
 - 1st Limit Home Search Drive It operates home search drive to the set direction at “Home Search Direction”.
 - 2nd It starts drive with the set start drive speed at “Home Search Start Speed” and operates acceleration drive with the set acceleration time at “Home Search Acceleration Time”.
 - 3rd When acceleration drive is completed, it operates constant speed drive until meeting the limit sensor with the set max. drive speed at “Home Search Max speed”.
 - 4th If “ \pm Limit (\pm direction limit sensor)” signal inputs or it arrives to “Software Limit \pm (\pm software limit)”, it decelerates with the set deceleration time at “Home Search Deceleration Time” and stops.
 - 5th After stops, it moves to the reverse direction for the passing distance from limit sensor with the set start drive speed at “Home Search Start Speed”, finds limit sensor and stops.
 - 6th After finding home, “In-Position” signal outputs and the “INP. indicator (orange)” turns ON.



Note

- At “Home Search Offset”, the other value except 0 is set, it moves for the setting value with start drive speed, “In-Position” signal outputs, and the “INP. indicator (orange)” turns ON.

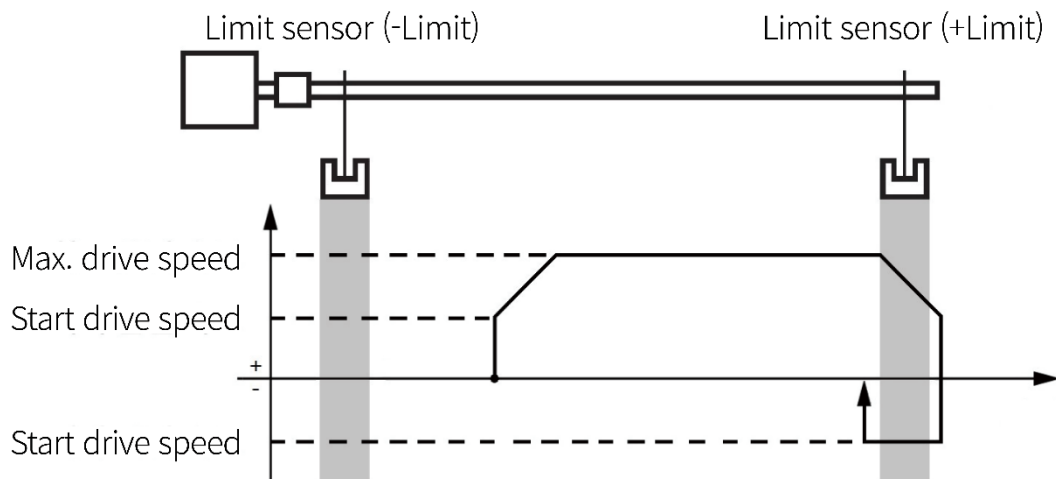

Caution

- For deceleration stop, set the deceleration time shortly. In case of long deceleration time, it may conflict with the structure.
- Install the limit sensor with the certain distance from the structure.

9.1.5.3 Zero Point Home Search (home search method=2)


It operates home search by zero point (absolute coordinate=0) when there is no home sensor, limit sensor.

- Zero Point Home Search Drive
 - 1st Set the zero (absolute coordinate=0) as home.
For changing home position, use the position reset.
If changing zero position by I/O, move the zero to the desired position and supply “RESET” signal and it resets.
When reset or resupplying power, the zero point is also reset.
 - 2nd The set direction at “Home Search Direction” is ignored and it operates drive at the set home direction.
 - 3rd It starts drive with the set start drive speed at “Home Search Start Speed”, and it operates acceleration drive with the set acceleration time at “Home Search Acceleration Time”.
 - 4th After acceleration drive is complete, it operates constant speed drive with the set max. drive speed at “Home Search Max speed”.
 - 5th When it is close to home, it decelerates with the set deceleration time at “Home Search Deceleration Time” and it stops.
 - 6th After finding home, “In-Position” signal outputs and the “INP. indicator (orange)” turns ON.



Note

- At “Home Search Offset”, the other value except 0 is set, it moves for the setting value with start drive speed, “In-Position” signal outputs, and the “INP. indicator (orange)” turns ON.

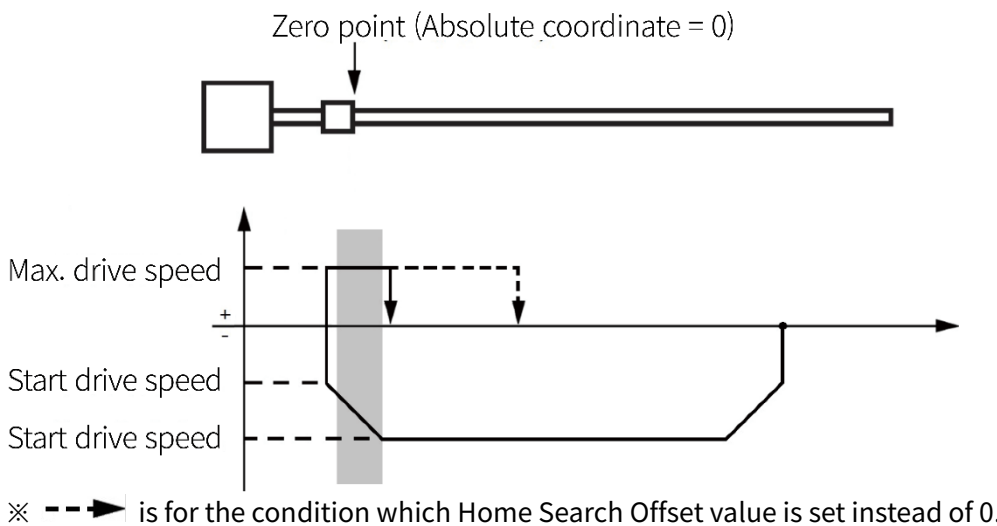

Caution

- If the parameter “Power On Home Search” is set as Enable and the power is applied, Home search mode error alarm will occur due to unassigned zero point.

9.1.5.4 Torque Home Search (home search method=3)

It operates home search by contact with the specific equipment when there is no home sensor, limit sensor.


When the torque value is output as much as the value set in the parameter “Home Search Torque” by contacting a specific object, assign the position moved by the value set in the parameter “Home Search Offset” as the home.

- 1st Torque Home Search Drive operates home search drive to the set direction at “Home Search Direction”.
- 2nd It starts drive with the set start drive speed at “Home Search Start Speed” and operates acceleration drive with the set acceleration time at “Home Search Acceleration Time”.
- 3rd When acceleration drive is completed, it operates constant speed drive until contacting the specific equipment with the set max. drive speed at “Home Search Max speed”.
- 4th When it contacts with the specific equipment, the current of motor is higher. It stops when the current of motor is same value as the set value at “Home Search Torque”.
- 5th After stops, it rotates and stops to the reverse direction with the start drive speed and rotation value set from atMotion.
- 6th After finding home, “In-Position” signal outputs and the “INP. indicator (orange)” turns ON.



Note


- At “Home Search Offset”, the other value except 0 is set, it moves for the setting value with start drive speed, “In-Position” signal outputs, and the “INP. indicator (orange)” turns ON.

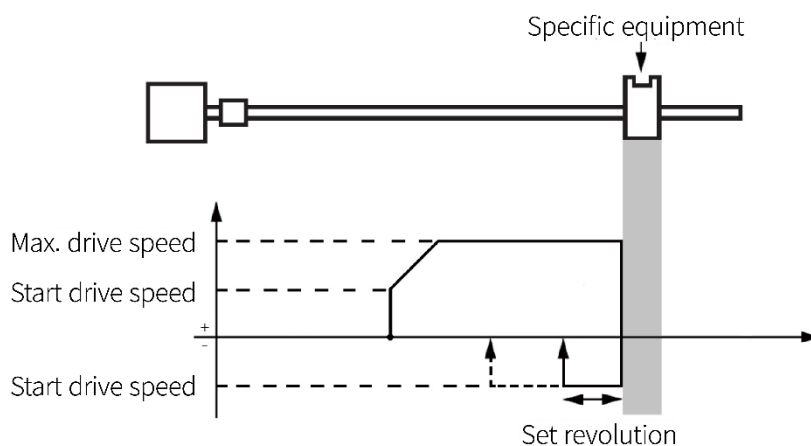


※ \dashrightarrow is for the condition which Home Search Offset value is set instead of 0.

9.2 atMotion Control Drive


- atMotion run and setting
 - 1st Visit our website (www.autonics.com) to download and install newest version of 'atMotion'.
 - 2nd Run 'atMotion' which is installed on PC.
 - 3rd On the left side, select ① 'Supported Device List' - ② 'AiC Series'.

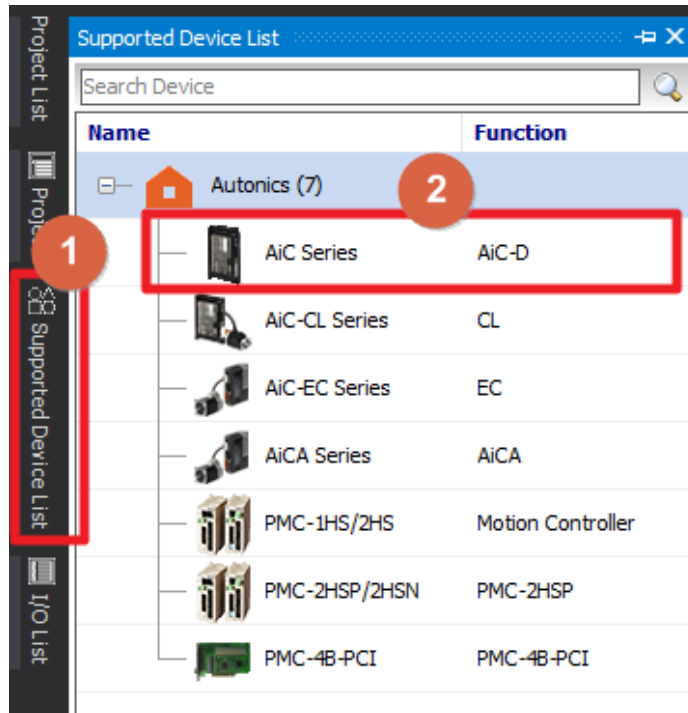


4th Set communication method as 'RS-232' at New DAQ interface

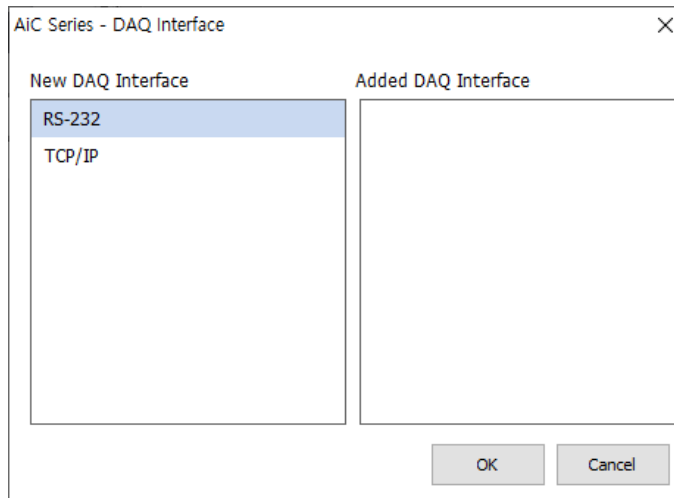


5th Right click the newly added device on 'My System' then click ① 'Add'. When ② 'Add Unit' window displays, double click the device list or click the arrow, placed in the middle of the window, to create node number then select ③ 'OK'.

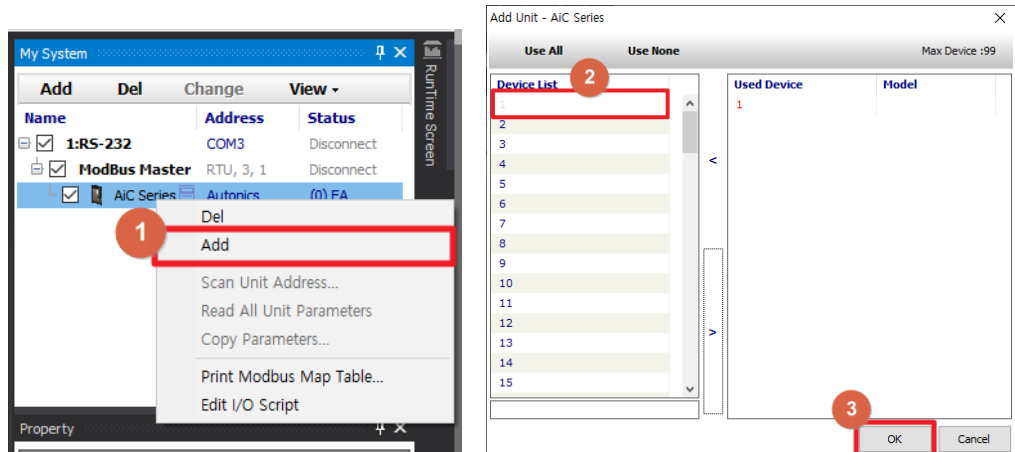


- 6th Select 'RS-232' on the right side of the window, set the communication port, and baud rate for the connected device.

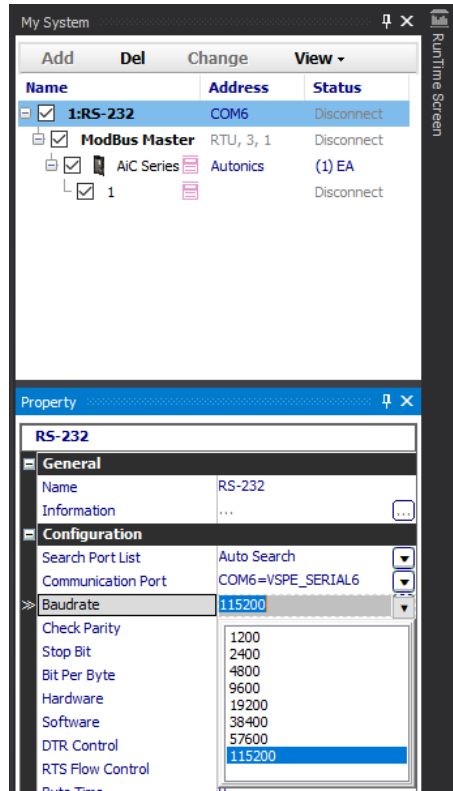


- 7th Click 'Connect' on the upper side of the window to connect the communication.

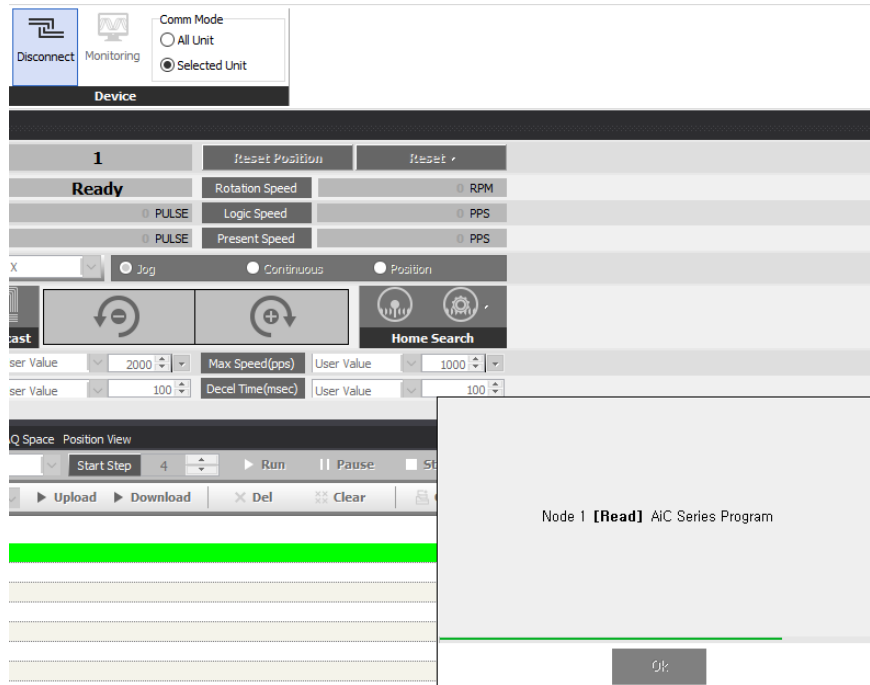

8th To make sure the communication is connected properly, check the ‘My System’ items on the right side of the window to figure out the device node setting.

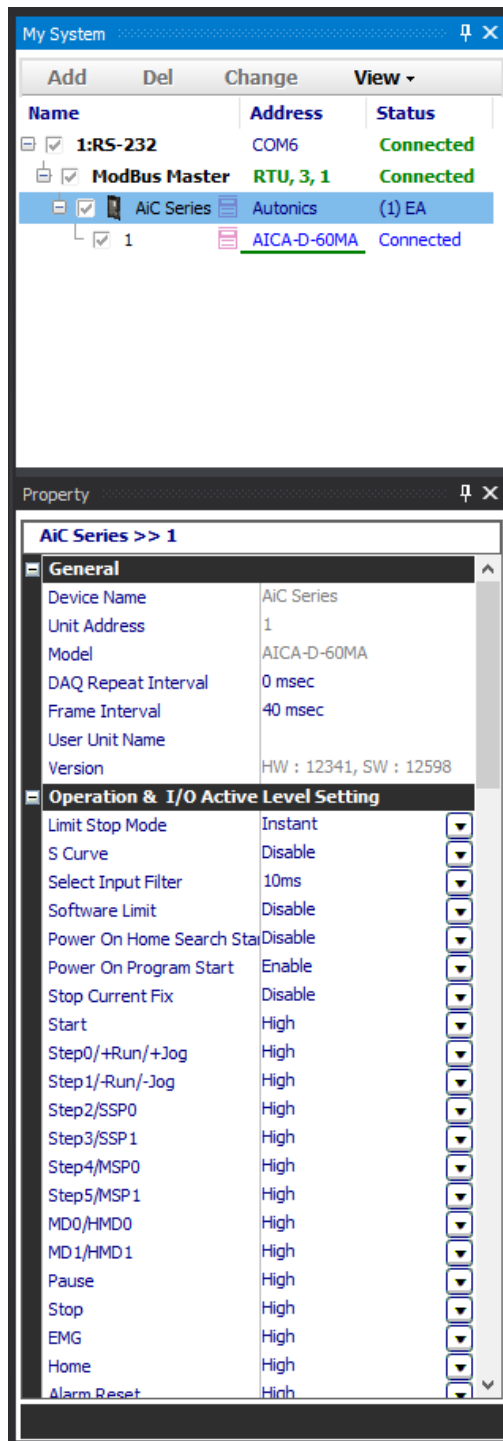

9.2.1 Jog Mode

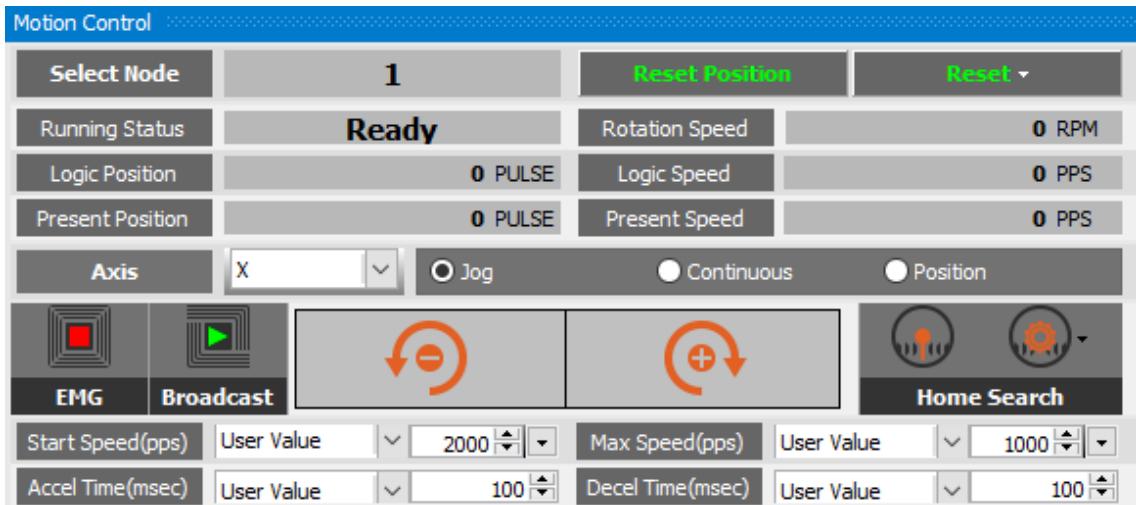


 
The screenshot shows the 'Motion Control' interface. At the top, 'Select Node' is set to '1' with 'Reset Position' and 'Reset' buttons. The 'Running Status' is 'Ready'. Below are fields for 'Logic Position' (0 PULSE), 'Present Position' (0 PULSE), 'Rotation Speed' (0 RPM), 'Logic Speed' (0 PPS), and 'Present Speed' (0 PPS). The 'Axis' is set to 'X'. Mode selection includes 'Jog' (selected), 'Continuous', and 'Position'. There are buttons for 'EMG', 'Broadcast', 'Home Search', and two circular jog buttons (CW and CCW). At the bottom, there are input fields for 'Start Speed(pps)' (User Value, 2000), 'Max Speed(pps)' (User Value, 1000), 'Accel Time(msec)' (User Value, 100), and 'Decel Time(msec)' (User Value, 100).

Jog mode operates the motor in CW or CCW direction by clicking  or  button.

- Jog mode operation

- 1st Select 'Jog' on Motion Control – mode selection box.

- 2nd Set the 'Start Speed', 'Max Speed', 'Accel Rate', 'Decel Rate' value for jog mode.

- 3rd Motor begins to operate to designated direction by clicking  or  button.

- 4th Operation stops by releasing the button.



Note

- Start Speed, Max Speed, Accel Rate and Decel Rate can be loaded from the saved value without entering these values.



9.2.2 Continuous Mode




The screenshot shows the Motion Control interface with the following details:

- Select Node:** 1
- Reset Position:** (Green button)
- Reset:** (Green dropdown menu)
- Running Status:** Ready
- Rotation Speed:** 0 RPM
- Logic Position:** 0 PULSE
- Logic Speed:** 0 PPS
- Present Position:** 0 PULSE
- Present Speed:** 0 PPS
- Axis:** X
- Mode Selection:** Jog, **Continuous** (selected), Position
- Buttons:** EMG (red square), Broadcast (green play), Stop (orange square), CW (orange circle with +), CCW (orange circle with -), Home Search (orange gear)
- Start Speed(pps):** User Value, 2000
- Max Speed(pps):** User Value, 1000
- Accel Time(msec):** User Value, 100
- Decel Time(msec):** User Value, 100

Continuous mode outputs pulse continuously in the designated direction until stop command from upper level or stop signal from outside. Continuous mode and home search mode is applicable for this function.

Stop commands include deceleration stop and immediate stop. Deceleration stop is operated when final operation speed is lower than the initial operation speed or in all cases except for reset or emergency stop.

Continuous mode operates the motor continuously in CW or CCW direction by clicking  or  button.

- Continuous mode operation
 - 1st Select 'Continuous' on Motion Control – mode selection box.
 - 2nd Set the 'Start Speed', 'Max Speed' value for continuous mode.
 - 3rd Motor begins to operate to designated direction by clicking  or  button.
 - 4th Operation stops by clicking  button or when the designated direction limit signal is applied.



Note

- Start Speed, Max Speed, Accel Rate and Decel Rate can be loaded from the saved value without entering these values.

9.2.3 Position Mode

Motion Control			
Select Node	1	Reset Position	Reset ▾
Running Status	Ready	Rotation Speed	0 RPM
Logic Position	0 PULSE	Logic Speed	0 PPS
Present Position	0 PULSE	Present Speed	0 PPS
Axis	X ▾	<input type="radio"/> Jog <input type="radio"/> Continuous <input checked="" type="radio"/> Position	
		<input type="button" value="◀"/> <input type="button" value="□"/> <input type="button" value="▶"/>	Relative Positio: ▾ 0
Start Speed(pps)	User Value ▾	2000 ▾	Max Speed(pps) User Value ▾
Accel Time(msec)	User Value ▾	100 ▾	Decel Time(msec) User Value ▾
			100 ▾

atMotion provides 'relative position' and 'absolute position' control.

Relative position control moves by the input pulse based on current position.

Absolute position control moves by the input pulse based as the origin.

The position value may change depending on the parameter 'Resolution' setting.


Check the actual position displayed on the program screen to move the position.

- Position mode operation
 - 1st Select 'Position' on Motion Control – mode selection box.
 - 2nd Set the 'Start Speed', 'Max Speed', 'Accel Rate', 'Decel Rate' value for position mode.
 - 3rd Select the position control method between 'Relative Position' and 'Absolute Position'.
 - 4th After entering designated position value, select and to input pulse value in the desired direction to move the position.
 - 5th If the middle button is clicked during the position moving, it does not reach the entered position and stops immediately by decelerating operation.

Note

- Start Speed, Max Speed, Accel Rate and Decel Rate can be loaded from the saved value without entering these values.
- Recognize the position when the initial power is entered as the origin. To change the origin, run home search mode.
- To specify the current position as the origin, click the 'Reset Position' button to set as the origin.

9.2.3.1 Position Override

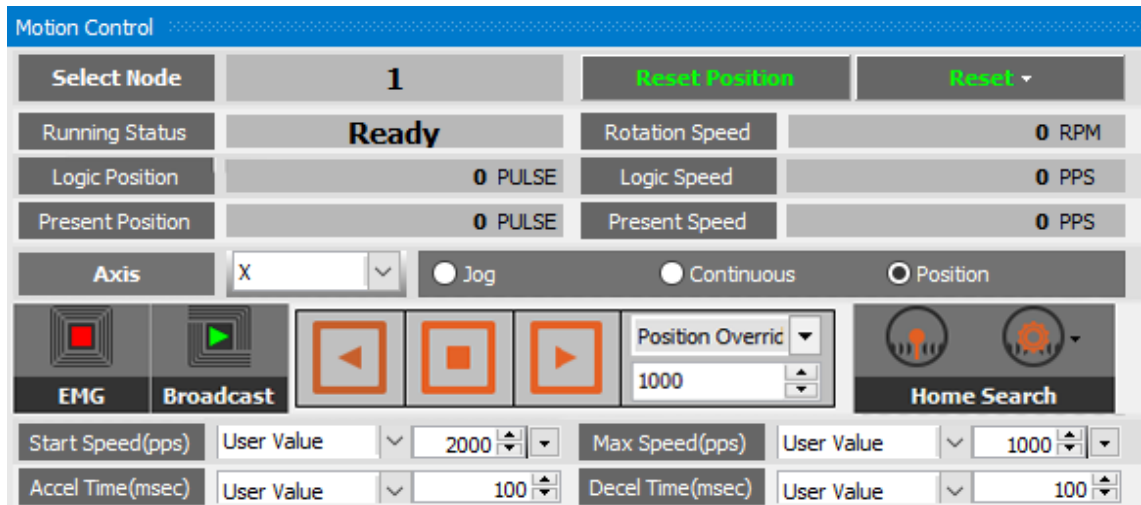






atMotion provides 'Position Override' control.

Position override control moves by changing the target position without stopping operation during position mode.

The command must be executed before reaching the initial target position. When the initial target is reached, subsequent position override commands are not executed.

The position value may change depending on the parameter 'Resolution' setting.

Check the actual position displayed on the program screen to move the position.


- Position Override operation
 - 1st Select 'Position' on Motion Control – mode selection box.
 - 2nd Set the 'Start Speed', 'Max Speed', 'Accel Rate', 'Decel Rate' value for position mode.
 - 3rd Select the position control method between 'Relative Position' and 'Absolute Position'.
 - 4th After entering designated position value, select  and  to input pulse value in the desired direction to move the position.
 - 5th Before reaching the target position, switch control mode as position override and enter the desired position value, select  and  to assign new target position.
 - 6th If the middle  button is clicked during the position moving, it does not reach the entered position and stops immediately by decelerating operation.



Note

- If the position override operation is not available properly, the position override warning occurs and the final target position is reached at the specified starting speed.

9.2.4 Program Mode

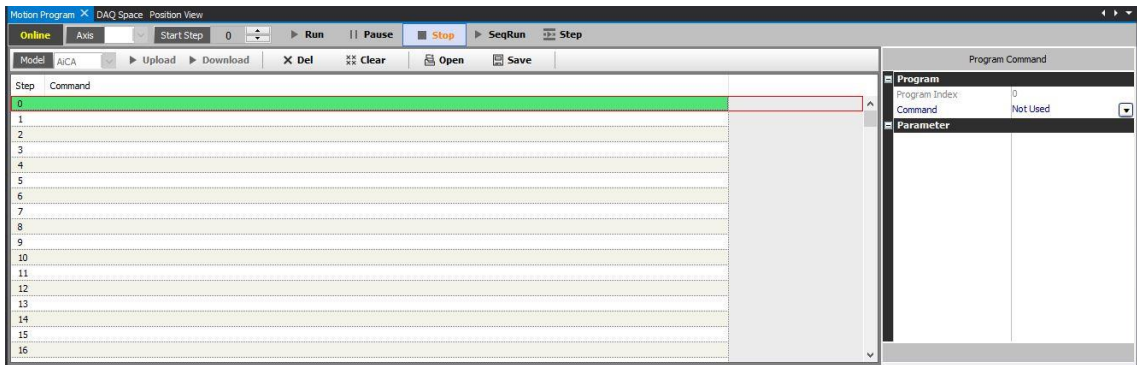

To end the program operation, 'END' command must be entered at the end of the step.

Program mode error alarm will occur when the 'END' command is not entered.

There are 256 steps in range of 0 to 255.

If the parameter 'Power On Program Start' is set to 'Enable', it automatically executes the saved program operation sequentially at initial power on.

- Program mode operation

- 1st Enter the command at the desired step.

- 2nd When step input is completed, click **▶ SeqRun** button to execute program operation sequentially.

- 3rd To start from a step other than step 0, select the step number from **Start Step** 0 and click the **▶ Run** button.

- 4th Click the **|| Pause** button to finish the active step and pause the motor. Click **▶ Run** button to start the next step.

While Program mode is in pause, click the **■ Stop** button will return to ready status.

- 5th Click the **■ Stop** button to finalize and stop the active step. Click **▶ Run** button to restart at the designated step.

- 6th When the program command 'END' reaches the entered step during program operation, the program operation is terminated.

Note



- For more information, refer to '10 Program Instructions'.
- To execute only one step, select the desired step and click the **▶ Step** button. However, executing a step with a command other than 'ABS' or 'INC', or clicking 'Stop' button during the step operation, Index mode error alarm will occur.

9.2.5 Home Search Mode

The screenshot shows the 'Motion Control' software interface. At the top, it displays 'Select Node' as '1', 'Reset Position' and 'Reset' buttons, and 'Running Status' as 'Ready'. Below this, it shows 'Logic Position' and 'Present Position' both at '0 PULSE', and 'Rotation Speed', 'Logic Speed', and 'Present Speed' all at '0 RPM', '0 PPS', and '0 PPS' respectively. The 'Axis' is set to 'X', and the mode is 'Position'. A 'Home' button is visible, and a dropdown menu is open, listing four options: 'Home Search', 'Limit Home Search', 'Zero Point Home Search', and 'Torque Home Search'. The 'Home Search' option is selected. Below the dropdown, there are input fields for 'Start Speed(pps)' (User Value, 2000), 'Max Speed(pps)' (User Value), 'Accel Time(msec)' (User Value, 100), and 'Decel Time(msec)' (User Value). The bottom of the interface shows 'Motion Program', 'DAQ Space', and 'Position View' tabs.



There are 4 types of home search mode can be executed; 'Nomal', 'Limit', 'Zero' and 'Torque'. If the parameter 'Power On Home Search' is set to 'Enable', it automatically executes the home search mode from the time when the power is applied and motor alignment is completed. (However, Home search mode error alarm occurs when it is executed by zero point home search mode operation.)

- Home search mode operation

- 1st Click  button to select the home search operation mode.
- 2nd Set the value of Start Speed, Max Speed, Accel Rate and Decel Rate for Home search mode.
- 3rd Click  button to execute the home search operation.
- 4th When the home is found, the home search operation is completed.

9.2.5.1 Normal Home Search

Connect the external origin sensor to 'ORG' and receive the signal output from the sensor to designate as home.

- 1st Click  button and select 'Home Search'.
- 2nd Click  button to execute the home search operation.
- 3rd When the operation is executed, the motor operates in the direction set in the parameter 'Home Search Direction'.
- 4th Operation starts according to the start speed set in the parameter 'Home Search Start Speed', and acceleration starts according to the acceleration time set in the parameter 'Home Search Acceleration Time'.
- 5th The constant speed operation is performed until a signal is input to the origin sensor 'ORG', when the maximum speed set in the parameter 'Home Search Max Speed' is reached.
- 6th If a signal is input to the limit sensor (\pm Limit) before the signal is input to the origin sensor 'ORG', after the deceleration stop, it operates in the opposite direction to find the origin.
- 7th When a signal is input to the origin sensor 'ORG', the motor decelerates and stops according to the deceleration time set in the parameter 'Home Search Deceleration Time'.
- 8th After stop, it moves to the opposite direction as far as the distance past the origin sensor at the start speed set in the parameter 'Home Search Start Speed' to find the origin sensor and stops.
- 9th When the origin found, the operation completion signal (In-Position) is output and the In-Position indicator lights to indicate the status.





Note

- If a value other than 0 is set in the parameter 'Home Search Offset', it moves to the set position value after finding the home and outputs the operation completion signal (In-Position) and lights up in the In-Position indicator to display the status.
- If a value other than 0 is set in the parameter 'Home Search Position Set', the position specified after finding the home is set to the set value other than 0.
- In normal home search mode, Home search mode error alarm occurs if the ORG signal does not input until it reaches the opposite limit sensor past the limit sensor (\pm Limit).

9.2.5.2 Limit Home Search

Connect the external limit sensor to '±Limit' and receive the signal output from the sensor to designate as home.

If the parameter 'Software Limit' is set to 'Enable', the home search mode is available with Software ±Limit.

- 1st Click  button and select 'Limit Home Search'.
- 2nd Click  button to execute the home search operation.
- 3rd When the operation is executed, the motor operates in the direction set in the parameter 'Home Search Direction'.
- 4th Operation starts according to the start speed set in the parameter 'Home Search Start Speed', and acceleration starts according to the acceleration time set in the parameter 'Home Search Acceleration Time'.
- 5th The constant speed operation is performed until a signal is input to the limit sensor '±Limit' when the maximum speed set in the parameter 'Home Search Max Speed' is reached.
- 6th If a signal is input to the limit sensor (±Limit) or reaches to Software ±Limit, the motor decelerates and stops according to the deceleration time set in the parameter 'Home Search Deceleration Time'.
- 7th After stop, it moves to the opposite direction as far as the distance past the limit sensor at the start speed set in the parameter 'Home Search Start Speed' to find the limit sensor and stops.
- 8th When the home found, the operation completion signal (In-Position) is output and the In-Position indicator lights to indicate the status.



Note

- If a value other than 0 is set in the parameter 'Home Search Offset', it moves to the set position value after finding the home and outputs the operation completion signal (In-Position) and lights up in the In-Position indicator to display the status.
- If a value other than 0 is set in the parameter 'Home Search Position Set', the position specified after finding the origin is set to the set value other than 0.
- If the deceleration time is set long during deceleration and stop, it may collide with the structure, so the deceleration time should be set short or the limit sensor should be installed from the structure with sufficient margin.



9.2.5.3 Zero Point Home Search

Zero point home search operation can be performed by specifying zero point (absolute coordinate '0') as home.

To change the home position, use 'Reset Position'.

The zero point should be re-assigned since the zero point is also reset when reset or resupplying the power.

Home search mode error alarm occurs since the zero point is not assigned when use automatically execution by setting parameter 'Power On Home Search' is set to 'Enable'.

- 1st Click  button and select 'Zero Point Home Search'.
- 2nd Click  button to execute the home search operation.
- 3rd When the operation is executed, the motor operates in the direction set in the parameter 'Home Search Direction'.
- 4th Operation starts according to the start speed set in the parameter 'Home Search Start Speed', and acceleration starts according to the acceleration time set in the parameter 'Home Search Acceleration Time'.
- 5th The constant speed operation is performed when the maximum speed set in the parameter 'Home Search Max Speed' is reached.
- 6th As closer to home (zero point), the motor decelerates and stops according to the deceleration time set in the parameter 'Home Search Deceleration Time'.
- 7th When the home found, the operation completion signal (In-Position) is output and the In-Position indicator lights to indicate the status.





Note

- If a value other than 0 is set in the parameter 'Home Search Offset', it moves to the set position value after finding the home and outputs the operation completion signal (In-Position) and lights up in the In-Position indicator to display the status.
- If a value other than 0 is set in the parameter 'Home Search Position Set', the position specified after finding the origin is set to the set value other than 0.

9.2.5.4 Torque Home Search

If there is no home sensor and limit sensor, home search mode can be executed by contact with a specific instrument.

If the torque value is output as much as the value set in the parameter 'Home Search Torque' after contacting a specific device, the position that has moved in the opposite direction by the position value set in the parameter 'Home Search Offset' is designated as the origin.

- 1st Click  button and select 'Torque Home Search'.
- 2nd Click  button to execute the home search operation.
- 3rd When the operation is executed, the motor operates in the direction set in the parameter 'Home Search Direction'.
- 4th Operation starts according to the start speed set in the parameter 'Home Search Start Speed', and acceleration starts according to the acceleration time set in the parameter 'Home Search Acceleration Time'.
- 5th The constant speed operation is performed until contact is made with a specific instrument.
- 6th Stops when the load is applied as the torque value set in the parameter 'Home Search Torque' by contacting a specific instrument.
- 7th After stop, it moves to the opposite direction as far as the distance past the limit sensor at the start speed set in the parameter 'Home Search Start Speed' and stops.
- 8th The operation completion signal (In-Position) is output and the In-Position indicator lights to indicate the status.



Note

- If a value other than 0 is set in the parameter 'Home Search Position Set', the position specified after finding the origin is set to the set value other than 0.

10 Program Instructions

There are 14 program instructions as below table.

Type	Instruction	Description
Drive	ABS	Absolute position move
	INC	Relative position move
	HOM	Home search
Input/Output	ICJ	Input condition jump
	IRD	Input wait
	OPC	Output port ON/OFF
	OPT	Output port ON pulse
	CMP	Compare output
Program control	JMP	Jump
	REP	Repeat start
	RPE	Repeat end
	END	Program end
	POS	Position set
	TIM	Ready

10.1 Drive Instruction

10.1.1 ABS (absolute position move)

It is for moving to absolute position by a specified distance from home.

Instruction	DATA				
ABS	Instruction	Start speed	Max speed	Acceleration	Deceleration
	Position	S Curve		S Curve time	Continuation


For more information, refer to the '11.1.1Fixed Pulse and Continuous Pulse Drive'.

- Start speed (start drive speed)
 - : Select the start drive speed during drive.
 - Set the start drive speed from 1 to 5.
 - When selecting start speed as 6, it is available to set as the desired value.
- Max speed (max. drive speed)
 - : Select the max. drive speed during drive.
 - Set the max. drive speed from 1 to 5.
 - When selecting max. speed as 6, it is available to set as the desired value.
- Acceleration
 - : Set the acceleration time of drive.
 - Set the acceleration time from 1 to 5.
 - When selecting acceleration as 6, it is available to set as the desired value.
- Deceleration
 - : Set the deceleration time of drive.
 - Set the deceleration time from 1 to 5.
 - When selecting deceleration as 6, it is available to set as the desired value.
- Position: Moving position inputs as absolute value.
 - In case of "Present position–Moving position > 2,147,483,647" or "Present position–Moving position < -2,147,483,648", it is out of range to move and program mode error occurs.
- S Curve
 - : Set use/not use of S-curve acceleration/deceleration.
 - Enable=Use S-curve acceleration/deceleration
 - Disable=Not use S-curve acceleration/deceleration
- S Curve Time
 - : When using S curve, set the S-curve acceleration/deceleration time.

- Continuation
: It drives continuously removing acceleration/deceleration time of each step at program mode.

Set the use/not use continuation.

- Enable=Use continuation
- Disable=Not use continuation

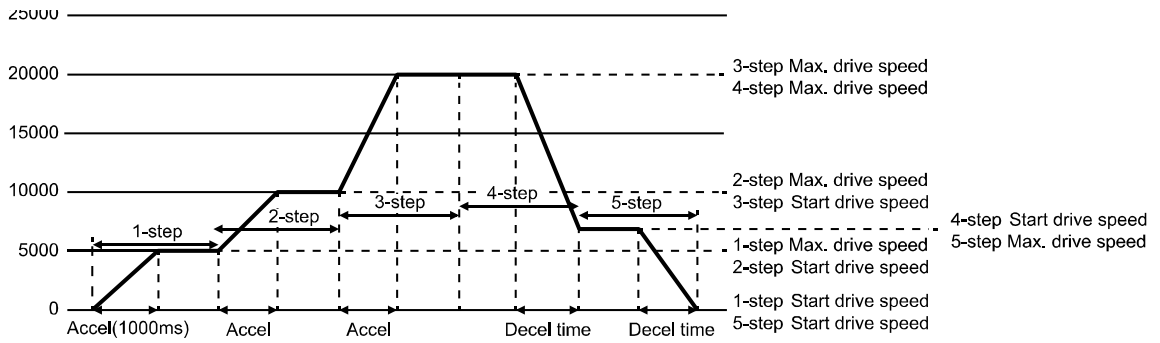

Step	Acceleration time (ms)	Deceleration time (ms)	Start drive speed (pps)	Max. drive speed (pps)
1	1,000	0	500	5,000
2	1,000	0	5,000	10,000
3	1,000	0	10,000	20,000
4	0	1,000	7,000	20,000
5	0	1,000	0	7,000



Note

- For the step with acceleration, set deceleration time as 0ms.
- For the step with deceleration, set acceleration time as 0ms.

10.1.2 INC (relative position move)

It is for moving to relative position by a specified distance from current position.

Instruction	DATA				
	INC	Instruction	Start speed	Max speed	Acceleration
Position		S Curve		S Curve time	Continuation


For more information, refer to the '11.1.1 Fixed Pulse and Continuous Pulse Drive'.

- Start speed (start drive speed)
 - : Select the start drive speed during drive.
 - Set the start drive speed from 1 to 5.
 - When selecting start speed as 6, it is available to set as the desired value.
- Max speed (max. drive speed)
 - : Select the max. drive speed during drive.
 - Set the max. drive speed from 1 to 5.
 - When selecting max. speed as 6, it is available to set as the desired value.
- Acceleration
 - : Set the acceleration time of drive.
 - Set the acceleration time from 1 to 5.
 - When selecting acceleration as 6, it is available to set as the desired value.
- Deceleration
 - : Set the deceleration time of drive.
 - Set the deceleration time from 1 to 5.
 - When selecting deceleration as 6, it is available to set as the desired value.
- Position: Moving position inputs as relative position value.
 - Moving range for input is -2,147,483,648 to 2,147,483,647.
- S Curve
 - : Set use/not use of S-curve acceleration/deceleration.
 - Enable=Use S-curve acceleration/deceleration
 - Disable=Not use S-curve acceleration/deceleration
- S Curve Time
 - : When using S curve, set the S-curve acceleration/deceleration time.

- Continuation
: It drives continuously removing acceleration/deceleration time of each step at program mode.

Set the use/not use continuation.

- Enable=Use continuation
- Disable=Not use continuation

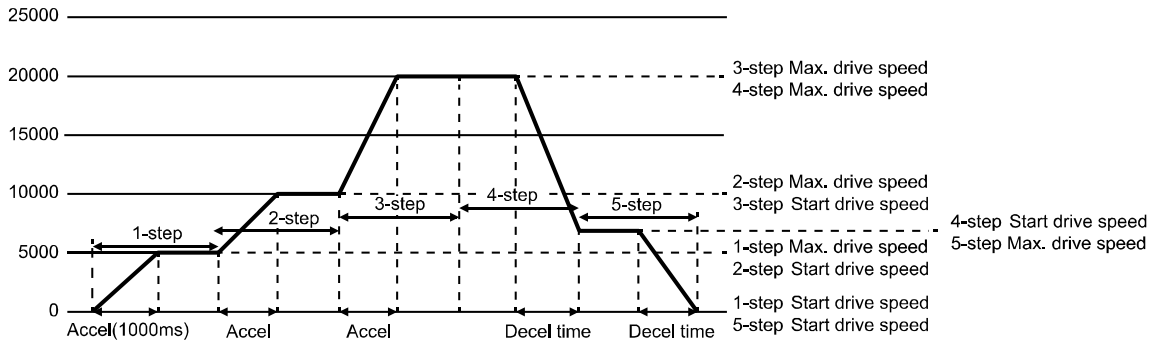

Step	Acceleration time (ms)	Deceleration time (ms)	Start drive speed (pps)	Max. drive speed (pps)
1	1,000	0	500	5,000
2	1,000	0	5,000	10,000
3	1,000	0	10,000	20,000
4	0	1,000	7,000	20,000
5	0	1,000	0	7,000



Note

- For the step with acceleration, set deceleration time as 0ms.
- For the step with deceleration, set acceleration time as 0ms.

10.1.3 HOM (home search)

It is for home search according to the set parameter of Home Search Mode (Home search mode).

Instruction	DATA
HOM	instruction

For more information, refer to the '9.5Home search'.

10.2 Input/Output Instruction

10.2.1 ICJ (input condition jump)

It is for jumping to the set step (Step No.) when the selected input port is activated.

When the input port is deactivated, it runs the next step.

Instruction	DATA		
ICJ	Instruction	Step no.	Input port

- Step No.: Set the step number to jump. Setting range is 0 to 255.
- Input port: Select Input port number.

For more information of input port number, refer to '8.1.2General Input (9)'.



Caution

At the loop between REP, RPE instruction, do not use ICJ (Input condition jump).

10.2.2 IRD (input wait)

It is for moving the next step when the selected input port is activated.

When the input port is deactivated, it waits at the current step until the active status.

Instruction	DATA	
IRD	Instruction	Input port

- Input port: Select the input port number.

For more information of input port number, refer to '8.1.2General Input (9)'.

10.2.3 OPC (output port ON/OFF)

Instruction	DATA		
OPC	Instruction	Output port	Level

It turns ON/OFF the selected output port.

- Output port: Select the output port number.

For more information of output port number,
refer to '8.2.2General Output (AiC-D: 10, AiC-D-B: 9)'.

- Level: When setting as Enable, it turns ON. When setting as Disable, it turns OFF.

10.2.4 OPT (output port ON pulse)

It turns the set output port ON during the set ON time.

Instruction	DATA			
OPT	Instruction	On time	Output port	Next step

- On Time: Set the ON time for output port.
Setting range is 1 to 10,000msec.
- Output port: Set the output port number.
For more information about output port number, refer to '8.2.2General Output (AiC-D: 10, AiC-D-B: 9)'.
- Next step
 - ON: It moves to the next step regardless of output operation.
 - OFF: It turns the set output port ON during the set ON time. After the time, it moves to the next step.

10.2.5 CMP (compare output)

It outputs trigger pulse for the set period.

Instruction	DATA					
CMP	Instruction	Pos	Port	Mode	Width	Period

For more information, refer to '8.2.1.3Compare1, Compare2'.

- Position
: Set the trigger position of output signal.
Setting range is 1 to 10,000 msec
- Compare Port
: Set the compare output port number.
- Compare Mode
: Set the compare output mode.
- Pulse Width
: Set the output pulse width.
Applied when compare mode is 3.
Setting range is 1 to 10,000 msec.
- Pulse Period
: Set the output pulse period.
Applied when compare mode is 3.
Setting range is 1 to 2,147,483,647.

10.3 Program Control Instruction

10.3.1 JMP (jump)

It jumps to the designated step (Step No.).

Instruction	DATA	
JMP	Instruction	Step no.

- Step No. : Set the step number to jump. Setting range is 0 to 255.



Caution

When using JMP instruction, be sure to the position of END instruction.


At the loop between REP, RPE instruction, do not use JMP (jump).

10.3.2 REP (repeat start)

It operates repeatedly for the set times from the next step of this instruction to RPE (repeat end instruction).

Instruction	DATA	
REP	Instruction	Repeat count

- Repeat Count : Set the repeat times. Setting range is 1 to 255.
RPE (repeat end) instruction should be below (higher step number) of the REP (repeat start) instruction. The lower nested loops are available up to 3.

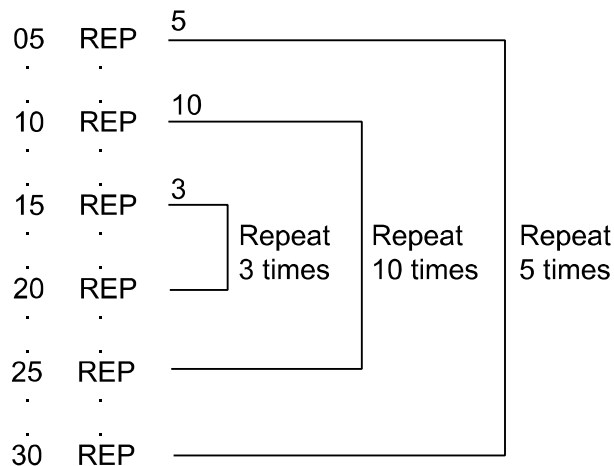

10.3.3 RPE (repeat end)

It is end instruction of REP (repeat start).

Instruction	DATA
RPE	Instruction

It operates repeatedly at the set times from REP (repeat start) instruction to the RPE (repeat end) instruction.



Caution

At the loop between REP, RPE instruction, do not use jump instruction (JMP, ICJ).

10.3.4 END (program end)

It ends program. You must enter this instruction at the end of program.

Instruction	DATA
END	Instruction

10.3.5 POS (position set)

It sets the position value.

Instruction	DATA
POS	Instruction Position

- Position: Set the position value. Setting range is -2,147,483,648 to +2,147,483,647.

10.3.6 TIM (ready)

It is ready instruction for the set time.

Instruction	DATA
TIM	Instruction Delay time

- Delay Time level
 - : Set the wait time as msec.
 - Set the Delay Time level from 1 to 5.
 - When selecting Delay Time level as 'User Value', it is available to set as the desired value in the range of 1 to 10,000 msec.

11 Driver Function

11.1 General Drive


11.1.1 Fixed Pulse and Continuous Pulse Drive

Drive pulse output on each axis is basically in +/- directions by drive instruction of a fixed or continuous pulse.

11.1.1.1 Fixed Pulse Drive

Fixed pulse drive is used to move something a fixed amount. It operates fixed speed or acceleration/deceleration drive for a specified number of output pulses.

Acceleration/Deceleration fixed pulse drive starts to reduce speed when remaining output pulse is less than the pulse used for acceleration. It ends drive when it finishes generating pulse, as shown in the image below.

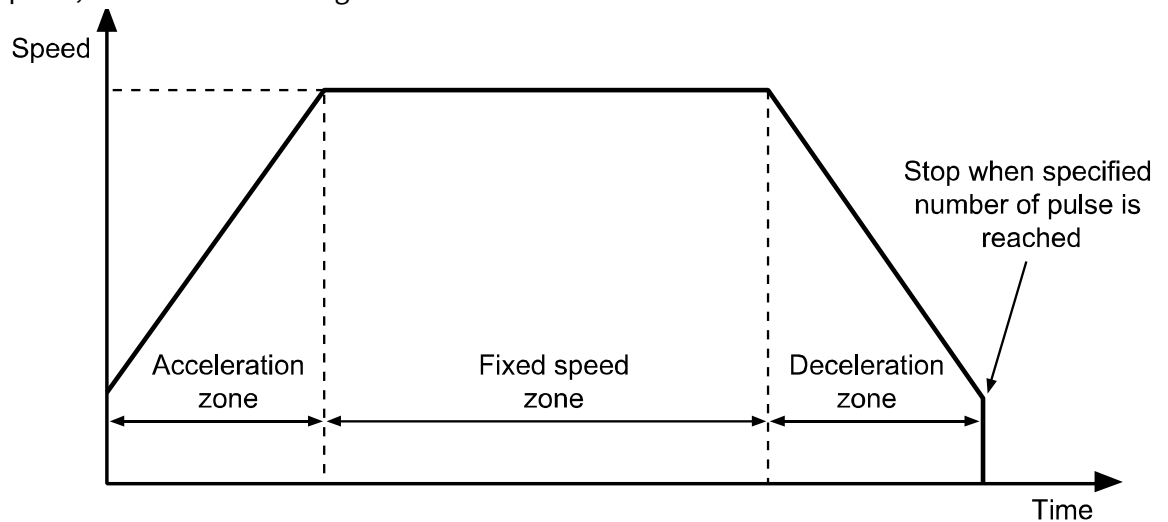

- Absolute position movement and relative position movement
 : There are absolute position movement and relative position movement.
 These are fixed pulse drive.


(1) Absolute Position Move

Absolute position movement drives from home to the position of a specified distance.

This is ABS command in program mode.


**Ex.**

- Absolute Position Move is a command based on home.
- For example, if the command moving 9,000 pulse for 3 times using the Absolute Position Move (ABS), it arrives to the point A in the diagram below.
- Absolute Position Move (ABS) command must be set each 9,000/18,000/27,000 pulse to reach A, B, C points in the diagram below.

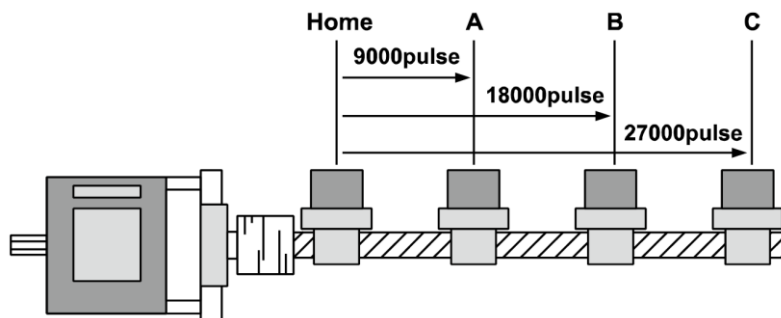
**(2) Relative Position Move**

Relative position movement sets a distance to drive from present coordinates.

 This is INC of program mode.

**Ex.**

- Relative Position Move is as the diagram below.
- For example, if the command moving 9,000 pulse for 3 times using the Relative Position Move (INC), it arrives to the point A, B, C sequentially in the diagram below.

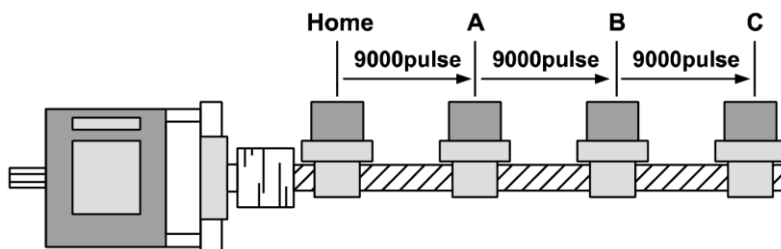**11.1.1.2 Continuous Drive**

Continuous pulse drive outputs drive pulse sequentially until the stop command from the high level or external stop signal becomes active. Continuous mode and home search mode are in this category.

Decelerating stop and immediate stop are in stop instruction. Slow stop is applied in almost every case except when drive speed is lower than initial speed, reset and emergency stop.

11.1.2 Speed Curve

Drive pulse output of each axis operates by CW direction, CCW direction fixed pulse drive instruction or continuous drive instruction. However, it can operate speed curve of fixed speed, trapezoidal acceleration/deceleration, S-curve acceleration/deceleration by operation mode setting or parameter.

11.1.2.1 Constant Speed Drive


Constant speed drive outputs pulse at a constant speed.

When the start drive speed and the max. drive speed are set as same value or the acceleration or the deceleration time is set as 0, it operates constant speed drive without acceleration/ deceleration.

This max. drive speed settings should be higher than or same as start drive speed.

11.1.2.2 Symmetric Trapezoidal Acceleration/Deceleration Drive

- Trapezoidal acceleration/deceleration drive accelerates from initial speed to drive speed trapezoidally with an inclination of the designated acceleration.
- Set acceleration/deceleration time as msec at “Acceleration Time 1 to 5”, “Deceleration Time 1 to 5” parameter.
- It counts the pulses consumed while accelerating to a specified drive speed, and starts decelerating when the remaining output pulse becomes less than accelerating pulse. This decelerating drive reduces speed to initial speed with specified acceleration. In continuous pulse drive, it decelerates to initial speed when the stop signal is activated, and stops immediately when it reaches initial speed.

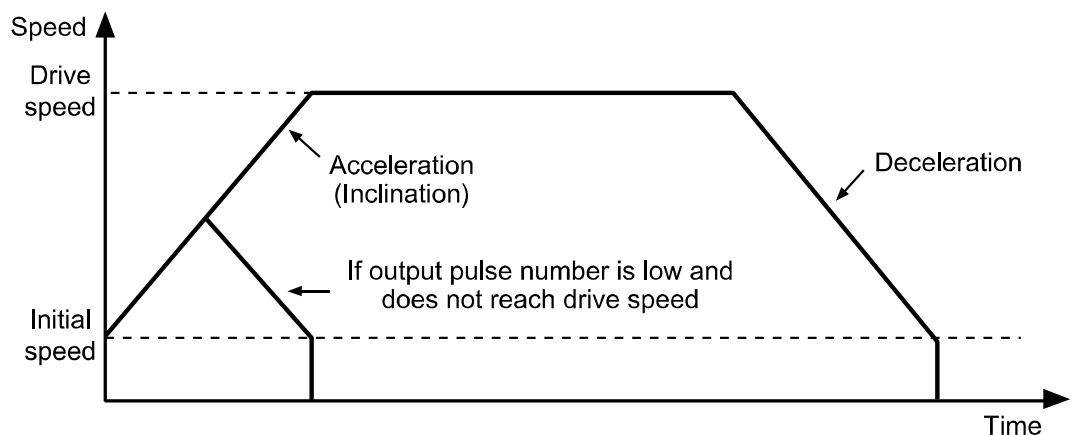

Note

- When speed override operates during constant speed drive, the set acceleration/deceleration time is changeable.
- For continuous drive or jog drive by I/O, acceleration/deceleration time is set at “Acceleration Time 1”, “Deceleration Time 1”.
- When it arrives with not the max. drive speed at the target position due to long acceleration time and short command position, acceleration time may be changed.


11.1.2.3 Asymmetric Trapezoidal Acceleration/Deceleration Drive

- AiC-D is available as asymmetric trapezoidal acceleration/deceleration drive which is different between acceleration speed and deceleration speed.


For moving the object to the vertical direction such as stacking device of semiconductor wafer, the gravity acceleration speed is added to the object and acceleration speed and deceleration speed for up/down movement should be different.

In this case, it operates asymmetric trapezoidal acceleration/deceleration drive.

- When deceleration speed is higher than acceleration speed,

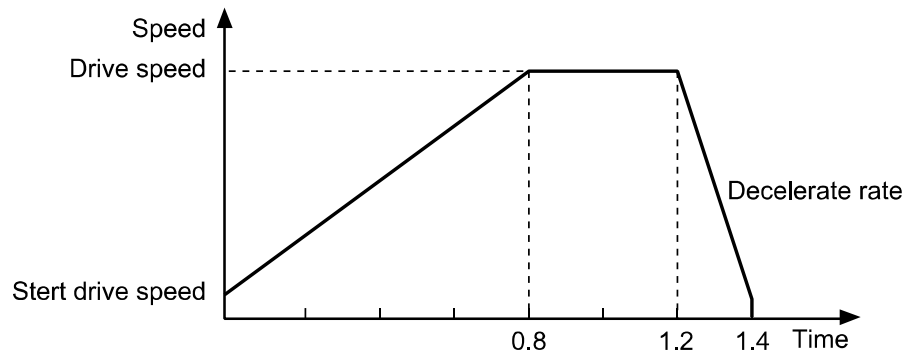

- When acceleration speed is higher than deceleration speed,

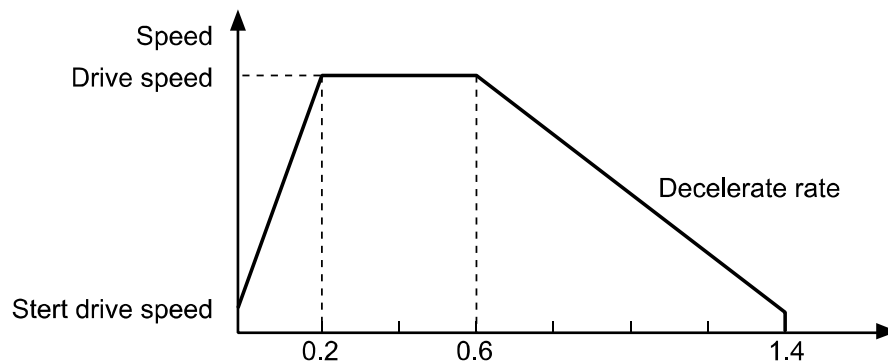


11.1.2.4 S Curve (S-curve acceleration/deceleration)

S curve generates an S shape speed curve according to linear increase/decrease of drive acceleration/deceleration. It smoothly increases and reduces speed when starting and stopping, and helps achieve smoother operation.



Note

- a, b, c=Acceleration Time
- d, e, f=Deceleration Time
- S curve occurs at the a, c, d, f zones during the set “S Curve Time”.
- When “S Curve Time” is set the half of “Acceleration Time (=Deceleration Time)”, it operates S curve without b, e (trapezoidal zone).

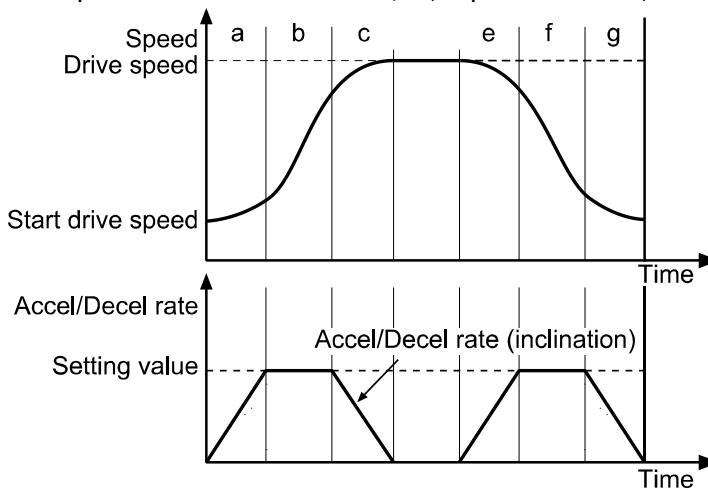

Caution


Precautions for S curve acceleration/deceleration drive

- In a fixed pulse S curve acceleration/deceleration drive, you cannot change speed while driving.
- At S-curve acceleration/deceleration fixed pulse drive, “S Curve Time (S-curve acceleration/deceleration time)” is set 1/2 of “Acceleration Time (=Deceleration Time)”. If it is set over 1/2, the drive pulse ends during deceleration before arriving the start drive speed or it outputs the left drive pulses as start drive speed and does not stop even though arriving the start drive speed.
- During S curve operation, acceleration/deceleration time should be set as same. If it is set differently, deceleration time is set same as acceleration time.

**Ex.**

- Example of S-curve acceleration/deceleration parameter setting (full S-curve acceleration/deceleration)

This example is S-curve acceleration with start drive speed 0 pps and max. drive speed 40 kpps during 0.4 sec. For full S-curve acceleration drive without trapezoidal zone, set the “S Curve Time” as 0.2 sec which is half of acceleration time.

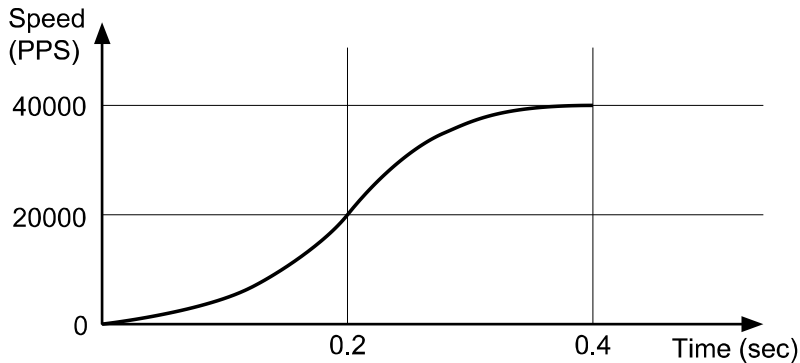

1st Start drive speed as 0 is ignored.

2nd This is full S-curve acceleration. During 0.2 sec, it drives trapezoidal acceleration up to 20,000pps.


3rd At the left 0.2 sec, it drives trapezoidal deceleration up to 40,000pps.

For each setting value of parameters and descriptions, refer to the below table.

Parameter	Setting value	Description
Acceleration Time (acceleration time)	4000 msec	For S-curve drive, acceleration/deceleration time should be same.
Deceleration Time (deceleration time)	4000 msec	
S Curve Time (S-curve acceleration/deceleration time)	2000 msec	For S-curve drive without trapezoidal, it should be set the half of acceleration/deceleration time.
Start Speed (start drive speed)	0 pps	-
Max Speed (max. drive speed)	40000 pps	-

- Example of S-curve acceleration/deceleration parameter setting (partial S-curve acceleration/deceleration)

This example is S-curve acceleration with start drive speed 0 pps and max. drive speed 40 kpps during 0.6 sec. Follow the below graph.

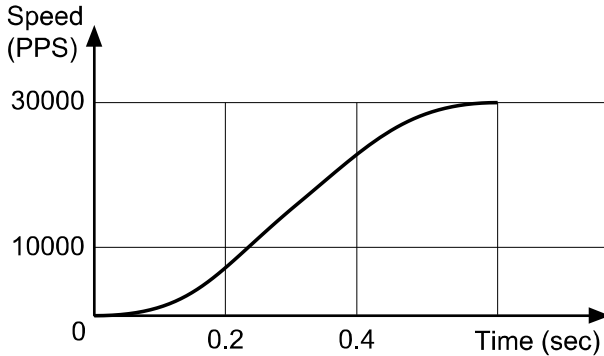

1st Start drive speed as 0 is ignored.

2nd During 0.2 sec, it drives trapezoidal acceleration up to 10,000pps.

3rd During 0.2 to 0.4 sec, it maintains the certain acceleration speed up to 30,000pps.

4th At the left 0.2 sec, it drives trapezoidal deceleration up to 40,000pps.

For each setting value of parameters and descriptions, refer to the below table.

Parameter	Setting value	Description
Acceleration Time (acceleration time)	6000 msec	For S-curve drive, acceleration/deceleration time should be same.
Deceleration Time (deceleration time)	6000 msec	
S Curve Time (S-curve acceleration/deceleration time)	2000 msec	It applies start drive speed + S Curve Time and max. drive speed - S Curve Time.
Start Speed (start drive speed)	0 pps	-
Max Speed (max. drive speed)	40000 pps	-

- Comparing S curve and Trapezoid acceleration/deceleration drive

Trapezoid acceleration/deceleration may cause problems at start and end points in a very sensitive system. When used for a system that must be heavy, fast and accurate, and acceleration sharply changes at start and end points, it is hard on the system. On the other hand, S curve smoothly increases acceleration at the start point and decreases it smoothly at the end point. Therefore S curve acceleration/deceleration is recommended for sensitive systems.

11.2 Other Functions

11.2.1 Limit Operation

Hardware and software limits can be used to stop drive.

- Hardware limit

Install a limit sensor to the machine to monitor system operation directly.

Connect Nlmt+/- (Pin19, 20) at I/O connector (CN3).

- Set Instant (instant stop) / Slow (deceleration stop) at Limit Stop Mode (limit Stop mode) of Operation Mode.

- Software limit

Unlike the input of hardware limit signal by external sensor, this limit function is set using internal position data. To operate software limit, set software limit (software limit) as Enable.

High and low limit values can be set the each axis separately at \pm software limit (\pm software limit) parameter.

Operation Mode	Setting value	Parameter	Setting value
Software Limit	Enable	+Software Limit	100,000
		-Software Limit	-50,000

When the setting value is as above, the position value operates among -50,000 to 100,000 range. When it is out of the range, the drive decelerates and stops.



Note

Hardware limit operates independently regardless of the software limit settings, and only hardware limit except limit home search is operated during home search.

11.2.2 Position Control Gain Setting

It is available to set responsiveness of motor to position instruction at the parameter. According to the motor load, set the gain for fast positioning and soft movement.

- P Gain: Adjusts vibration during drive
- I Gain: Adjusts vibration in acceleration/deceleration zone.
- The set gain value applies when motor stops.

Parameter	Setting	Value (ratio)	
		P	I
GAIN	0 (factory default)	1	1
	1	2	1
	2	3	1
	3	4	1
	4	5	1
	5	1	2
	6	2	2
	7	3	2
	8	4	2
	9	5	2
	10	1	3
	11	2	3
	12	3	3
	13	4	3
	14	5	3
15	User setting		



Ex.

- When GAIN is set as 1,
P: I=2:1
The set value is the ratio between P and I.
- When GAIN is set as 15,
user can set each GAIN value at the atMotion.

Parameter	Setting range	Unit
P GAIN	0 to 7	0.001
I GAIN	0 to 4	0.001



Note

Speed Filter and PI GAIN can be set at the same time.

11.2.3 Stop Current

When it stops, set the stop current supplied at the motor phase to decrease motor heat and current consumption.

- Factory default is 50% of max. run current. It is available to set at the parameter.

Parameter	Setting range	Unit	Unit value	factory default
Stop Current	20 to 100	%	1	50

11.2.4 Stop Current Fix


Set the stop current control method; Enable, Disable (factory default).

- Enable: Fixed stop current
: It maintains stop current as the set value at the parameter.
- Disable: Setting stop current
: It adjusts by stop current load and it is able to reduce over heat of motor.

11.2.5 Speed Filter

It is available to set motor drive response according to the instruction at the parameter.

Set the speed filter value for time delay between the command position and motor. It is able to drive softly even though load changing or disturbance occurs.

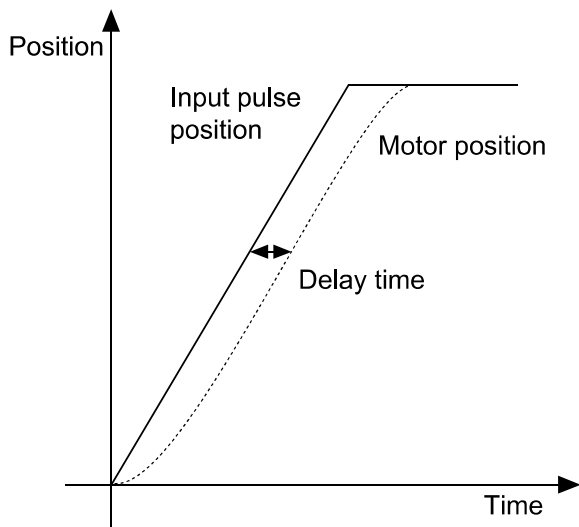

Parameter	Setting	Value (msec)
Speed Filter	0	Disable
	1	2
	2	4
	3	6
	4	8
	5	10
	6	20
	7	40
	8 (factory default)	60
	9	80
	10	100
	11	120
	12	140
	13	160
	14	180
15	200	


11.2.6 In-Position

In-Position output is output condition of positioning completion signal.

If the gap between target position and real position is under in-position setting value after position command pulse has finished, in-position output turns ON and the in-position indicator turns ON.

In reverse, when the gap is over in-position setting value, in-position output turns OFF and the in-position indicator turns OFF.

- Fast response: When gap between the target position and the current position is lower than the setting value, it outputs in-position signal immediately.
- Accurate response: When gap between the target position and the current position is lower than the setting value and maintains over 50 msec, it outputs in-position signal.

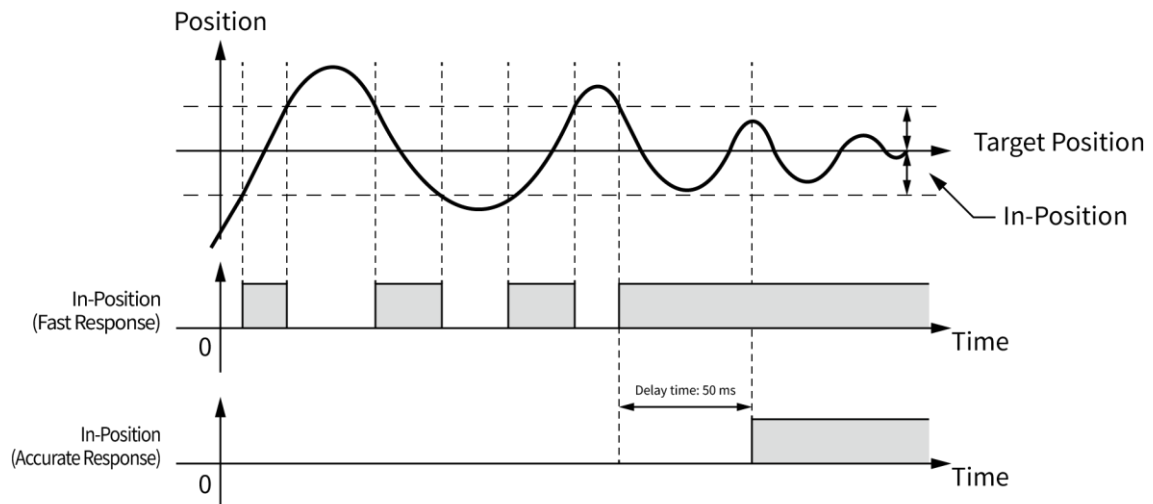

Fast response		Accurate response	
Setting	Value	Setting	Value
0	0	8	0
1	±1	9	±1
2	±2	10	±2
3	±3	11	±3
4	±4	12	±4
5	±5	13	±5
6	±6	14	±6
7	±7	15	±7



Note

For accurate control, check the in-position output before the next drive.

11.2.7 Servo Off

This signal is for rotating the shaft using external force or used for manual positioning. Servo Off signal is input while motor is stopped, the phase current is cut to release torque. In Servo Off status, break is locked. In case of changing as released status, apply signal on input signal “Brake ON/OFF”.



Note

For the safety reason, this is not available while motor is in operation.

11.2.8 Motor Direction

Sets the rotating direction of the motor during Jog and Continuous operation. Even when the power is applied again, the motor will rotate in the direction set in the parameter “Motor Dir”.


DIR setting	+Jog/+Run	-Jog/-Run
Forward	Rotates to CW direction	Rotates to CCW direction
Backward	Rotates to CCW direction	Rotates to CW direction

11.2.9 Position Override

Position override moves by changing the target position without stopping operation during position mode.

The command must be executed before reaching the initial target position. When the initial target is reached, subsequent position override commands are not executed.

The position value may change depending on the parameter ‘Resolution’ setting.

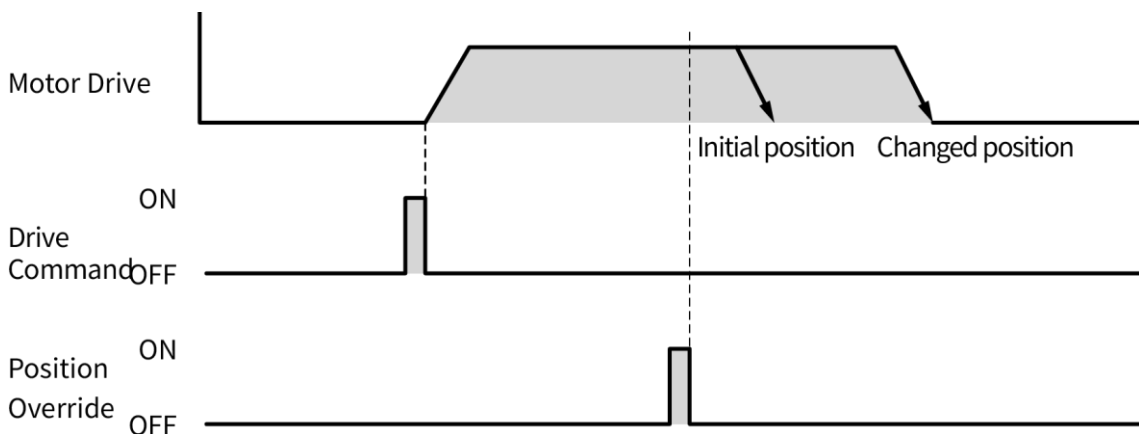

Note

- If the position override operation is not available properly, the position override warning occurs and the final target position is reached at the specified starting speed.
- For more information of operation refer to ‘9.2.3.1 Position Override’.

12 Protection Function

12.1 Alarm

 
- This function stops motor to protect driver, depending on the error status such as over current or over speed.
- After removing the cause of alarm, re-supply power or apply the signal on Alarm Reset, the driver returns to the normal status.



Note

- ※ Depending on the alarm/warning type, it displays as a segment and indicator on the Alarm/Status display part.
- ※ When alarm/warning occurs, indicators flash with interval of 0.4 sec and turn OFF with interval of 0.8 sec until the alarm/warning is cleared.

<E.g. In case of alarm no. 3>



1) Motor stops, torque releases and brake locks

No. of flashing	Alarm type	Descriptions	Causes	Troubleshooting
1	Over current error	When over current flows at motor RUN element	1. Over load 2. Insufficient SMPS capacity	1. Change operation condition or reduce load so that sudden load fluctuation does not occur. 2. Check that less than the recommended SMPS capacity is used. 3. Check driver break.
2	Over speed error	When motor speed is over 4,000rpm	1. When overload is applied and released at a moment. 2. Turning more than 4,000 rpm by external force.	1. Change operation condition or reduce load so that sudden load fluctuation does not occur. 2. Change the operating condition so that the motor does not rotate more than 4,000 rpm.
3	Position tracking error	When the gap between position command value and current position value is over 90°	1. Over load 2. Motor connector and cable connection error 3. Burnout of line driver IC in encoder	1. Change operation condition or reduce load so that sudden load fluctuation does not occur. 2. Check motor connector and cable connection. 3. Replace the line driver IC in encoder.
4	Overload error	When applying load over the rated load for over 1 sec.	1. Over load 2. Insufficient SMPS capacity	1. Change operation condition or reduce load so that sudden load fluctuation does not occur. 2. Check that less than the recommended SMPS capacity is used. 3. Check driver break.

No. of flashing	Alarm type	Descriptions	Causes	Troubleshooting
5	Overheat error	When driver inner temperature is over 80°C	1. Installed in an enclosed space	1. Change the installation environment. -Air flow around driver installation. -Heat dissipation (heat sink or fan)
6	Motor connection error	When motor cable connection error occurs at driver	1. Motor connector and cable connection error 2. Burnout of the inverter in the driver	1. Check motor connector and cable connection. 2. Replace burned parts of the inverter in the driver.
7	Encoder connection error	When encoder cable connection error occurs at driver	1. Motor connector and cable connection error 2. Burnout of line driver IC in encoder	1. Check motor connector and cable connection. 2. Replace the line driver IC in encoder.
8	Regenerative voltage error	When regenerative voltage is over 78V	1. Over load 2. Excessive force due to rapid deceleration	1. Change operation condition or reduce load so that sudden load fluctuation does not occur.
9	Motor misalignment	When motor is in misalignment	1. Motor connector and cable connector error 2. Burnout of line driver IC in driver 3. Burnout of line driver IC in encoder 4. Burnout of the inverter in the driver	1. Check motor connector and cable connection. 2. Replace the line driver IC in driver. 3. Replace the line driver IC in encoder. 4. Replace burned parts of the inverter in the driver.
10	Command speed error	When command speed is over 3,500rpm	1. Enter error of user command speed input	1. Use recommended specifications. (max. 3,000rpm input) 2. Enter the speed value (PPS) by checking the resolution.
11	Input voltage error	When input voltage is out of 24VDC $\pm 10\%$	1. Over load 2. Insufficient SMPS capacity 3. Power input over the specification (24VDC $\pm 10\%$)	1. Change operation condition or reduce load so that sudden load fluctuation does not occur. 2. Check that less than the recommended SMPS capacity is used. 3. Check the power specification. (24VDC $\pm 10\%$)
12	In-Position error	When position error (over 1) is kept over 3 sec, after motor stopped.	1. Over load 2. Lack of stop torque.	1. Change operation condition or reduce load so that sudden load fluctuation does not occur. 2. Increase stop torque as 50% or use the other motor with higher torque.
13	Memory error	When memory error is detected as power supplied	1. EEPROM error	1. Replace EEPROM parts.

2) Motor stops, torque maintains and brake releases

No. of flashing	Alarm type	Descriptions	Causes	Troubleshooting
14	Emergency stop ※1	When emergently stopped with emergency stop command	1. When emergency stop enters	1. Check EMG signal. 2. Check Active Level Setting of EMG signal.
15	Program mode error	When 'END' command is not exist at the last step	1. If there is no 'END' instruction at the last step of the program 2. If there is an empty step in the middle of the program.	1. Add 'END' command at last step of program. 2. Remove an empty step in middle of a program.
16	Index mode error	When other instruction is used but 'INC', 'ABS' When index command is not completed due to the stop command	1. When running a step with commands other than 'INC' and 'ABS'. 2. When entering the stop command during driving on index mode	1. Check whether the command of the step is 'INC' or 'ABS' 2. Check that the selected step number is correct.
17	Home search mode error	When failed to find home	1. If there is no 'ORG' or '+/- Limit' input 2. If load above the set value is not applied (torque home search) 3. When a stop command is issued during home search operation	1. Check if the ORG signal is correctly input (general home search) 2. Check if the +/- Limit signal is correctly input (limit home search) 3. Check if the +/- Limit signal is correctly set with the motor rotation direction. (CW direction: +Limit, CCW direction: -Limit) 4. Change the value of the Home search Torque parameter (torque home search)

※1. When emergency stop alarm occurs, all drive stops and all output turn OFF regardless of the output remain setting.

12.2 Warning

- This function notices dangers with the alarm indicator prior to motor stop with limit signal or over load alarm.
- When turning out from the alarming condition, driver returns to the normal status automatically.



Note

- ※Even though warning occurs, it drives as normal and it keep allow the current.
- ※Even though warning occurs, it drives as normal status and it may cause damage by fire.
It is recommended not to use the unit during warning status.
- ※Depending on the alarm/warning type, it displays on the Alarm/Power indicator.

No. of flashing	Warning type	Descriptions	Causes	Troubleshooting
1	S/W +Limit	When normal direction (CW) software limit is ON	1. When the current position reaches the S/W + Limit value	1. Check S/W \pm Limit parameter value.
2	S/W -Limit	When reverse direction (CCW) software limit is ON	1. When the current position reaches the S/W - Limit value	
3	H/W +Limit	When normal direction (CW) hardware limit is ON	1. When + Limit signal (I/O pin 19) is input	1. Check the \pm Limit signal is input correctly. 2. Check if the \pm - Limit signal is correctly set with the motor rotation direction. (CW direction: + Limit, CCW direction: - Limit)
4	H/W -Limit	When reverse direction (CCW) hardware limit is ON	1. When - Limit signal (I/O pin 20) is input	
5	Over load warning	When maximum load is kept connected over 10 sec	1. Over load	1. Change operation condition or reduce load so that sudden load fluctuation does not occur.
6	Position override	When it is impossible to operate position override	1. When value which position override cannot be operated is entered	1. Change operation condition to avoid sudden position change.

13 Troubleshooting

Malfunction	Causes	Troubleshooting
When communication is not connected	The communication cable is not connected.	Check communication cable wiring. Check communication cable connection correctly.
	The communication port or speed settings are not correct.	Check communication port and speed settings are correct.
When motor does not excite	Servo is not ON.	Check that servo On/Off input signal is [L]. In case of [H], servo is off and excitation of motor is released.
	Alarm occurs.	Check the alarm type and remove the cause of alarm.
When motor rotates to the opposite direction of the designated direction	MotorDir parameter setting is not correct.	Check the MotorDir parameter settings.
When motor drive is unstable	Connection between motor and encoder is unstable.	Check the Motor+Encoder connection cable.
	Position control gain value is not correct.	Change the P Gain or I Gain parameter as the certain value.

Make Life Easy: Autonics

* Dimensions or specifications on this manual are subject to change and some models may be discontinued without notice.