



Buy this item and view more at www.ironplanet.com or call 800-211-3983

Item #13869133 - 2017 Genie GTH-844 Telehandler



Item Details:

- Features: Open Operator Station, 6000 lb Max Lift Capacity, 2017 US EPA Label, 48 in Forks, Frame Leveling, Auxiliary Hydraulic Plumbing
- Meter Reading: 1,762 Hours
- Serial # : GTH08E-11226
- Inspection Completed: 8/23/25

Shipping Details:

- Location California (Riverside County)
- Loading Dock Available: No
- Pickup Hours: null-null
- You will need a copy of your IronPlanet Item Release to pick the item up. Please call one day in advance to schedule pickup.

Inspection Report

Note: This condition inspection report is the result of an impartial, systematic, documented process focused on the establishment of the general, overall mechanical condition of a piece of equipment, or of a vehicle, at a specific time. The purpose of the inspection is to establish the "as is" operational capability of the machine. It is not a performance or load test on the item.

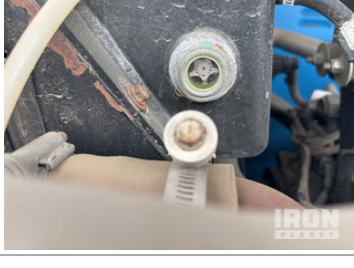
Inspection Ratings Key

★★★★	Limited use or recently replaced. Free of visible wear or defects.
★★★☆☆	Performs within the tolerances expected for age and type of item
★★☆☆☆	Although performing, shows indication of needing repair or replacement
★☆☆☆☆	Needs immediate repair/replacement. Requires work if it is to perform as expected

General Appearance

Item	Assessment	Photo
Picture, Left Front Corner		
Picture, Left Rear Corner		
Picture, Right Rear Corner		
Picture, Right Front Corner		

Serial Number / VIN	GTH08E-11226	
Paint	Damage/Rust	
Body Panels	Damage	
Fenders	All fenders damaged	
Steps	Cab step bent, Bent bracket	
Hand Rails	No visible damage or missing components	
Exterior Lights	No lights	
General Appearance #1		

General Appearance #2		
General Appearance #3		
General Appearance #4		
General Appearance #5		
General Appearance #6		
General Appearance #7		
General Appearance #8		

General Appearance #9



Safety		
Item	Assessment	Photo
Travel Alarm	Operational	
Horn	Operational	
Seat Belts	Operational	
Current Safety Manual	No	
Current Operator/Maintenance Manual	Yes	
Safety #1		
Safety #2		

Control Station		
Item	Assessment	Photo
Seat/Armrests	Operator seat cushion damaged, Entire seat damage	
Mirrors		
Steering Control	★★★★☆	
Hydraulic Controls	★★★★☆	
Drivetrain Controls	★★★★☆ Boot damage and handle damage	
Transmission Disconnect Control	★★★★☆	

Load Charts	Chart book in cab	
Engine Oil Pressure	The gauge registers in the operating range.	
Warning Lights	Operational	
Gauges	Operational	
Hour Meter / Odometer	1762 hrs	
Limited Function Check	The main components are in place and operational as noted.	
Control Station #1		

Engine		
Item	Assessment	Photo
Engine	2017 US EPA Label	
Emission Label		
Blow-by (subjective visual observation)	Spits oil from dipstick	
Starter	Operational	
Exhaust System	No visible damage or missing components	
Radiator	★★★★☆	
Engine - Left Side		
Engine - Right Side		
Limited Function Check	The engine started and ran.	
Engine #1		

Drivetrain

Operational test is limited to low speed in a confined flat area without load. Differential interlocks, full transmission shifting and functionality of all drive axles cannot be fully verified. Inspector listens for abnormal noises, observes leaks and notes physical damage.

Item	Assessment	Photo
Transmission	★★☆☆ Operational	
Transfer Case / Drop Box	★★☆☆ Operational	
Front Drive Axle	★★☆☆	
Front Axle Oscillating Pin	Seep	
Rear Drive Axle	★★☆☆	
Rear Axle Oscillating Pin	★★☆☆	

Final Drives	☆☆☆☆	
Limited Function Check	The drivetrain was operational.	
Drivetrain #1		
Drivetrain #2		
Drivetrain #3		
Drivetrain #4		

Hydraulics		
Item	Assessment	Photo
Pumps (Hydraulics)	★★★★☆	
Valves	★★★★☆	
Hydraulic Tank	★★★★☆	
Hoses (Hydraulics)	★★★★☆	
Auxiliary Hydraulic Plumbing	Capped off, Front	
Boom Lift Cylinder(s)	★★★★☆	
Telescopic Boom Cylinders	★★★★☆	

Carriage Tilt Cylinder	★★★★☆	
Fork Positioning Cylinder (on fork carriage)	★★★★☆	
Frame Leveling Cylinders	★★★★☆	
Steering Cylinders	★★★☆☆ Boots cracked	
Limited Function Check	The hydraulic system was operational.	
Hydraulics #1		
Hydraulics #2		
Hydraulics #3		

Hydraulics #4		
Hydraulics #5		

Chassis

IronPlanet pin connection pivot point wear inspections are limited to sound, sight and feel observations. Dial indicator testing is not performed.

Item	Assessment	Photo
Boom Condition	★★★★☆	
Left Side of Boom		
Right Side of Boom		
Chain / Tensioners	★★★★☆	
Rollers and Guides	★★★★☆	
Boom Wear Guides	★★★★☆	

Chassis #1		
------------	--	---

Telehandler*

IronPlanet pin connection pivot point wear inspections are limited to sound, sight and feel observations. Dial indicator testing is not performed.

Item	Assessment	Photo
Steering Linkage	★★★★☆	
Frame Condition	★★★★☆	
Limited Function Check	The main chassis components functioned during a limited check.	
Master Cylinder	★★★★☆	
Brake Control	★★★★☆	
Brake Lines/Hoses	★★★★☆	
Park Brake	★★★★☆	
Limited Function Check - Brakes	The service brakes are operational, The park brake is operational.	
Left Front Tire	Size: 330/85-25 Brand: ETREMELIFT Model: EXL-T1 Tread Depth: 8/32	

Left Rear Tire	Tread Depth: 3/32	
Right Rear Tire	Tread Depth: 4/32	
Right Front Tire	Tread Depth: 5/32	
Wheel Condition	No visible damage or missing components	
Loader Quick Coupler	★★★★☆	
Load Back Rest	★★★★☆	
Forks	★★★★☆	

Telehandler* #1		 A close-up photograph of a hydraulic arm joint on a telehandler. The joint is made of dark metal and is connected to a blue hydraulic hose. The background is a light-colored, textured surface. An "IRON PLANET" watermark is visible in the bottom right corner.
Telehandler* #2		 A close-up photograph of a hydraulic arm joint on a telehandler. The joint is made of dark metal and is connected to a blue hydraulic hose. The background is a light-colored, textured surface. An "IRON PLANET" watermark is visible in the bottom right corner.
Telehandler* #3		 A close-up photograph of a hydraulic arm joint on a telehandler. The joint is made of dark metal and is connected to a blue hydraulic hose. The background is a light-colored, textured surface. An "IRON PLANET" watermark is visible in the bottom right corner.
Telehandler* #4		 A close-up photograph of a hydraulic arm joint on a telehandler. The joint is made of dark metal and is connected to a blue hydraulic hose. The background is a light-colored, textured surface. An "IRON PLANET" watermark is visible in the bottom right corner.

Buy this item and view more at www.ironplanet.com or call 800-211-3983

IronPlanet , Inc. © 2012 All Rights Reserved