

Inspection Report (On-Highway Dump Truck)

General Info

Year	2011
Make	Peterbilt
Model	367
Serial Number	1NP - TLUOX - 2 - BD127975
Truck Odometer Reading	423,441
Previous Application (e.g., earth moving, mining, demolition, etc)	Asphalt Construction

Dimensions

Dimensions	Please enter in or verify (if pre-populated) the following dimensions.
Length (ft and inches)	30'2" (From back of strong arm axle to front bumper)
Width (ft and inches)	8'2"
Height (ft and inches)	12'10"
Wheelbase (ft and inches)	20'8"
GVWR (lbs)	66,000 lbs.



Features and Configuration

Features	Enter in and/or verify the following information regarding the features of this equipment.
Heat	Yes
A/C	Yes
Radio	Yes
Backup Camera	No
Cruise Control	Yes
PTO	Yes
PTO Details	Trans mounted Muncie
Engine Brake	Yes
Differential Lock	Yes
OMM (Operator & Maintenance Manual)	No
Telematics	No

Exterior 360 Walkaround

Exterior 360 Walkaround

Inspection Report (On-Highway Dump Truck)

Instructions	<p>Take photos of the exterior of the piece of equipment. Capture a full 360 degree walk around and all major components.</p> <p>Must have shots to capture:</p> <ul style="list-style-type: none"> - Front - 45 degree corner shot of left front - 45 degree corner shot of right front - Left side - Right side - Rear - 45 degree corner shot of left rear - 45 degree corner shot of right rear <p>Tips for good photos:</p> <ul style="list-style-type: none"> - Move the equipment into a open area without any visual distractions or other equipment in the background
Exterior Walkaround Photos	
	

Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)





Inspection Report (On-Highway Dump Truck)






General Appearance Inspection Points




General Appearance

Front	3 - Normal Wear & Tear
Front Condition	No visible damage
Front Photos	
	




Inspection Report (On-Highway Dump Truck)

	
	
Rear	3 - Normal Wear & Tear
Rear Condition	No visible damage, Visible chipped paint or dents, Other (see comments)
Comments	Rear body straight and solid, normal wear
Rear Photos	

Inspection Report (On-Highway Dump Truck)

	
	
	
Left	3 - Normal Wear & Tear
Left Condition	No visible damage, Other (see comments)
Comments	Left side storage box dented

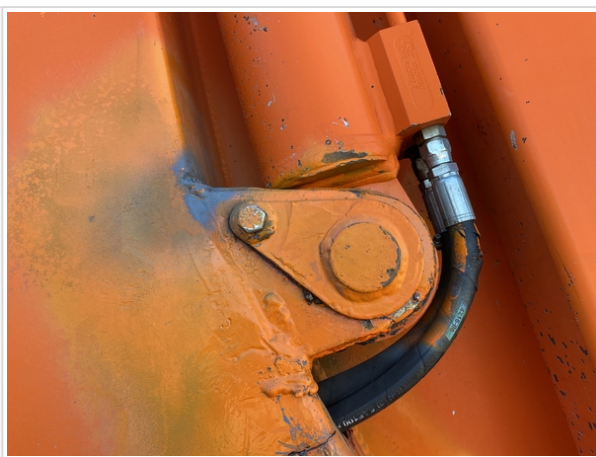Inspection Report (On-Highway Dump Truck)

<p>Left Photos</p>		
		
		

Inspection Report (On-Highway Dump Truck)






Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)

		
Right	3 - Normal Wear & Tear	
Right Condition	Visible chipped paint or dents, No visible damage, Other (see comments)	
Comments	No major damage just minor paint chipped areas on front fender	
Right Photos		
		

Inspection Report (On-Highway Dump Truck)






Inspection Report (On-Highway Dump Truck)




Inspection Report (On-Highway Dump Truck)






Inspection Report (On-Highway Dump Truck)

		
Upper	3 - Normal Wear & Tear	
Upper Condition	No visible damage, Other (see comments)	
Comments	Clear coat peeling	
Upper Photos		
		




Inspection Report (On-Highway Dump Truck)

		
Body Panels (Any Rust Damage?)	3 - Normal Wear & Tear	
Body Panel Condition	No visible damage, good paint condition and panel fitment, Other (see comments)	
Doors / Canopy Latches	3 - Normal Wear & Tear	
Doors / Canopy Latches Condition	No visible damage	
Doors / Canopy Latches Photos		
		




Inspection Report (On-Highway Dump Truck)

		
		
Steps / Ladders	3 - Normal Wear & Tear	
Steps / Ladders Condition	Steps/ladders are fully intact and appear structurally sound	
Steps / Ladders Photos		

Inspection Report (On-Highway Dump Truck)

	
	
	
Handrails	3 - Normal Wear & Tear
Handrails Condition	Handrails are fully intact and appear structurally sound




Inspection Report (On-Highway Dump Truck)

Handrail Photos	
	
Glass Condition	3 - Normal Wear & Tear
Glass Condition Notes	Glass intact, no visible damage
Glass Condition Photos	




Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)

		
Mirrors	3 - Normal Wear & Tear	
Mirror Condition Notes	Mirrors present and intact, no visible damage	
Mirrors Photos		
		

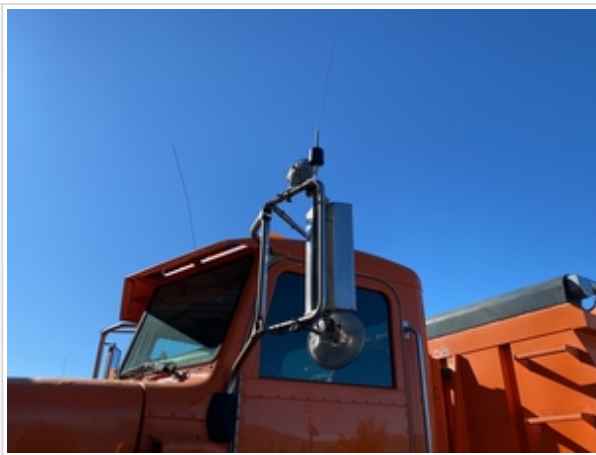
Inspection Report (On-Highway Dump Truck)

		
		
Lighting System	3 - Normal Wear & Tear	
Lighting System Condition	No visible damage, lighting system is operational	
Lighting System Photos		

Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)

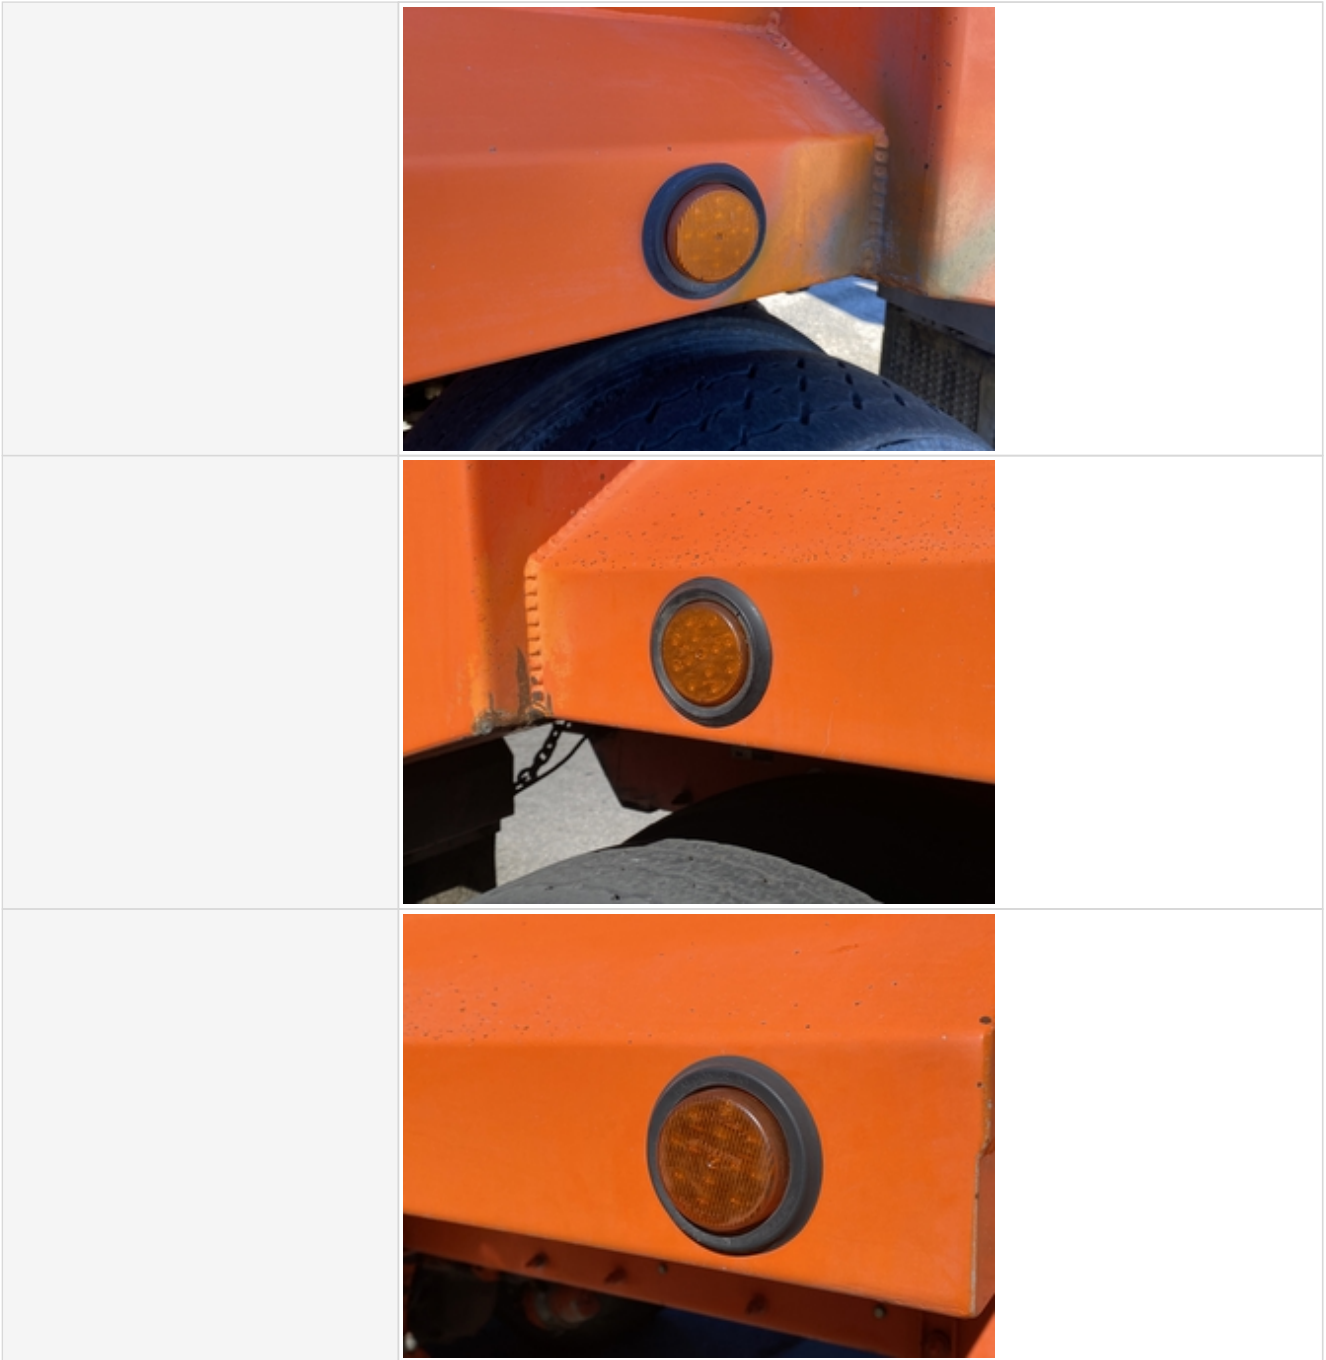

Inspection Report (On-Highway Dump Truck)



Cab Inspection Points

On Highway - Cab

Serial Number Plate Photo



Operator Cabin

3 - Normal Wear & Tear


Operator Cabin Photos



Inspection Report (On-Highway Dump Truck)



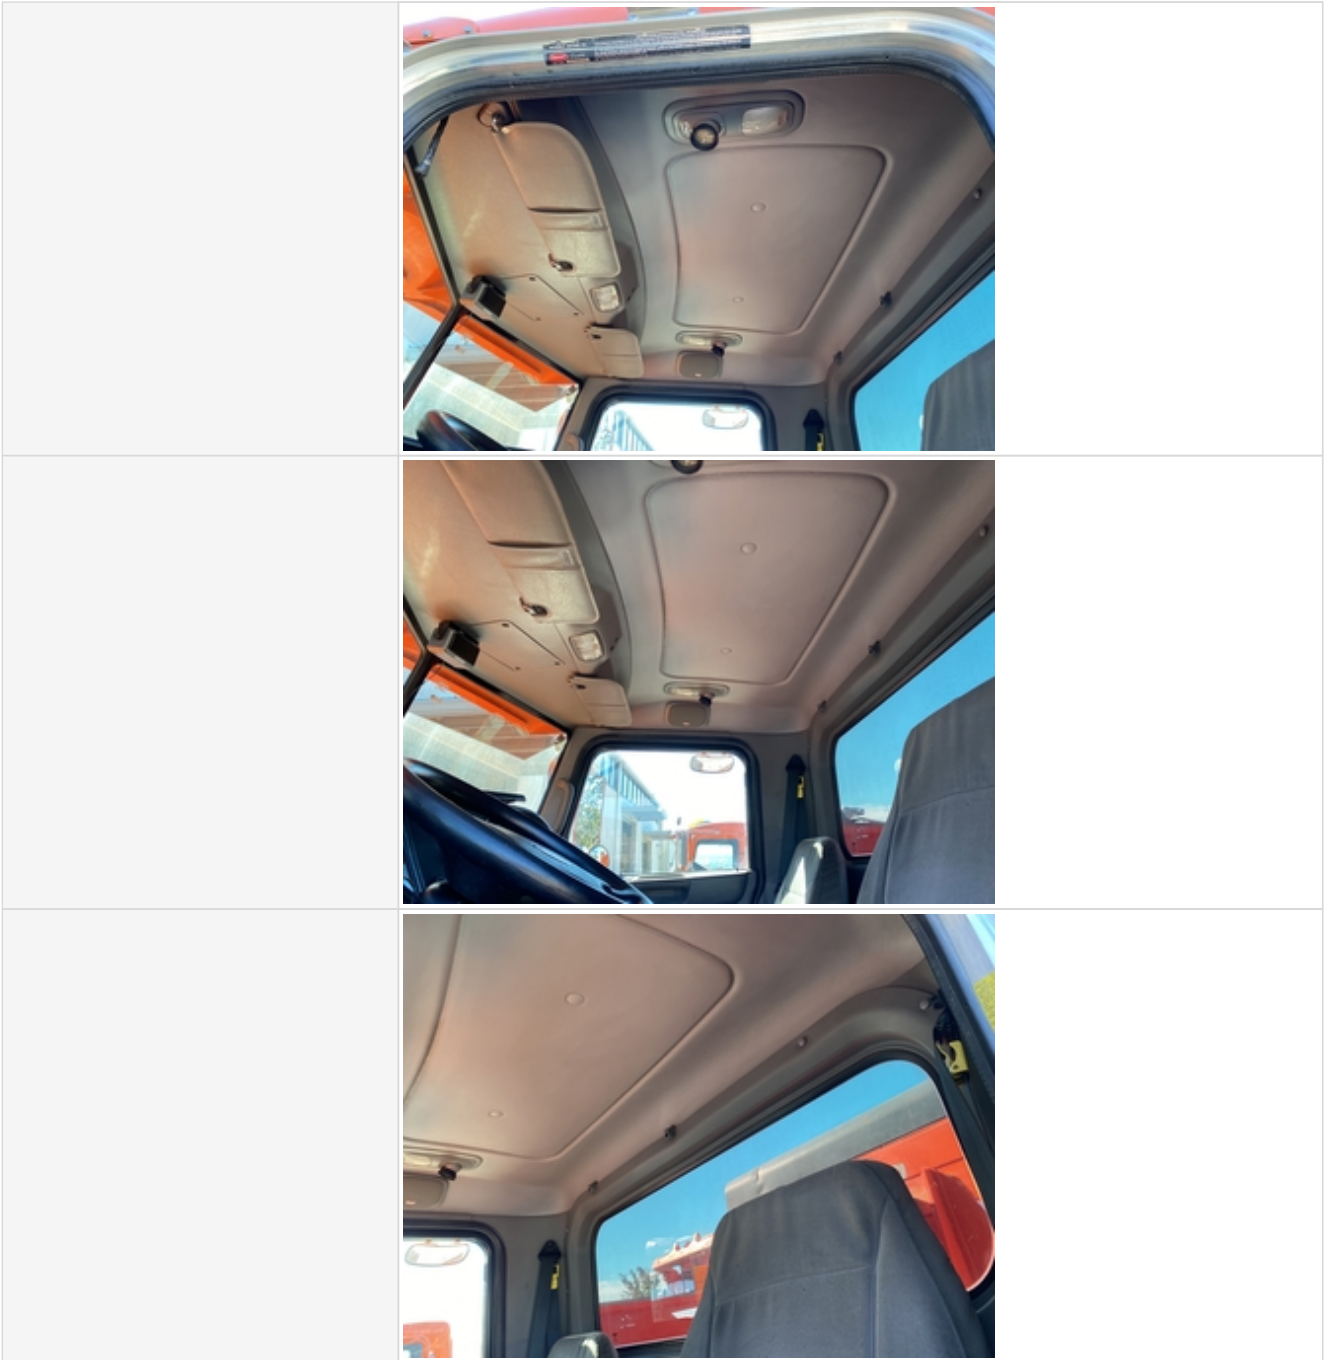


Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)






Inspection Report (On-Highway Dump Truck)

		
<p>Operator's Seat & Arm Rests</p>	<p>3 - Normal Wear & Tear</p>	
<p>Operator's Seat & Arm Rests Photos</p>		
		

Inspection Report (On-Highway Dump Truck)






Inspection Report (On-Highway Dump Truck)

		
Seat Belt	3 - Normal Wear & Tear	
Seat Belt Photos		
Cabin Lights	3 - Normal Wear & Tear	
Cabin Lights Photos		




Inspection Report (On-Highway Dump Truck)

		
		
<p>Controls & Switches</p>	<p>3 - Normal Wear & Tear</p>	
<p>Controls & Switches Photos</p>		

Inspection Report (On-Highway Dump Truck)

	
	
	
<p>Odometer Activity</p>	<p>3 - Normal Wear & Tear</p>




Inspection Report (On-Highway Dump Truck)

Odometer Activity Photos	
Other Gauge Activity	3 - Normal Wear & Tear
Other Gauge Activity Photos	
	



Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)

	
Heater & A/C	3 - Normal Wear & Tear
Heater & A/C Photos	
Fans / Vents	3 - Normal Wear & Tear
Fans / Vents Photos	

Inspection Report (On-Highway Dump Truck)

	
	
Horn	3 - Normal Wear & Tear
Reverse Alarm / Backup Signal	3 - Normal Wear & Tear
Backup Camera	0
Other Electronic Devices	0
Fire Extinguisher	0
First Aid Kit	0

Engine Inspection Points

Engine

Engine Type (Make, Model, Cylinders, Hp)	CAT - 12.5L - 6 Cyl. - 470HP - C13
Emissions Tier	Tier 4i
Engine Serial Number	N/A
Engine Fuel Type	Diesel

Inspection Report (On-Highway Dump Truck)

Engine Photos





Inspection Report (On-Highway Dump Truck)






Inspection Report (On-Highway Dump Truck)






Inspection Report (On-Highway Dump Truck)

		
Blow-by (Visual Observation Check)	No	
Unusual Noises (Upon Start-up, Idle, Shutdown)	No	
Unusual Noise Notes	No unusual noises heard	
Engine Smoke (Upon Start-up, Idle, Shutdown)	No	
Engine Smoke Notes	No engine smoke issues observed	
Engine Exhaust Color	Clear	
Battery	2 - Above Average Wear	
Battery Condition	Needs charge or replacement	
Comments	Engine starter hesitation observed	
Battery Condition Photos		




Inspection Report (On-Highway Dump Truck)

		
Radiator	3 - Normal Wear & Tear	
Radiator Condition	Radiator fins & components appear to be in good working order, no signs of damage or leaks	
Radiator Photos		
		

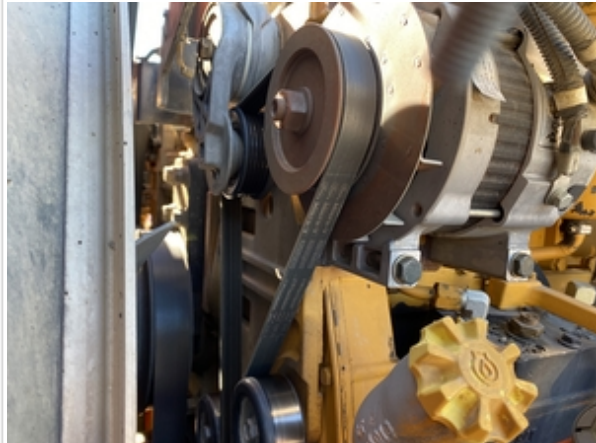Inspection Report (On-Highway Dump Truck)

	
	
Belts	3 - Normal Wear & Tear
Belt Condition	Belts appear in good condition & alignment with proper tension
Belt Photos	

Inspection Report (On-Highway Dump Truck)

		
Hoses	3 - Normal Wear & Tear	
Hose Condition	Firm, pliant hoses with no signs of wear or leaks	
Hose Photos		
		

Inspection Report (On-Highway Dump Truck)






Inspection Report (On-Highway Dump Truck)






Inspection Report (On-Highway Dump Truck)






Inspection Report (On-Highway Dump Truck)

	
	
	
Water Pump	3 - Normal Wear & Tear
Water Pump Condition	No unusual pump noises heard


Inspection Report (On-Highway Dump Truck)

Water Pump Photos	
Cooling System Leaks	No
Coolant Color / Appearance	3 - Normal Wear & Tear
Coolant Color/Appearance Notes	Normal Translucent appearance, no visual signs of contamination
Oil Leaks	Yes
Oil Leak Notes	Wet areas with drops forming due to oil leakage, Other (see comments)
Comments	Oil leak at rear top side of oil pan and around bell housing
Oil Leak Photos	
	

Inspection Report (On-Highway Dump Truck)


		
Oil Color / Appearance	3 - Normal Wear & Tear	
Oil Color / Appearance Notes	Clean oil appearance, no signs of cross contamination, Appropriate oil level	
Fuel Leaks	No	
Equipped with DPF (Diesel Particulate Filter)	Yes	
DPF Condition	3 - Normal Wear & Tear	
DPF Condition Notes	Filter housing is intact with no signs of damage or malfunction, DPF indicator is not illuminated	
DPF Photos		
		

Inspection Report (On-Highway Dump Truck)

	
Requires DEF (Diesel Exhaust Fluid)	No
Overall Engine Appearance	Clean & dry, Areas of dried seepage seen on engine hoses & components
Overall Engine Comments	Minor oil leak may be coming from engine oil pan and around bell housing.

Drivetrain Inspection Points




Drivetrain

Transmission Info (Make/Model)	Eaton 10 Speed Manual
Drive Type	6X4
Overdrive	No
Transmission	3 - Normal Wear & Tear
Transmission Condition	No unusual noises or vibrations
Transmission Condition Photos	




Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)

		
		
Clutch	3 - Normal Wear & Tear	
Clutch Condition	Clutch is functioning as expected	
Shift Lever	3 - Normal Wear & Tear	
Shift Lever Condition	Good forward and reverse function	
Shift Lever Photos		




Inspection Report (On-Highway Dump Truck)

		
		
Differential	Check condition of the differential(s). Take photos and notes as relevant.	
Rear Differential	3 - Normal Wear & Tear	
Rear Differential Condition	Dry housing appearance, no unusual noises heard during operation	
Rear Differential Photos		




Inspection Report (On-Highway Dump Truck)






Inspection Report (On-Highway Dump Truck)

		
Front Differential	3 - Normal Wear & Tear	
Front Differential Condition	Dry housing appearance, no unusual noises heard during operation	
Front Differential Photos		
		

Inspection Report (On-Highway Dump Truck)

		
		
Brake System Type	Air Brakes	
Air Brakes Build Correct Pressure	Yes	
Air Brake System Leaks	Yes	
Comments	Minor air leak observed beneath cab	
Air Brake Hose Condition	3 - Normal Wear & Tear	
Air Brake System Photos		

Inspection Report (On-Highway Dump Truck)




		
		
Foot Brake	3 - Normal Wear & Tear	
Foot Brake Condition	Good brake function	
Foot Brake Photos		
Engine Brake Configuration	2 Position	
Engine Brake	3 - Normal Wear & Tear	
Parking Brake	3 - Normal Wear & Tear	
Parking Brake Condition	Good brake function	
Overall Drivetrain Comments	Overall drivetrain In solid, well maintained condition.	

Inspection Report (On-Highway Dump Truck)


Chassis & Axle Inspection Points

Chassis

Frame

Frame Condition	3
Frame Photos	
	
	

Inspection Report (On-Highway Dump Truck)

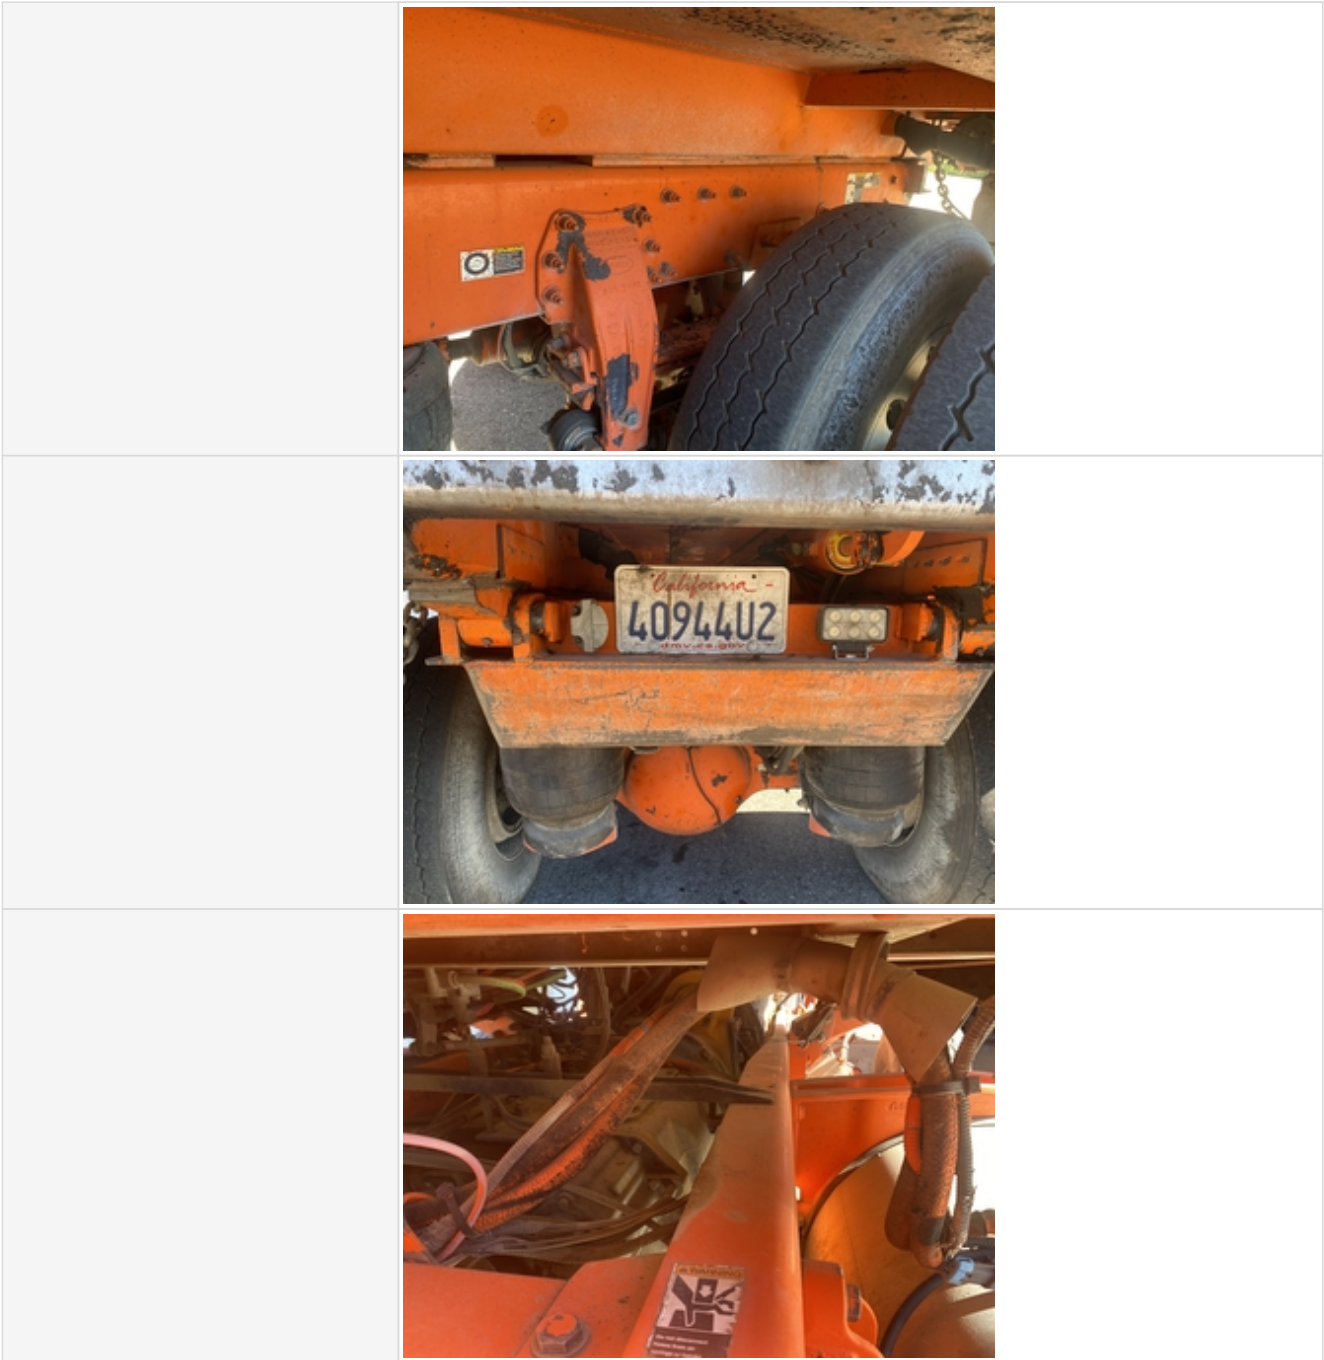

Suspension

Suspension	3
------------	---

Inspection Report (On-Highway Dump Truck)

Suspension Photos



Inspection Report (On-Highway Dump Truck)





Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)



Steering

Steering Components	3
Steering Components Photos	
	




Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)





Inspection Report (On-Highway Dump Truck)

		
Steer Axle Condition	3	
Steer Axle Photos		
		

Inspection Report (On-Highway Dump Truck)



Wheels & Tires

Wheels & Hub Condition	3
Wheels & Hub Photos	 <p>A close-up photograph of a silver metal wheel hub with six lug nuts. The hub is mounted on a black tire. The background shows a concrete surface.</p>
	 <p>A close-up photograph of a black tire tread on a silver metal wheel. The tire shows some wear and a dark, possibly wet or oily, substance on the tread surface. The wheel is mounted on a concrete surface.</p>




Inspection Report (On-Highway Dump Truck)






Inspection Report (On-Highway Dump Truck)

	
	
	
Wheel Seal Leaks	No
Tire Brand	(Front) Yokohama (Rear) generic recaps
Tire Size	315/80R/22.5 (Rear) 11R22.5
Front Left Tire - Ratio Remaining	10%




Inspection Report (On-Highway Dump Truck)

Front Left Tire Photos	
	
Front Right Tire - Ratio Remaining	10%
Front Right Tire Photos	

Inspection Report (On-Highway Dump Truck)

		
Rear Right Tire - Ratio Remaining	10%	
Rear Right Tire Photos		
		



Inspection Report (On-Highway Dump Truck)

		
Rear Left Tire - Ratio Remaining	10%	
Rear Left Tire Photos		
		

Inspection Report (On-Highway Dump Truck)




Brake Components

Brake Shoe Thickness	30%
Comments	3rd axle (rear) brakes shoes above 50% all others at 30% life left
Brake Shoe Photos	
	

Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)

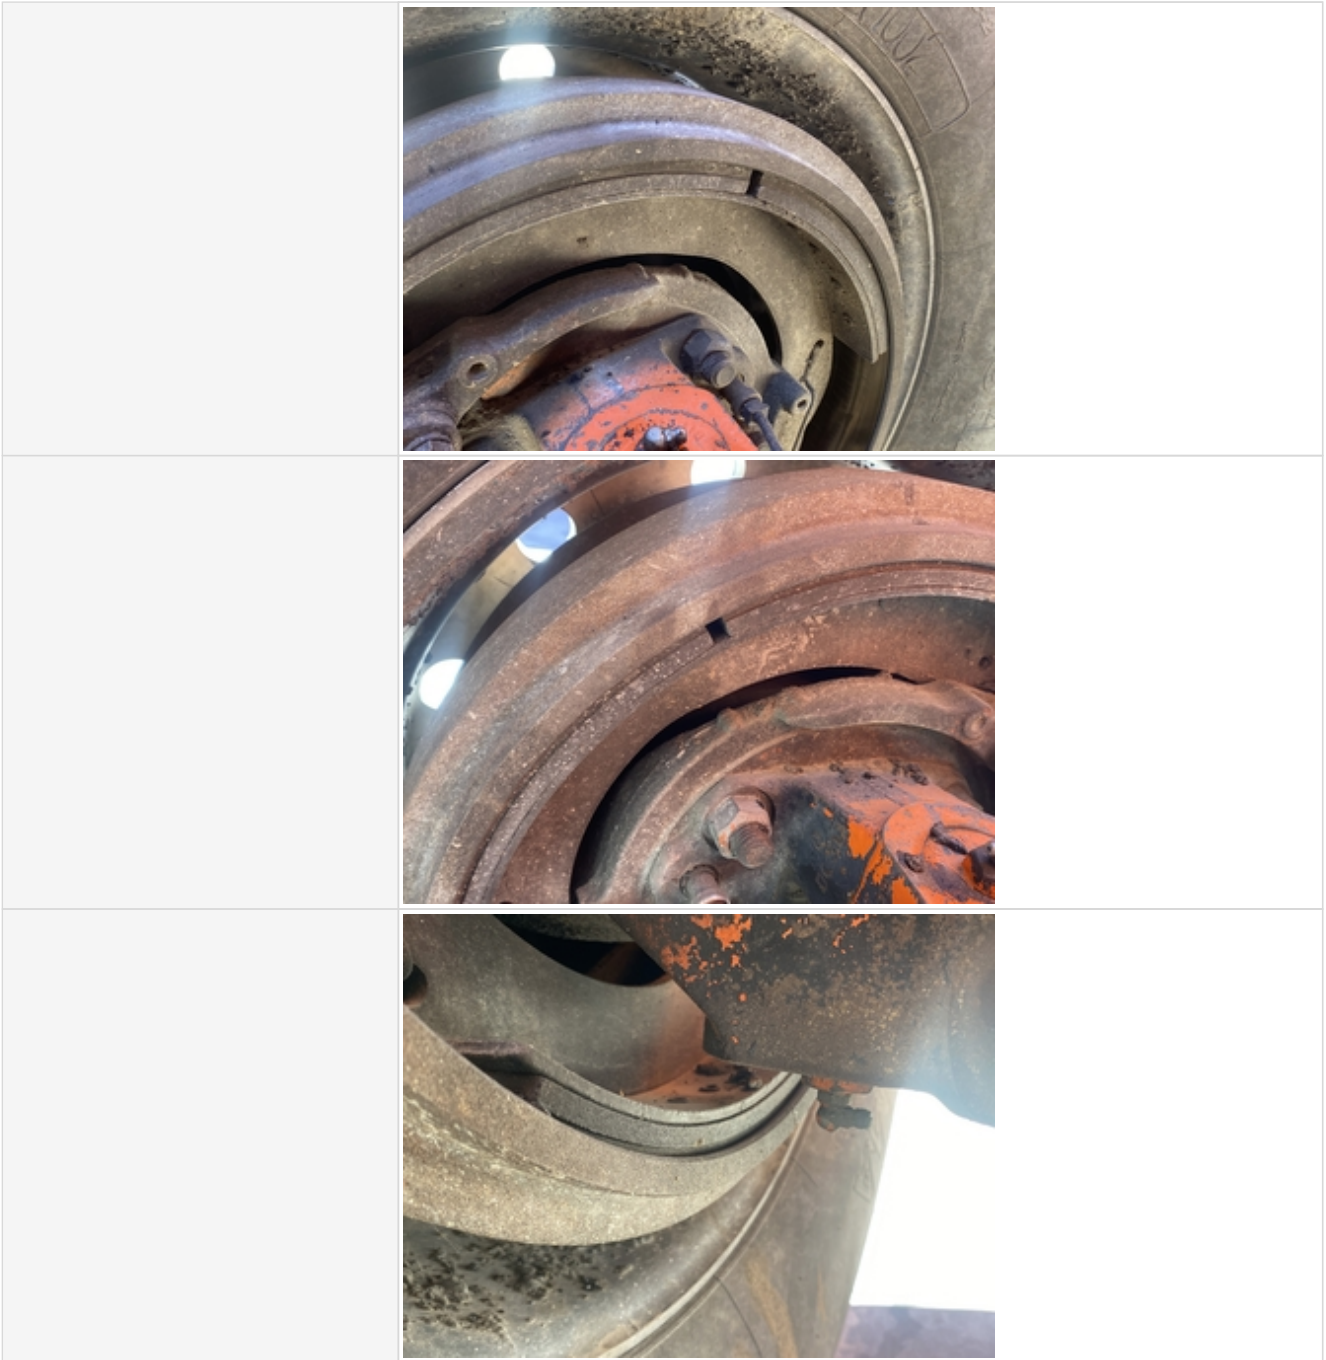

Overall Chassis Condition


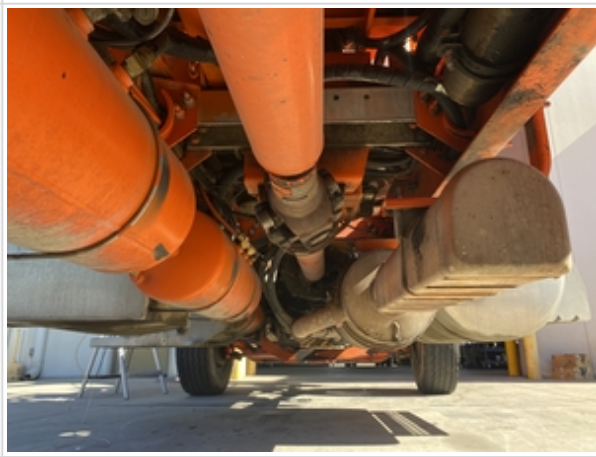

Overall Chassis	3
Overall Chassis Comments	Overall chassis in good condition with no obvious major problems found.

Inspection Report (On-Highway Dump Truck)

Overall Chassis & Undercarriage
Photos



Inspection Report (On-Highway Dump Truck)




	
	
	
Additional Axles	Check the condition of all other axles. Specify the position and type of axle. Note any damage or wear. Take photos.

Addition Axle Inspection

Additional Axle

Instructions	Check the condition of additional axle(s), wheels & tires. Note any damage or wear. Take photos.
Axle Description & Position	Strong arm drop down axle
Steerable?	No

Inspection Report (On-Highway Dump Truck)

Drop Axle?	Yes
Super Dump?	Yes
Weight Rating	12,0000 Lbs.
Axle Condition	3 - Normal Wear & Tear
Axle Condition Photos	
	
	

Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)






Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)

		
<p>Wheels & Tires</p>	<p>3 - Normal Wear & Tear</p>	
<p>Wheels & Tires Photos</p>		
		

Inspection Report (On-Highway Dump Truck)






Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)




	
	
	
Tire Brand	Ameristeel
Tire Size	11R22.5
Left Tire(s) Ratio Remaining	70%
Right Tire(s) Ratio Remaining	70%

Additional Inspection Points

On Highway - Dump Truck

Additional Inspection Points: Dump Body, Tailgate, Support & Tarp

Inspection Report (On-Highway Dump Truck)

Dump Body Make & Material	Rogue
Dump Body Length (ft and inches)	15'
Dump Body Height (ft and inches)	5'3"
Bed Body	3 - Normal Wear & Tear
Bed Body Photos	  

Inspection Report (On-Highway Dump Truck)






Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)




		
		
		
<p>Tailgate</p>	<p>3 - Normal Wear & Tear</p>	

Inspection Report (On-Highway Dump Truck)




Tailgate Photos



Inspection Report (On-Highway Dump Truck)

		
<p>Tailgate Latch</p>	<p>3 - Normal Wear & Tear</p>	
<p>Tailgate Latch Photos</p>		
		




Inspection Report (On-Highway Dump Truck)

		
		
<p>Support Frame</p>	<p>3 - Normal Wear & Tear</p>	
<p>Support Frame Photos</p>		

Inspection Report (On-Highway Dump Truck)



Inspection Report (On-Highway Dump Truck)




		
		
		
<p>Hinge Points</p>	<p>3 - Normal Wear & Tear</p>	

Inspection Report (On-Highway Dump Truck)

Hinge Point Photos





Inspection Report (On-Highway Dump Truck)

		
<p>Tarp</p>	<p>3 - Normal Wear & Tear</p>	
<p>Tarp Photos</p>		
		




Inspection Report (On-Highway Dump Truck)






Additional Inspection Points: Dump Hydraulics

Hydraulics	Check the condition of the hydraulics. Check lines, hoses, fittings, leaks, function, etc. Note any damage or wear. Take photos.
Hydraulic Tank	3 - Normal Wear & Tear
Hydraulic Tank Photos	 A photograph of a white, rectangular hydraulic tank mounted on the side of an orange dump truck. The tank is situated on a metal platform, and the surrounding area shows the orange body panels of the truck.
Hoses	3 - Normal Wear & Tear
Hose Photos	 A close-up photograph of several hydraulic hoses and fittings on an orange dump truck. The hoses are connected to various components, and the surrounding area shows the orange metal structure of the truck.

Inspection Report (On-Highway Dump Truck)

	
<p>Hydraulic Cylinders</p>	<p>3 - Normal Wear & Tear</p>
<p>Hydraulic Cylinder Photos</p>	
	

Inspection Report (On-Highway Dump Truck)

	
Cylinder Pins and Bushings	3 - Normal Wear & Tear
Cylinder Pins and Bushings Photos	
	
Hydraulic Function	3 - Normal Wear & Tear
Comments	Cylinder functions well

Functional Test

Forward & Reverse	3 - Normal Wear & Tear
Steering	3 - Normal Wear & Tear
Engine	3 - Normal Wear & Tear

Inspection Report (On-Highway Dump Truck)

Controls	3 - Normal Wear & Tear
Overall Functional Test Comments	Truck operates well. Dump body and strong arm axle operate normal. Tarp may need to be adjusted (tarp retract hesitation observed)
Operating Video	Click to Download

Inspection Summary

Overall Assessment

Exterior Rating	3
Interior Rating	3
Safety Rating	3
Quality Rating	3
Functionality Rating	3
Overall Rating	3
What's Great About the Machine	Overall the truck is in great shape, well maintained and it shows. The engine, transmission and suspension have excellent appearance and no major issues found. The interior is well taken care of and the exterior looks great too.
What Needs Work	Some tires need to be replaced soon. Brake shoes getting low. Tarp needs to be adjusted/repared to ensure smooth in and out movement.
Date/Time	11-14-2022