

## Inspection Report (Off-Highway Carrier or Service)

### General Info

B&B Stock Number	A4645759
Year	2022
Make	Terramac
Model	RT9
Serial Number	9L00412
Hour Meter Reading	119hrs
Previous Application (e.g., earth moving, mining, demolition, etc)	The machine was used to carry sand blasting rigs into areas that vehicles could not get to.

### Dimensions

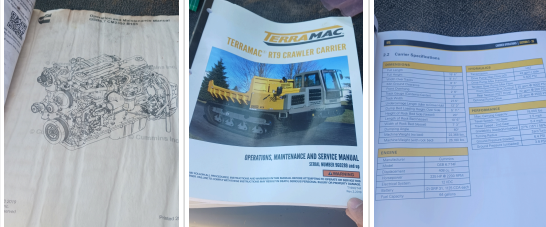
A. Length (ft and inches)	21ft 5in
B. Width (ft and inches)	8ft 4in
C. Height (ft and inches)	9ft 11in
Operational Weight (lbs)	26,345lbs

### Features and Configuration

Control Station Type	Cab
Travel System	Rubber Track Undercarriage
Additional Attachment(s)	Yes
Heat	Yes
A/C	Yes
Radio	Yes
Backup Camera	Yes
Grade Control System	No
OMM (Operator & Maintenance Manual)	Yes
Telematics	No

### OMM Specifications

#### OMM Specifications

Detail Specifications	Take photos of the detailed spec pages included in the operator's manual
OMM Spec Photos	

### Exterior Walkaround Photos

## Inspection Report (Off-Highway Carrier or Service)

### 360 Walkaround & Operating Video

#### Walkaround Photos & Operating Video

Exterior Walkaround Photos	
Operating Video	<a href="#">Click to Download</a>

### General Appearance Inspection Points

#### General Appearance

#### General Appearance Photos

Close-up Exterior Photos	
--------------------------	---

### General Appearance Inspection Points

Inspection Rating Criteria	Rating Scale	Explanation
	1 - Service Required	Requires immediate repairs to function as expected.
	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.
	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.
	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.
	5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.
Body Panels	4 - Very Light or Minimal Wear	
Body Panel Condition	No visible damage, good paint condition and panel fitment	
Doors / Canopy Latches	5 - Like New, Recently Replaced	
Steps / Ladders	5 - Like New, Recently Replaced	
Handrails	5 - Like New, Recently Replaced	
Glass	5 - Like New, Recently Replaced	
Mirrors	5 - Like New, Recently Replaced	
Exterior Lights	5 - Like New, Recently Replaced	

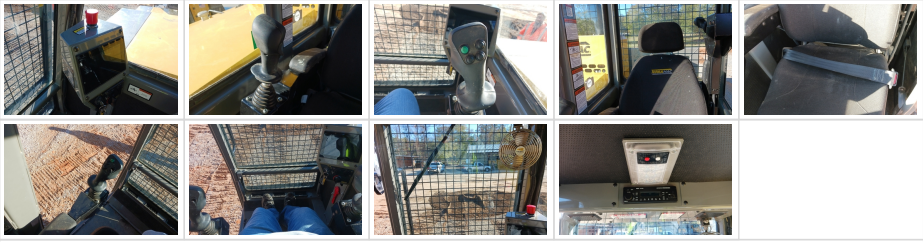


## Inspection Report (Off-Highway Carrier or Service)

Overall Exterior	5 - Like New, Recently Replaced
Comments	The exterior is in great condition and well taken care of

### Control Station Inspection Points

#### Control Station

#### Control Station Photos

Control Station Photos	
Serial Number Plate	
Hour Meter/Odometer	
Seat	5 - Like New, Recently Replaced
Cabin Lights	5 - Like New, Recently Replaced
Safety Lock Out / Stop	5 - Like New, Recently Replaced
Controls & Switches	5 - Like New, Recently Replaced
Hour Meter Activity	5 - Like New, Recently Replaced
Hour Meter Condition	Hour meter is functional and in good condition


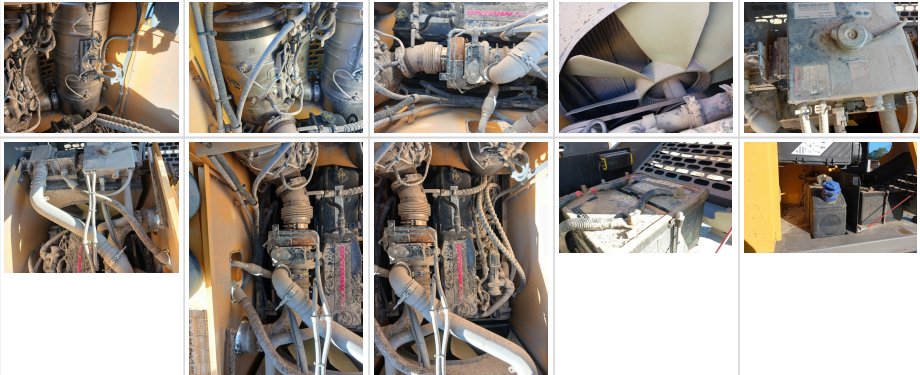

## Inspection Report (Off-Highway Carrier or Service)

Other Gauge Activity	5 - Like New, Recently Replaced
Heater & A/C	5 - Like New, Recently Replaced
Travel Alarm	5 - Like New, Recently Replaced
Horn	5 - Like New, Recently Replaced
Backup Camera	5 - Like New, Recently Replaced
Control Station Overall Rating	5 - Like New, Recently Replaced

### Engine Inspection Points

#### Engine

#### Engine Compartment Photos

Engine Data Plate					
Engine Compartment Photos					
					
Engine Type (Make, Model, Cylinders, Hp)	Cummins, QSB6.7, 225Hp				
Emissions Tier	Tier 4F				
Engine Serial Number	74597000				
Engine Fuel Type	Diesel				
Blow-by (Visual Observation Check)	Yes				

## Inspection Report (Off-Highway Carrier or Service)

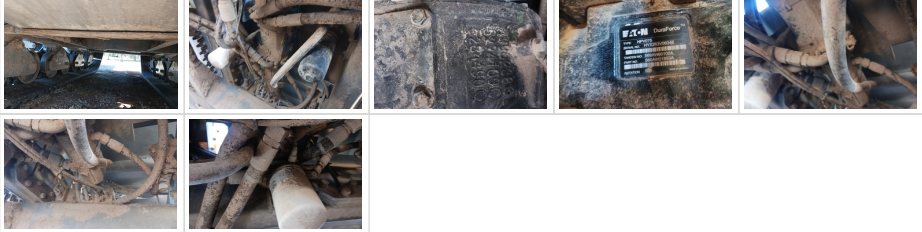
Unusual Noises (Upon Start-up, Idle, Shutdown)	No
Engine Smoke (Upon Start-up, Idle, Shutdown)	No
Engine Exhaust Color	Clear
Battery	4 - Very Light or Minimal Wear
Battery Condition	Clean & dry appearance, tight connections
Radiator	4 - Very Light or Minimal Wear
Radiator Condition	Radiator fins & components appear to be in good working order, no signs of damage or leaks
Belts	4 - Very Light or Minimal Wear
Belt Condition	Belts appear in good condition & alignment with proper tension
Hoses	4 - Very Light or Minimal Wear
Hose Condition	Firm, pliant hoses with no signs of wear or leaks
Water Pump	4 - Very Light or Minimal Wear
Water Pump Condition	No unusual pump noises heard
Cooling System Leaks	No
Coolant Appearance	4 - Very Light or Minimal Wear
Coolant Appearance Notes	Normal Translucent appearance, no visual signs of contamination
Oil Leaks	No
Oil Appearance	4 - Very Light or Minimal Wear
Oil Appearance Notes	Clean oil appearance, no signs of cross contamination, Appropriate oil level
Fuel Leaks	No
Equipped with DPF (Diesel Particulate Filter)	Yes
DPF Condition	4 - Very Light or Minimal Wear
DPF Condition Notes	Filter housing is intact with no signs of damage or malfunction, DPF indicator is not illuminated
Requires DEF (Diesel Exhaust Fluid)	Yes
DEF Tank	4 - Very Light or Minimal Wear
DEF Tank Condition	Area around DEF tank cap is clean, fluid is clear & appears free of contaminants
Overall Engine Rating	4 - Very Light or Minimal Wear
Overall Engine Appearance	Clean & dry
Overall Engine Comments	The engine is in good working order

## Drivetrain Inspection Points


### Drivetrain

## Inspection Report (Off-Highway Carrier or Service)

### Drivetrain Inspection Points

Drivetrain Photos	
Hydrostatic Transmission?	Yes
2 Speed?	Yes
Hydrostatic Drive Configuration	Other (see comments)
Comments	unable to verify
Drive	2WD
Transmission Components	4 - Very Light or Minimal Wear
Transmission Condition	Good forward and reverse function, No unusual noises or vibrations
Drive Motors	4 - Very Light or Minimal Wear
Parking Brake	4 - Very Light or Minimal Wear
Parking Brake Function	Good brake function
Overall Drivetrain Rating	4 - Very Light or Minimal Wear
Overall Drivetrain Comments	The drivetrain is in good condition

### Chassis Inspection Points

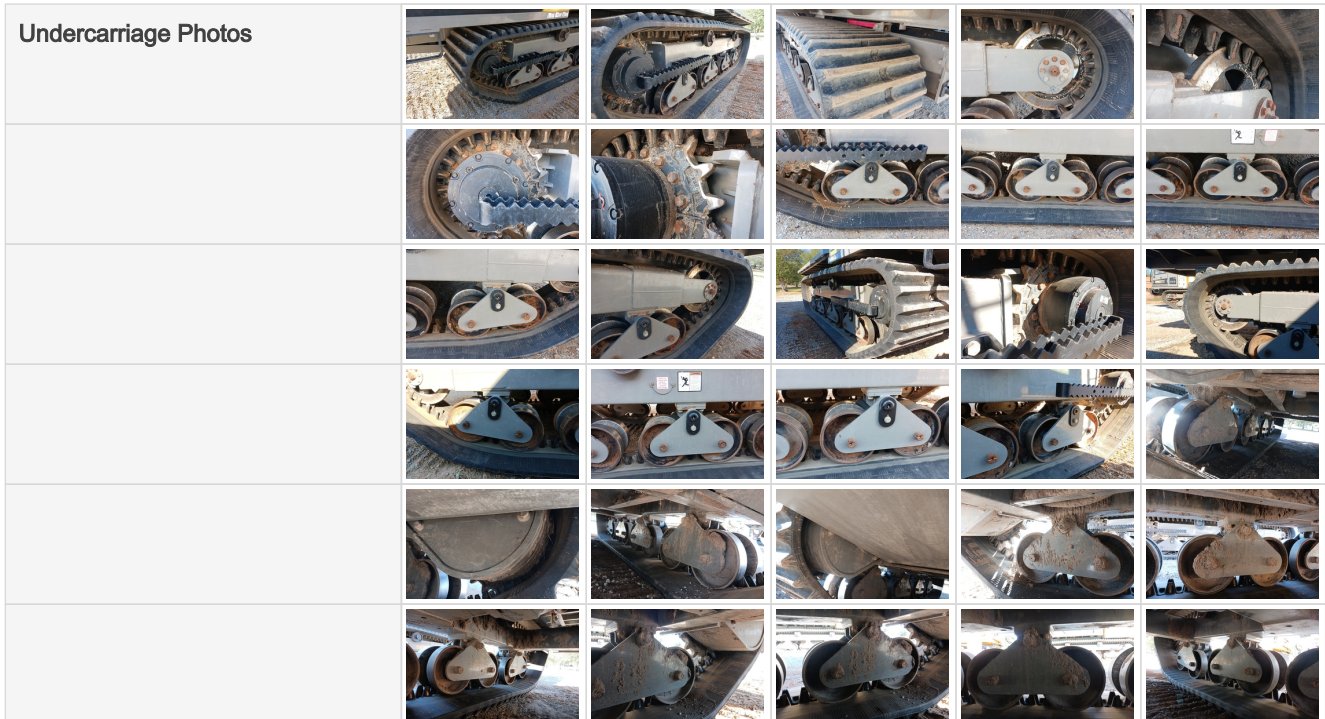
Chassis Photos	
Turntable Bearing	0
Frame	4 - Very Light or Minimal Wear
Bottom Covers	4 - Very Light or Minimal Wear
Carrier Body	4 - Very Light or Minimal Wear
Overall Chassis	4 - Very Light or Minimal Wear
Overall Chassis Comments	The chassis is good

### Travel System Inspection Points

#### Rubber Track Undercarriage

#### Undercarriage Photos

## Inspection Report (Off-Highway Carrier or Service)



### Inspection Points




Track Width (inches)	2ft 3.5in
Track Length (inches)	14ft 11in and 10ft 5in track on ground
Roller Frames	4 - Very Light or Minimal Wear
Track Belt	4 - Very Light or Minimal Wear
Rubber Belt Drive Lugs	4 - Very Light or Minimal Wear
Track Tensioners	4 - Very Light or Minimal Wear
Front Idlers	4 - Very Light or Minimal Wear
Rear Idlers	4 - Very Light or Minimal Wear
Track Rollers	4 - Very Light or Minimal Wear
Sprockets	4 - Very Light or Minimal Wear
Overall Undercarriage Rating	4 - Very Light or Minimal Wear
Left Track Belt - Percent Remaining Estimate	90%
Right Track Belt - Percent Remaining Estimate	90%
Overall Comments	The undercarriage is in good working order

### Hydraulics Overall Inspection Points

#### Hydraulics Overall

#### Hydraulic System Inspection Points

## Inspection Report (Off-Highway Carrier or Service)

Hydraulic System Photos	  
Wet or Damp Hydraulic Lines / Fittings	No
Hydraulic Lines/Fittings	4 - Very Light or Minimal Wear
Hydraulic Lines / Fittings Condition	Hydraulic lines & fittings are clean and in good condition
Hydraulic Pump(s)	4 - Very Light or Minimal Wear
Unusual Noises	No
Hydraulic Pump Notes	No unusual noises heard during operation

## Hydraulic Cylinder Inspection Points

Hydraulic Cylinder Photos	   
Mounting Pins	4 - Very Light or Minimal Wear
Cylinder Oil Leaks	No
Hydraulic System Overall	4 - Very Light or Minimal Wear
Comments	The hydraulic system is in good working order and fully functional

## Additional Attachment Inspection Points

### Additional Attachment(s)

### Additional Attachments

Attachment Type	Flatbed
Attachment Make	Terramac
Attachment Size / Specs	7ft 10in wide and 15ft long
Attachment Condition	4 - Very Light or Minimal Wear
Attachment Photos	   

## Functional Test



## Inspection Report (Off-Highway Carrier or Service)

### Functionality Assessment

#### Functionality Assessment

Engine	4 - Very Light or Minimal Wear
Transmission/Drivetrain	4 - Very Light or Minimal Wear
Travel (Forward/Reverse/Steering)	5 - Like New, Recently Replaced
Brakes	4 - Very Light or Minimal Wear
Hydraulic System	5 - Like New, Recently Replaced
Electric Operating System	0
Controls	5 - Like New, Recently Replaced
Safety Systems	5 - Like New, Recently Replaced
Core Functions	5 - Like New, Recently Replaced
Attachments	5 - Like New, Recently Replaced
Overall Functional Test Comments	The machine is fully functional and well taken care of

### Overall Assessment

#### Overall Assessment

Inspection Rating Criteria	<b>Rating Scale</b>	<b>Explanation</b>
	1 - Service Required	Requires immediate repairs to function as expected.
	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.
	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.
	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.
	5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.
Exterior Rating	5 - Like New, Recently Replaced	
Interior Rating	5 - Like New, Recently Replaced	
Safety Rating	5 - Like New, Recently Replaced	
Quality Rating	5 - Like New, Recently Replaced	
Functionality Rating	5 - Like New, Recently Replaced	
Overall Rating	5 - Like New, Recently Replaced	
Summary Video	<a href="#">Click to Download</a>	
What's Great About the Machine	The machine is practically new, with only 119 hours on it. Everything works and is fully functional	
What Needs Work	At 119 hours, there is not much this machine needs work on.	
Any Additional Info from the Seller?	The machine is well taken care of and was used to transport things into areas normal vehicles could not.	
Date/Time	11-28-2023	



## Inspection Report (Off-Highway Carrier or Service)

Inspector Name	Steven Mesa
----------------	-------------