

## Inspection Report (Forklift)

### General Info

B&B Stock Number	A0426859
Year	2014
Make	Hyundai
Model	70D-9
Serial Number	HHKHFA03LG0000188
Hour Meter Reading	13256.4
Previous Application (e.g., earth moving, mining, demolition, etc)	Warehouse


### Features and Configuration

Side Shift	Yes
Tilt Carriage	No
Tilt Mast	Yes
Frame Leveling	No
Additional Attachment(s)?	No
Auxiliary Hydraulics	No
Engine Type	Internal Combustion
Wheel Type	Solid
Heat	Yes
A/C	Yes
Radio	Yes
Backup Camera	Yes
OMM (Operator & Maintenance Manual)	Yes
Telematics	No

### Exterior 360 Walkaround

### 360 Walkaround & Operating Video

### Walkaround Photos & Operating Video


Exterior Walkaround Photos	
Operating Video	<a href="#">Click to Download</a>

## Inspection Report (Forklift)

### General Appearance Inspection Points

#### General Appearance

#### General Appearance Photos

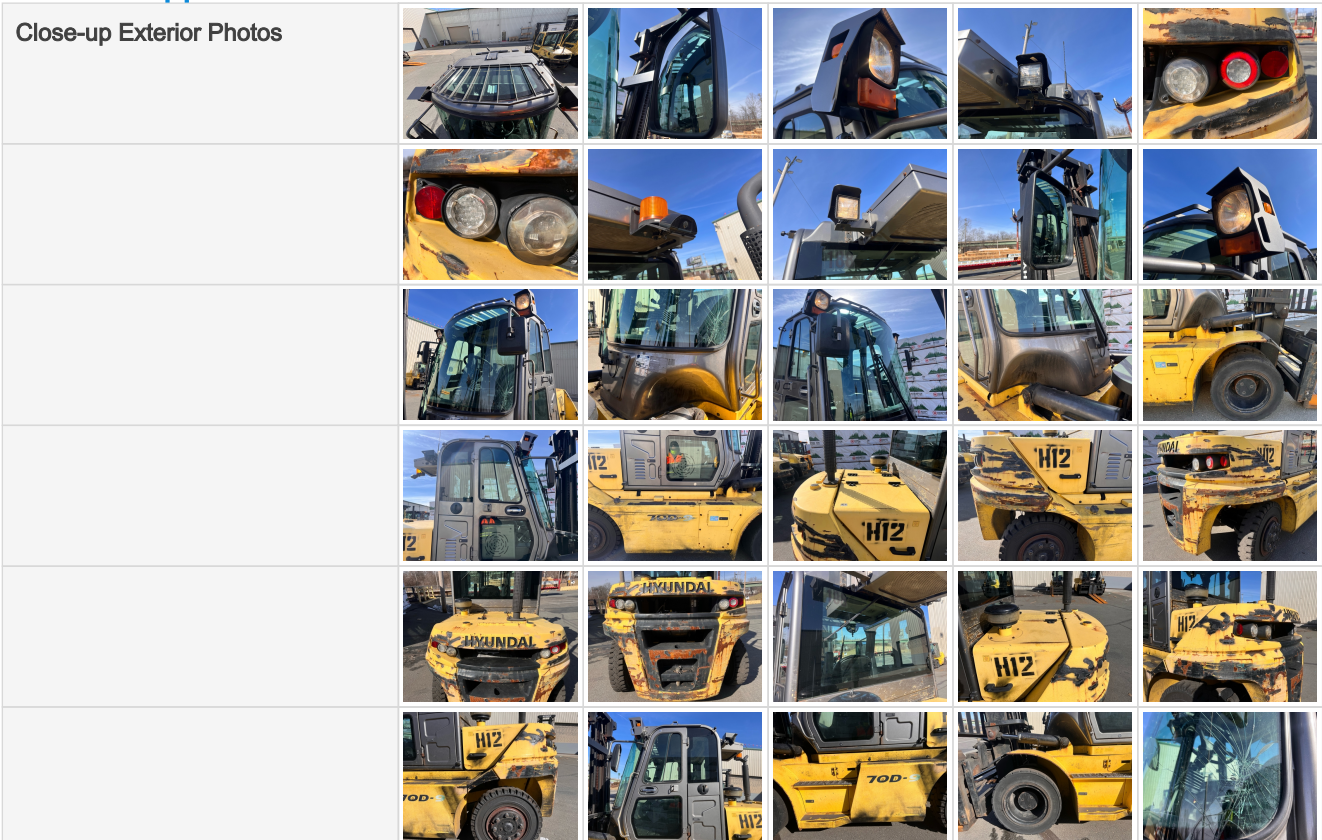

### General Appearance Inspection Points

Inspection Rating Criteria	Rating Scale	Explanation
	1 - Service Required	Requires immediate repairs to function as expected.
	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.
	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.
	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.
	5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.
Body Panels	2 - Above Average Wear & Tear	
Body Panel Condition		Visible chipped paint or dents, Areas of surface rust observed, Some panel misalignment observed
Doors / Canopy Latches	3 - Normal Wear & Tear	
Doors / Canopy Latches Condition		No visible damage
Steps / Ladders	3 - Normal Wear & Tear	


## Inspection Report (Forklift)

Steps / Ladders Condition	Steps/ladders are fully intact and appear structurally sound
Handrails	3 - Normal Wear & Tear
Handrails Condition	Handrails are fully intact and appear structurally sound
Glass	1 - Service Required
Glass Condition	Major chips or cracks observed
Comments	Windshield major crack
Mirrors	3 - Normal Wear & Tear
Exterior Lights	3 - Normal Wear & Tear
Exterior Lights Condition	No visible damage, lighting system is operational
Overall Exterior	2 - Above Average Wear & Tear
Comments	Paint chips throughout exterior of machine, areas of surface rust observed, major crack on windshield glass, left rear tail lights cracked

## Control Station Inspection Points

### Control Station

### Control Station Photos

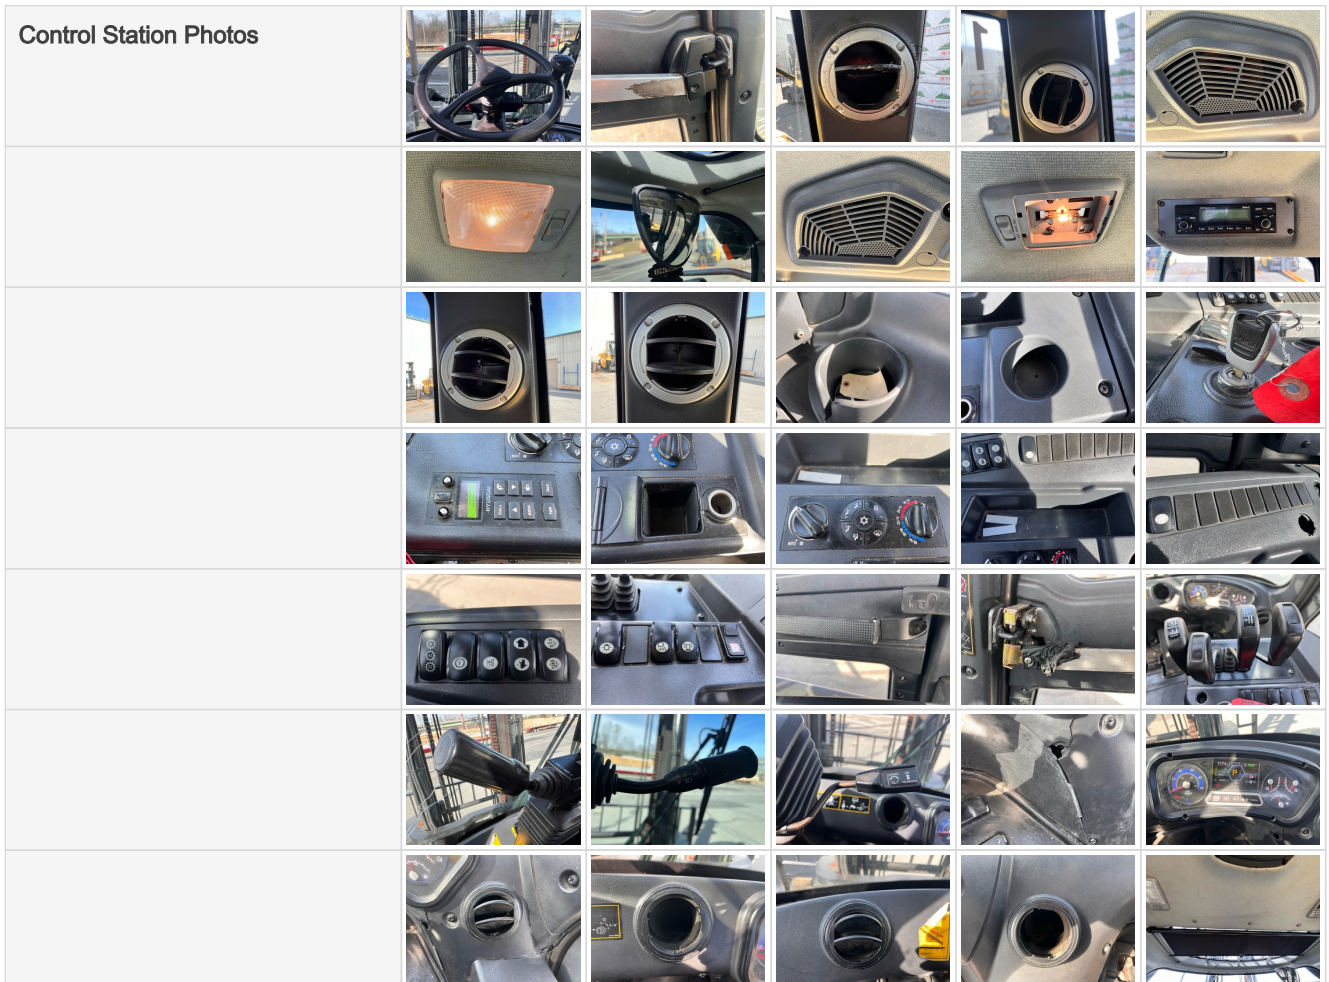

### Inspection Report (Forklift)

	
	
<b>Serial Number Plate</b>	
<b>Hour Meter/Odometer</b>	
<b>Control Station Type</b>	Enclosed Cab (EROPS)
<b>Option List</b>	Unable to Confirm
<b>Seat</b>	2 - Above Average Wear & Tear
<b>Seat Condition</b>	Seat(s) have minor surface staining or small tears, Seat belt secures properly



## Inspection Report (Forklift)

Cabin Lights	2 - Above Average Wear & Tear
Cabin Lights Condition	One or more light cover or bulb is missing, lighting system is operational
Safety Lock Out / Stop	3 - Normal Wear & Tear
Safety Lock Out / Stop Condition	Safety lock out device is present, in good condition, and functional
Controls & Switches	3 - Normal Wear & Tear
Controls & Switches Condition	All switches are installed and functional
Hour Meter Activity	3 - Normal Wear & Tear
Hour Meter Condition	Hour meter is functional and in good condition
Other Gauge Activity	3 - Normal Wear & Tear
Other Gauge Condition	All cockpit gauges are functional and in good condition
Heater & A/C	2 - Above Average Wear & Tear
Heater & A/C Condition	Only heat functionality works
Travel Alarm	0
Horn	3 - Normal Wear & Tear
Horn Condition	Horn is installed and functioning as expected
Backup Camera	3 - Normal Wear & Tear
Backup Camera Condition	Back up camera is installed and functioning as expected
Control Station Overall Rating	3 - Normal Wear & Tear
Control Station Overall Condition	Good cabin appearance, solid floors, panels, and ceiling









## Engine Inspection Points

### Engine

### Engine Compartment Photos

Engine Data Plate					
Engine Compartment Photos					

## Inspection Report (Forklift)

	    
	  
<b>Engine Type (Make, Model, Cylinders, Hp)</b>	Cummins, QSF 3.8
<b>Emissions Tier</b>	Tier 4F
<b>Engine Serial Number</b>	89801496
<b>Engine Fuel Type</b>	Diesel
<b>Blow-by (Visual Observation Check)</b>	No
<b>Engine Smoke (Upon Start-up, Idle, Shutdown)</b>	Yes
<b>Engine Smoke Notes</b>	Engine smoke observed upon start up
<b>Engine Exhaust Color</b>	White
<b>Battery</b>	3 - Normal Wear & Tear
<b>Battery Condition</b>	Inaccessible, unable to determine condition
<b>Radiator</b>	3 - Normal Wear & Tear
<b>Radiator Condition</b>	Radiator fins & components appear to be in good working order, no signs of damage or leaks
<b>Belts</b>	3 - Normal Wear & Tear
<b>Belt Condition</b>	Belts appear in good condition & alignment with proper tension
<b>Hoses</b>	3 - Normal Wear & Tear
<b>Hose Condition</b>	Firm, pliant hoses with no signs of wear or leaks
<b>Water Pump</b>	3 - Normal Wear & Tear
<b>Water Pump Condition</b>	No unusual pump noises heard
<b>Cooling System Leaks</b>	No
<b>Coolant Appearance</b>	3 - Normal Wear & Tear
<b>Coolant Appearance Notes</b>	Normal Translucent appearance, no visual signs of contamination
<b>Oil Leaks</b>	No
<b>Oil Appearance</b>	3 - Normal Wear & Tear
<b>Oil Appearance Notes</b>	Appropriate oil level
<b>Fuel Leaks</b>	No
<b>Equipped with DPF (Diesel Particulate Filter)</b>	Yes


## Inspection Report (Forklift)

DPF Condition	3 - Normal Wear & Tear
DPF Condition Notes	Filter housing is intact with no signs of damage or malfunction, DPF indicator is not illuminated
Requires DEF (Diesel Exhaust Fluid)	Yes
DEF Tank	3 - Normal Wear & Tear
DEF Tank Condition	Area around DEF tank cap is clean, fluid is clear & appears free of contaminants
Overall Engine Rating	3 - Normal Wear & Tear
Overall Engine Appearance	Dusty & dry
Overall Engine Comments	Normal wear and tear No major issues to report

## Drivetrain Inspection Points

### Drivetrain

### Drivetrain Inspection Points





Drivetrain Photos	
Hydrostatic Transmission?	No
Transmission Info (Make/Model/Speeds)	Unable to verify
Drive Type	2WD
Transmission Components	3 - Normal Wear & Tear
Transmission Condition	Good forward and reverse function, No unusual noises or vibrations
Parking Brake	3 - Normal Wear & Tear
Overall Drivetrain Rating	3 - Normal Wear & Tear
Overall Drivetrain Comments	Normal wear and tear No major issues to report
Front Axle	3 - Normal Wear & Tear
Rear Axle	0

## Wheels & Tires


### Wheels & Tires Inspection Points

Wheels & Hubs	3 - Normal Wear & Tear
---------------	------------------------

## Inspection Report (Forklift)

Wheel Seal Leaks	No
Tire Brand	GS-solid
Tire Size	8.25-15
Front Left Tire - Ratio Remaining	10%
Front Left Tire Photos	
Front Right Tire - Ratio Remaining	10%
Front Right Tire Photos	
Rear Right Tire - Ratio Remaining	70%
Rear Right Tire Photos	
Rear Left Tire - Ratio Remaining	70%
Rear Left Tire Photos	

## Chassis Inspection Points

Chassis Photos	
Frame	3 - Normal Wear & Tear
Stance	3 - Normal Wear & Tear
Carriage Appearance	2 - Above Average Wear & Tear
Comments	Slightly bent backrest
Mast Condition	3 - Normal Wear & Tear
Chain / Tensioners	3 - Normal Wear & Tear
Rollers & Guides	3 - Normal Wear & Tear




## Inspection Report (Forklift)

Overall Chassis	3 - Normal Wear & Tear
Overall Chassis Comments	Normal wear and tear No major issues to report


### Hydraulics Overall Inspection Points

#### Hydraulics Overall

#### Hydraulic System Inspection Points

Hydraulic System Photos	
Wet or Damp Hydraulic Lines / Fittings	No
Hydraulic Lines/Fittings	3 - Normal Wear & Tear
Hydraulic Lines / Fittings Condition	Hydraulic lines & fittings are clean and in good condition
Hydraulic Pump(s)	3 - Normal Wear & Tear
Unusual Noises	No
Hydraulic Pump Notes	No unusual noises heard during operation

### Hydraulic Cylinder Inspection Points

Hydraulic Cylinder Photos	
Mounting Pins	3 - Normal Wear & Tear
Cylinder Oil Leaks	No
Hydraulic System Overall	3 - Normal Wear & Tear

### Functional Test

## Inspection Report (Forklift)

### Functionality Assessment

#### Functionality Assessment

Engine	3 - Normal Wear & Tear
Transmission/Drivetrain	3 - Normal Wear & Tear
Travel (Forward/Reverse/Steering)	3 - Normal Wear & Tear
Brakes	3 - Normal Wear & Tear
Hydraulic System	3 - Normal Wear & Tear
Electric Operating System	3 - Normal Wear & Tear
Controls	3 - Normal Wear & Tear
Safety Systems	3 - Normal Wear & Tear
Core Functions	3 - Normal Wear & Tear
Attachments	3 - Normal Wear & Tear
Overall Functional Test Comments	Normal wear and tear No major issues to report

### Overall Assessment

#### Overall Assessment

Inspection Rating Criteria	<b>Rating Scale</b>	<b>Explanation</b>
	1 - Service Required	Requires immediate repairs to function as expected.
	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.
	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.
	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.
	5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.
Exterior Rating	2 - Above Average Wear & Tear	
Interior Rating	3 - Normal Wear & Tear	
Safety Rating	2 - Above Average Wear & Tear	
Quality Rating	3 - Normal Wear & Tear	
Functionality Rating	3 - Normal Wear & Tear	
Overall Rating	3 - Normal Wear & Tear	
What's Great About the Machine	The great thing about this machine is its engine, it starts right up with no abnormal noises.	
What Needs Work	The things that need work on this machine are the front windshield that is cracked, the Left rear tail lights that are cracked and The heater vents that are damaged.	
Date/Time	02-15-2024	
Inspector Name	Javier Bocanegra	