

## Inspection Report (Forklift)

### General Info

B&B Stock Number	A0329940
Year	2014
Make	Hyster
Model	H155FT
Serial Number	K006V02468M
Hour Meter Reading	15190
Previous Application (e.g., earth moving, mining, demolition, etc)	Warehouse


### Features and Configuration

Forks / Work Tool Specs	4' forks
Side Shift	Yes
Tilt Carriage	No
Tilt Mast	Yes
Frame Leveling	No
Additional Attachment(s)?	No
Auxiliary Hydraulics	No
Engine Type	Internal Combustion
Wheel Type	Solid
Heat	Yes
A/C	No
Radio	No
Backup Camera	No
OMM (Operator & Maintenance Manual)	No
Telematics	No
Other Configuration Details / Notes	Hydraulic fork spreader

### Exterior 360 Walkaround

### 360 Walkaround & Operating Video

### Walkaround Photos & Operating Video

Exterior Walkaround Photos	
----------------------------	--
















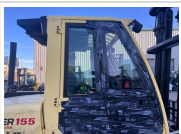













## Inspection Report (Forklift)

	  	
Operating Video	<a href="#">Click to Download</a>	

### General Appearance Inspection Points

#### General Appearance

#### General Appearance Photos

Close-up Exterior Photos	    	
	    	
	    	
	    	
	    	
	    <td></td>	

### General Appearance Inspection Points

Inspection Rating Criteria	<table border="1"> <thead> <tr> <th>Rating Scale</th> <th>Explanation</th> </tr> </thead> <tbody> <tr> <td>1 - Service Required</td> <td>Requires immediate repairs to function as expected.</td> </tr> <tr> <td>2 - Above Average Wear &amp; Tear</td> <td>Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.</td> </tr> <tr> <td>3 - Normal Wear &amp; Tear</td> <td>Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.</td> </tr> <tr> <td>4 - Very Light or Minimal Wear</td> <td>Exhibits very minimal wear. Operation is better than expected given age and usage.</td> </tr> <tr> <td>5 - Like New, Recently Replaced</td> <td>Excellent condition, free of visible wear or damage. Operation is within factory specifications.</td> </tr> </tbody> </table>	Rating Scale	Explanation	1 - Service Required	Requires immediate repairs to function as expected.	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.	5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.
	Rating Scale	Explanation											
	1 - Service Required	Requires immediate repairs to function as expected.											
	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.											
	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.											
	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.											
5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.												
Body Panels	2 - Above Average Wear & Tear												
Body Panel Condition	Visible chipped paint or dents, Large dents or cracks, Areas of surface rust observed												

## Inspection Report (Forklift)

Comments	Bent step on left side, paint chipping at rear
Doors / Canopy Latches	1 - Service Required
Doors / Canopy Latches Condition	Loose or missing latches, hinges or handles, Other (see comments)
Comments	Right side door taped up, left side door window taped in place, left side door is bent and door hinge welded
Steps / Ladders	2 - Above Average Wear & Tear
Steps / Ladders Condition	Bent or broken steps or rungs
Comments	Left side lower step bent
Handrails	3 - Normal Wear & Tear
Handrails Condition	Handrails are fully intact and appear structurally sound
Glass	3 - Normal Wear & Tear
Glass Condition	Glass intact, no visible damage
Mirrors	2 - Above Average Wear & Tear
Mirror Condition	Mirrors present and intact, no visible damage, Other (see comments)
Comments	Left side mirror taped up
Exterior Lights	3 - Normal Wear & Tear
Exterior Lights Condition	No visible damage, lighting system is operational
Overall Exterior	2 - Above Average Wear & Tear
Comments	Left door window taped in place, left door bent and hinge re-welded, right side door taped up, left side door latch damage


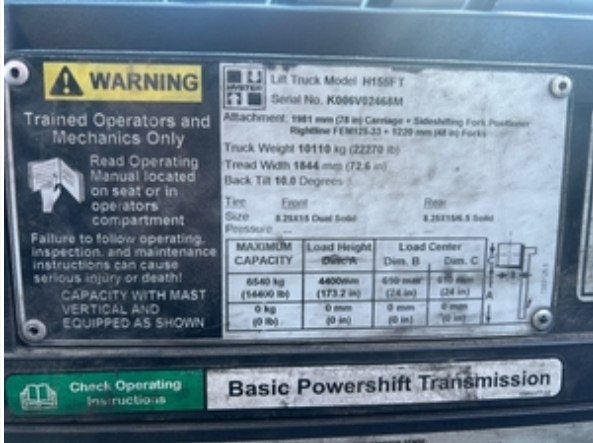
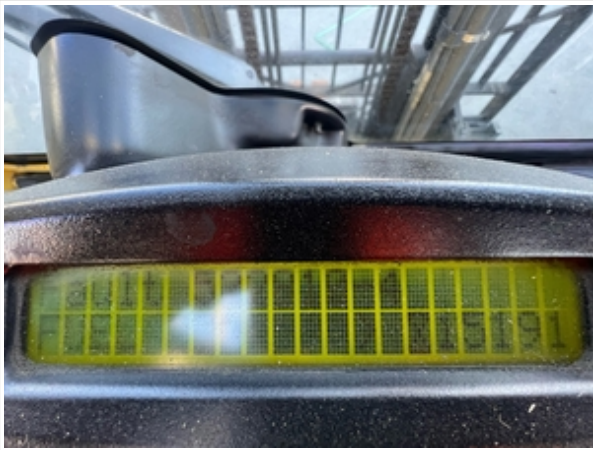
## Control Station Inspection Points

### Control Station

### Control Station Photos

Control Station Photos					
					
					
					

## Inspection Report (Forklift)

															
Serial Number Plate	 <p><b>WARNING</b> Trained Operators and Mechanics Only Read Operating Manual located on seat or in operators compartment Failure to follow operating, inspection, and maintenance instructions can cause serious injury or death! CAPACITY WITH MAST VERTICAL AND EQUIPPED AS SHOWN</p> <p>Let Truck Model H155F T Serial No. K096V92466M Attachment: 1981 mm (78 in) Carriage + Sideshifting Fork Post/Carrier Rightline FEM125-23 + 1220 mm (48 in) Forks Truck Weight 19110 kg (22270 lb) Tread Width 1844 mm (72.6 in) Back Tilt 10.6 Degrees</p> <table border="1"> <thead> <tr> <th rowspan="2">MAXIMUM CAPACITY</th> <th rowspan="2">Load Height</th> <th colspan="2">Load Center</th> </tr> <tr> <th>Dim. B</th> <th>Dim. C</th> </tr> </thead> <tbody> <tr> <td>6540 kg (14400 lb)</td> <td>4400mm (173.2 in)</td> <td>630 mm (24.8 in)</td> <td>615 mm (24.2 in)</td> </tr> <tr> <td>0 kg (0 lb)</td> <td>0 mm (0 in)</td> <td>0 mm (0 in)</td> <td>0 mm (0 in)</td> </tr> </tbody> </table> <p>Check Operating Basic Powershift Transmission</p>	MAXIMUM CAPACITY	Load Height	Load Center		Dim. B	Dim. C	6540 kg (14400 lb)	4400mm (173.2 in)	630 mm (24.8 in)	615 mm (24.2 in)	0 kg (0 lb)	0 mm (0 in)	0 mm (0 in)	0 mm (0 in)
MAXIMUM CAPACITY	Load Height			Load Center											
		Dim. B	Dim. C												
6540 kg (14400 lb)	4400mm (173.2 in)	630 mm (24.8 in)	615 mm (24.2 in)												
0 kg (0 lb)	0 mm (0 in)	0 mm (0 in)	0 mm (0 in)												
Hour Meter/Odometer															
Control Station Type	Enclosed Cab (EROPS)														
Option List	Unable to Confirm														
Seat	2 - Above Average Wear & Tear														
Seat Condition	Seat(s) have minor surface staining or small tears, Seat belt secures properly														
Cabin Lights	1 - Service Required														
Cabin Lights Condition	Cabin light system is not operational														
Safety Lock Out / Stop	3 - Normal Wear & Tear														
Safety Lock Out / Stop Condition	Safety lock out device is present, in good condition, and functional														



## Inspection Report (Forklift)

Controls & Switches	3 - Normal Wear & Tear
Controls & Switches Condition	All switches are installed and functional
Hour Meter Activity	2 - Above Average Wear & Tear
Hour Meter Condition	Hour meter is unreadable or not functioning
Last Known Hour Meter Reading	15191
Comments	Display contrast too low hard to see what is being displayed
Other Gauge Activity	0
Heater & A/C	1 - Service Required
Heater & A/C Condition	Fan only, heating and A/C components inoperative
Travel Alarm	0
Backup Camera	0
Control Station Overall Rating	2 - Above Average Wear & Tear
Control Station Overall Condition	Other (see comments)
Comments	Door latch to exit left door not operational, display screen contrast is too low, heater does not blow hot, left side mirror taped up







## Engine Inspection Points

### Engine

### Engine Compartment Photos

Engine Data Plate					
Engine Compartment Photos					

## Inspection Report (Forklift)

	    
	
<b>Engine Type (Make, Model, Cylinders, Hp)</b>	Kubota, v3800
<b>Emissions Tier</b>	Tier 4i
<b>Engine Serial Number</b>	Unable to verify
<b>Engine Fuel Type</b>	Diesel
<b>Blow-by (Visual Observation Check)</b>	No
<b>Unusual Noises (Upon Start-up, Idle, Shutdown)</b>	No
<b>Engine Smoke (Upon Start-up, Idle, Shutdown)</b>	Yes
<b>Engine Smoke Notes</b>	Engine smoke observed upon start up
<b>Engine Exhaust Color</b>	White
<b>Battery</b>	3 - Normal Wear & Tear
<b>Battery Condition</b>	Inaccessible, unable to determine condition
<b>Radiator</b>	3 - Normal Wear & Tear
<b>Radiator Condition</b>	Radiator fins & components appear to be in good working order, no signs of damage or leaks
<b>Belts</b>	3 - Normal Wear & Tear
<b>Belt Condition</b>	Belts appear in good condition & alignment with proper tension
<b>Hoses</b>	3 - Normal Wear & Tear
<b>Hose Condition</b>	Firm, pliant hoses with no signs of wear or leaks
<b>Water Pump</b>	3 - Normal Wear & Tear
<b>Water Pump Condition</b>	No unusual pump noises heard
<b>Cooling System Leaks</b>	No
<b>Coolant Appearance</b>	3 - Normal Wear & Tear
<b>Coolant Appearance Notes</b>	Normal Translucent appearance, no visual signs of contamination
<b>Oil Leaks</b>	No
<b>Oil Appearance</b>	3 - Normal Wear & Tear
<b>Oil Appearance Notes</b>	Appropriate oil level
<b>Fuel Leaks</b>	No


## Inspection Report (Forklift)

Equipped with DPF (Diesel Particulate Filter)	Yes
DPF Condition	3 - Normal Wear & Tear
DPF Condition Notes	Filter housing is intact with no signs of damage or malfunction, DPF indicator is not illuminated
Requires DEF (Diesel Exhaust Fluid)	No
Overall Engine Rating	2 - Above Average Wear & Tear
Overall Engine Appearance	Dusty & dry
Overall Engine Comments	Unknown fault code on display screen.

## Drivetrain Inspection Points

### Drivetrain

### Drivetrain Inspection Points





Drivetrain Photos	
Hydrostatic Transmission?	No
Transmission Info (Make/Model/Speeds)	Unable to verify
Drive Type	2WD
Transmission Components	3 - Normal Wear & Tear
Transmission Condition	Good forward and reverse function
Parking Brake	3 - Normal Wear & Tear
Overall Drivetrain Rating	3 - Normal Wear & Tear
Overall Drivetrain Comments	Normal wear and tear No major issues to report
Front Axle	3 - Normal Wear & Tear
Rear Axle	0

## Wheels & Tires

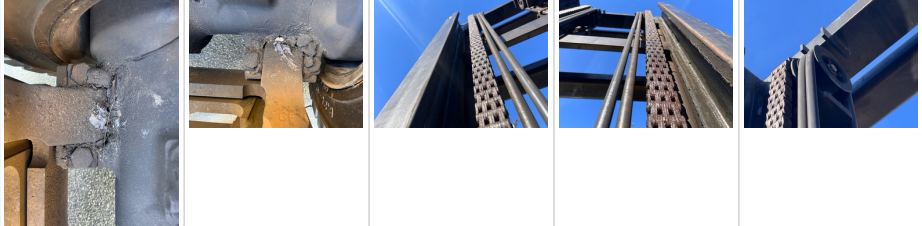
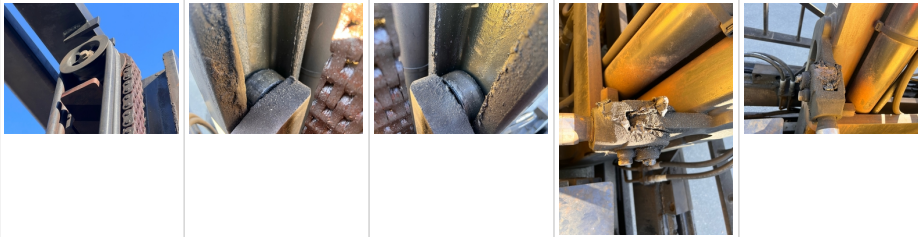

### Wheels & Tires Inspection Points

Wheels & Hubs	3 - Normal Wear & Tear
Wheel Seal Leaks	No

## Inspection Report (Forklift)

Tire Brand	Gs sold tire			
Tire Size	8.25-15			
Front Left Tire - Ratio Remaining	90%			
Front Left Tire Photos				
Front Right Tire - Ratio Remaining	90%			
Front Right Tire Photos				
Rear Right Tire - Ratio Remaining	90%			
Rear Right Tire Photos				
Rear Left Tire - Ratio Remaining	90%			
Rear Left Tire Photos				

## Chassis Inspection Points

Chassis Photos					
					
					
Frame	3 - Normal Wear & Tear				
Stance	3 - Normal Wear & Tear				
Carriage Appearance	3 - Normal Wear & Tear				
Mast Condition	3 - Normal Wear & Tear				



## Inspection Report (Forklift)

Chain / Tensioners	3 - Normal Wear & Tear
Rollers & Guides	3 - Normal Wear & Tear
Overall Chassis	3 - Normal Wear & Tear
Overall Chassis Comments	Normal wear and tear No major issues to report

## Functional Test

### Functionality Assessment

### Functionality Assessment

Engine	2 - Above Average Wear & Tear
Comments	Unknown fault code on display screen.
Transmission/Drivetrain	3 - Normal Wear & Tear
Travel (Forward/Reverse/Steering)	3 - Normal Wear & Tear
Brakes	3 - Normal Wear & Tear
Hydraulic System	3 - Normal Wear & Tear
Electric Operating System	3 - Normal Wear & Tear
Controls	3 - Normal Wear & Tear
Safety Systems	3 - Normal Wear & Tear
Core Functions	3 - Normal Wear & Tear
Attachments	3 - Normal Wear & Tear
Overall Functional Test Comments	Normal wear and tear No major issues to report

## Overall Assessment

### Overall Assessment

Inspection Rating Criteria	<b>Rating Scale</b>	<b>Explanation</b>
	1 - Service Required	Requires immediate repairs to function as expected.
	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.
	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.
	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.
	5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.
Exterior Rating	2 - Above Average Wear & Tear	
Interior Rating	2 - Above Average Wear & Tear	
Safety Rating	3 - Normal Wear & Tear	
Quality Rating	3 - Normal Wear & Tear	
Functionality Rating	3 - Normal Wear & Tear	



## Inspection Report (Forklift)

<b>Overall Rating</b>	3 - Normal Wear & Tear
<b>What's Great About the Machine</b>	The thing that's great about this machine is it engine. It starts right up with no abnormal noises heard.
<b>What Needs Work</b>	The things that need work on this machine are the left side door, the right side door and the check engine light
<b>Date/Time</b>	02-15-2024
<b>Inspector Name</b>	Javier Bocanegra