



Inspection Report (On-Highway Truck Cab + Chassis)

General Info

B&B Stock Number	A9653085
Year	2007
Make	Freightliner
Model	Columbia
Serial Number	1FUJA6CK97LX83192
Serial Plate	
Odometer Reading	737504
Odometer	
Current Inspection / State Cert / DOT	unable to verify
Previous Application (e.g., earth moving, mining, demolition, etc)	This truck was used at a food bank

Dimensions

Length (ft and inches)	23ft 3in
Width (ft and inches)	8ft 3in
Height (ft and inches)	12ft
Wheelbase (ft and inches)	14ft 5.5in
GVWR (lbs)	52,000lbs

Inspection Report (On-Highway Truck Cab + Chassis)

Features and Configuration

Drive Type	4X2
Overdrive	Yes
Heat	Yes
A/C	Yes
Radio	Yes
Backup Camera	No
Cruise Control	Yes
PTO	No
Engine Brake	2 Position
Differential Lock	Yes
Auxiliary Engine	No
Liftgate	No
Telematics	No
OMM (Operator & Maintenance Manual)	No

Exterior 360 Walkaround

360 Walkaround & Operating Video

Walkaround Photos & Operating Video

Exterior Walkaround Photos	    
	    
Operating Video	Click to Download



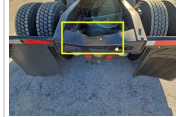








General Appearance Inspection Points

General Appearance

General Appearance Photos

Close-up Exterior Photos	    
	    

Inspection Report (On-Highway Truck Cab + Chassis)

					
			A dent was noticed directly behind the 5th wheel		
					
					

General Appearance Inspection Points

Inspection Rating Criteria	Rating Scale	Explanation
	1 - Service Required	Requires immediate repairs to function as expected.
	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.
	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.
	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.
	5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.
Body Panels	3 - Normal Wear & Tear	
Body Panel Condition	Other (see comments), Some panel misalignment observed, Visible chipped paint or dents	
Comments	When the hood is closed, the right-hand side of the trucks hood shuts but is misaligned by a small amount. This is because the bracket that holds the hood in place is bent on the right-hand side.	
Doors / Canopy Latches	3 - Normal Wear & Tear	
Doors / Canopy Latches Condition	No visible damage	
Steps / Ladders	3 - Normal Wear & Tear	
Steps / Ladders Condition	Steps/ladders are fully intact and appear structurally sound	
Handrails	3 - Normal Wear & Tear	
Handrails Condition	Handrails are fully intact and appear structurally sound	
Glass	4 - Very Light or Minimal Wear	
Glass Condition	Glass intact, no visible damage	
Mirrors	4 - Very Light or Minimal Wear	
Mirror Condition	Mirrors present and intact, no visible damage	
Exterior Lights	4 - Very Light or Minimal Wear	

























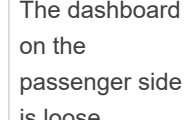

Inspection Report (On-Highway Truck Cab + Chassis)

Exterior Lights Condition	No visible damage, lighting system is operational
Overall Exterior	3 - Normal Wear & Tear
Comments	The exterior is in good shape with signs of normal wear and tear throughout the exterior.

Cab Inspection Points

On Highway - Cab

Cab Interior Photos

Cab Interior Photos	    
	    
	    
	    
	     The dashboard on the passenger side is loose.
	 This area is damaged
Odometer Activity	3 - Normal Wear & Tear
Odometer	Odometer is working and in good condition
Controls/Switches/Gauges	3 - Normal Wear & Tear
Controls/Switches/Gauges	All switches/gauges are in good condition and functioning
Brake System Type	Air Brakes
Air Brakes Build Correct Pressure	Yes
Clutch	3 - Normal Wear & Tear
Clutch Function	Clutch is functioning as expected
Horn	3 - Normal Wear & Tear
Horn Function	Horn is functioning as expected







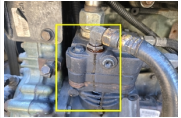














Inspection Report (On-Highway Truck Cab + Chassis)

Reverse Alarm / Backup Camera	N/A
Heater & A/C	3 - Normal Wear & Tear
Heat & A/C	A/C Blows cool - noticeably cooler than air temp
Interior Lights	3 - Normal Wear & Tear
Interior Lights	All interior lights are installed and functioning
Seats/Seat Belts	3 - Normal Wear & Tear
Seats/Seat Belt	Seat belt secures properly, Seat(s) have minor surface staining or small tears
Cab Interior Overall	3 - Normal Wear & Tear
Comments	The cab is in good condition with a normal amount of wear and tear.









Engine Inspection Points

Engine

Engine Compartment Photos

Engine Data Plate					
Engine Compartment Photos					
					
	this area has a fuel leak.	Fuel leak			
					
					

Inspection Report (On-Highway Truck Cab + Chassis)

	    	
	   <td></td>	
Engine Type (Make, Model, Cylinders, Hp)	Detroit, Series 60, Hp 515	
Emissions Tier	Undetermined	
Engine Serial Number	unable to verify	
Engine Fuel Type	Diesel	
Blow-by (Visual Observation Check)	Yes	
Comments	The blowby check was good	
Unusual Noises (Upon Start-up, Idle, Shutdown)	No	
Engine Smoke (Upon Start-up, Idle, Shutdown)	No	
Engine Exhaust Color	Clear	
Battery	3 - Normal Wear & Tear	
Battery Condition	Clean & dry appearance, tight connections	
Radiator	3 - Normal Wear & Tear	
Radiator Condition	Radiator fins & components appear to be in good working order, no signs of damage or leaks	
Belts	3 - Normal Wear & Tear	
Hoses	3 - Normal Wear & Tear	
Water Pump	3 - Normal Wear & Tear	
Cooling System Leaks	No	
Coolant Appearance	3 - Normal Wear & Tear	
Oil Leaks	No	
Oil Appearance	3 - Normal Wear & Tear	
Oil Appearance Notes	Very dark, black & burnt oil appearance, Appropriate oil level	
Fuel Leaks	Yes	
Fuel Leak Notes	Wet spots & streaking on fuel lines indicate an active leak	
Equipped with DPF (Diesel Particulate Filter)	No	
Requires DEF (Diesel Exhaust Fluid)	No	







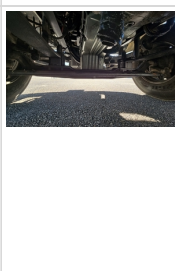
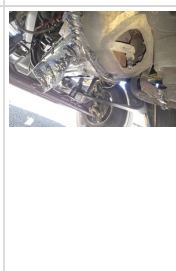

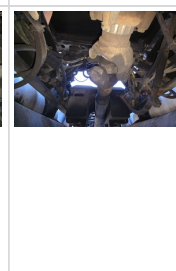













Inspection Report (On-Highway Truck Cab + Chassis)

Overall Engine Rating	2 - Above Average Wear & Tear
Overall Engine Appearance	Active leaks/pooling observed in & around engine compartment
Overall Engine Comments	A fuel leak was seen on the engine. The seller is aware and is going to fix the issue.

Chassis & Drivetrain Inspection Points

On-Highway: Underbody Components

Chassis & Drivetrain Photos

Chassis & Drivetrain Underside Photos					
				This area around the transmission is wet and has signs of a small active leak.	
					
	Active leaking around the transmission bell was seen.				
					
					
					

Chassis Inspection Points

Frame	3 - Normal Wear & Tear
Suspension	3 - Normal Wear & Tear
Steer Axle	3 - Normal Wear & Tear
Steering Components	3 - Normal Wear & Tear

Inspection Report (On-Highway Truck Cab + Chassis)

Overall Chassis Condition	3 - Normal Wear & Tear
Overall Chassis Comments	The chassis is in good working order





Drivetrain Inspection Points

Transmission Info (Make/Model)	Eaton
Transmission	2 - Above Average Wear & Tear
Transmission Condition	No unusual noises or vibrations, Other (see comments)
Comments	The transmission had a small leak coming from around the bell.
PTO	N/A
Rear Differential	3 - Normal Wear & Tear
Rear Differential Condition	Dry housing appearance, no unusual noises heard during operation
Front Differential	3 - Normal Wear & Tear
Front Differential Condition	Dry housing appearance, no unusual noises heard during operation
Brake Shoe Thickness	50%
Air Brake System Leaks	No
Air Brake Hose Condition	3 - Normal Wear & Tear
Overall Drivetrain Condition	3 - Normal Wear & Tear
Overall Drivetrain Comments	The drivetrain is fully functional.

Wheels & Tires Inspection Points

Wheels & Tires

Wheels & Tires Inspection Points

Wheel Type	Pneumatic
Wheel Seal Leaks	No
Tire Brand	Bridgestone
Tire Size	11R22.5
Front Left Tire - Ratio Remaining	70%
Front Left Tire Photos	 
Front Right Tire - Ratio Remaining	50%
Front Right Tire Photos	 
Rear Right Tire - Ratio Remaining	70%

Inspection Report (On-Highway Truck Cab + Chassis)

Rear Right Tire Photos	   	
Rear Left Tire - Ratio Remaining	50%	
Rear Left Tire Photos	   	
Wheels & Hubs	3 - Normal Wear & Tear	
Comments	the left-hand side rear tires have 70% life left on tread	

Functional Test

Functionality Assessment

Functionality Assessment

Engine	2 - Above Average Wear & Tear
Comments	An active fuel leak was seen on the left-hand side of the engine.
Transmission/Drivetrain	2 - Above Average Wear & Tear
Comments	A small leak was seen around the bell area of the transmission
Travel (Forward/Reverse/Steering)	3 - Normal Wear & Tear
Brakes	3 - Normal Wear & Tear
Hydraulic System	N/A
Electric Operating System	3 - Normal Wear & Tear
Controls	3 - Normal Wear & Tear
Safety Systems	2 - Above Average Wear & Tear
Comments	An small fuel leak was seen
Core Functions	3 - Normal Wear & Tear
Attachments	N/A
Overall Functional Test Comments	The truck is fully functional and operational

Inspection Summary

Overall Assessment

Inspection Rating Criteria	Rating Scale	Explanation
	1 - Service Required	Requires immediate repairs to function as expected.
	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.
	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.
	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.
	5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.

Inspection Report (On-Highway Truck Cab + Chassis)

Exterior Rating	3 - Normal Wear & Tear
Interior Rating	3 - Normal Wear & Tear
Safety Rating	2 - Above Average Wear & Tear
Quality Rating	2 - Above Average Wear & Tear
Functionality Rating	3 - Normal Wear & Tear
Overall Rating	2 - Above Average Wear & Tear
Summary Video	Click to Download
What's Great About the Machine	On the rear axels, 6 tires have 70% life on them.
What Needs Work	A fuel leak was found on the left-hand side of the engine. A small active leak was seen coming from the transmission around the bell area, and the hood is misaligned a little bit.
Any Additional Info from the Seller?	The owner was aware of the fuel leak and is going to fix the issue. Content, notes, photos, and hours displayed were initially obtained on 3/28/24 and can be confirmed on request. Most recent hour reading is 737,564 miles and seller confirms report is still accurate.
Date/Time	03-28-2024
Inspector Name	Steven Mesa