

## Inspection Report (On-Highway Truck Cab + Chassis)

### General Info

Year	2012
Make	Kenworth
Model	T800
Serial Number	1XKDDP9X5CJ335272
Truck Odometer Reading	551,326
Current Inspection / State Cert / DOT	Last inspection 05/2022 (In accordance with 49CFR,Part396,FMCSR)
Previous Application (e.g., earth moving, mining, demolition, etc)	Equipment Rental Hauler

### Dimensions

Dimensions	Please enter in or verify (if pre-populated) the following dimensions.
Length (ft and inches)	24'6"
Width (ft and inches)	8'3"
Height (ft and inches)	11'
Wheelbase (ft and inches)	15'6"
GVWR (lbs)	52,350lbs.

### Features and Configuration

Features	Enter in and/or verify the following information regarding the features of this equipment.
Heat	Yes
A/C	Yes
Radio	Yes
Backup Camera	No
Cruise Control	Yes
PTO	Yes
PTO Details	Trans mounted
Engine Brake	Yes
Engine Brake Configuration	2 Position
Differential Lock	Yes
OMM (Operator & Maintenance Manual)	No
Telematics	Yes
Auxiliary Engine	No
Liftgate	No

## Inspection Report (On-Highway Truck Cab + Chassis)

Other Configuration Details / Features / Notes	GPS goes with truck
--	---------------------

### Exterior 360 Walkaround

#### Exterior 360 Walkaround

<b>Instructions</b>	<p>Take photos of the exterior of the piece of equipment. Capture a full 360 degree walk around and all major components.</p> <p>Must have shots to capture:</p> <ul style="list-style-type: none"> <li>- Front</li> <li>- 45 degree corner shot of left front</li> <li>- 45 degree corner shot of right front</li> <li>- Left side</li> <li>- Right side</li> <li>- Rear</li> <li>- 45 degree corner shot of left rear</li> <li>- 45 degree corner shot of right rear</li> </ul> <p>Tips for good photos:</p> <ul style="list-style-type: none"> <li>- Move the equipment into a open area without any visual distractions or other equipment in the background</li> </ul>
<b>Exterior Walkaround Photos</b>	
	

**Inspection Report (On-Highway Truck Cab + Chassis)**



### Inspection Report (On-Highway Truck Cab + Chassis)



### General Appearance Inspection Points

#### General Appearance

### Inspection Report (On-Highway Truck Cab + Chassis)

Close-up Exterior Photos



**Inspection Report (On-Highway Truck Cab + Chassis)**




**Inspection Report (On-Highway Truck Cab + Chassis)**



**Inspection Report (On-Highway Truck Cab + Chassis)**



Inspection Report (On-Highway Truck Cab + Chassis)

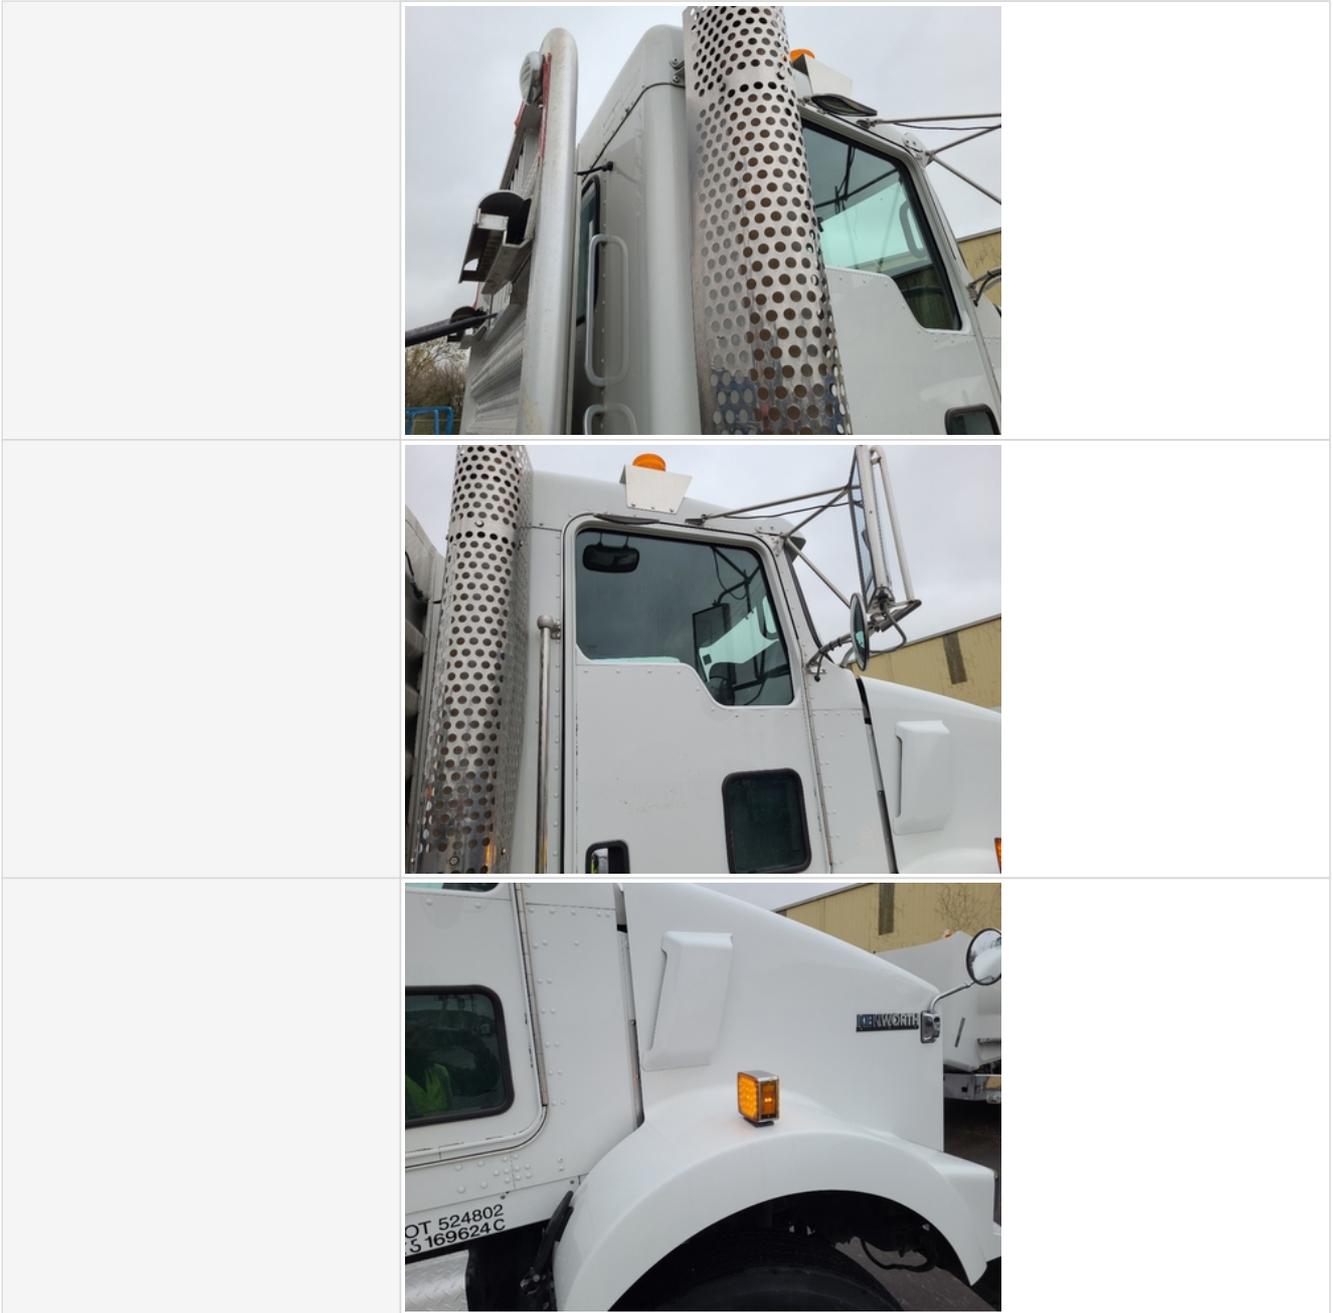

Inspection Report (On-Highway Truck Cab + Chassis)




## Inspection Report (On-Highway Truck Cab + Chassis)

	
<b>Body Panels</b>	3 - Normal Wear & Tear
<b>Body Panel Condition</b>	No visible damage, good paint condition and panel fitment
<b>Doors / Canopy Latches</b>	3 - Normal Wear & Tear
<b>Doors / Canopy Latches Condition</b>	No visible damage
<b>Steps / Ladders</b>	3 - Normal Wear & Tear
<b>Steps / Ladders Condition</b>	Steps/ladders are fully intact and appear structurally sound
<b>Handrails</b>	3 - Normal Wear & Tear
<b>Handrails Condition</b>	Handrails are fully intact and appear structurally sound
<b>Glass</b>	3 - Normal Wear & Tear
<b>Glass Condition</b>	Major chips or cracks observed, Other (see comments)
<b>Comments</b>	Large crack at front right side of windshield
<b>Glass Condition Photos</b>	
<b>Mirrors</b>	3 - Normal Wear & Tear
<b>Mirror Condition</b>	Mirrors present and intact, no visible damage
<b>Exterior Lights</b>	3 - Normal Wear & Tear
<b>Exterior Lights Condition</b>	No visible damage, lighting system is operational


### Cab Inspection Points

#### On Highway - Cab

### Inspection Report (On-Highway Truck Cab + Chassis)
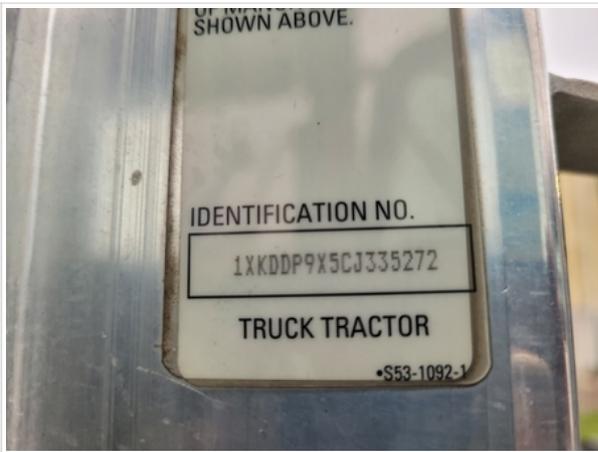
<p>VIN/Serial Number Plate Photo</p>	 <p>UP FROM SHOWN ABOVE.</p> <p>IDENTIFICATION NO. 1XKDDP9X5CJ335272</p> <p>TRUCK TRACTOR</p> <p>•S53-1092-1</p>	
<p>Odometer Photo</p>	 <p>20 120 75 5 km/h MPH 85</p> <p>55 1326 5408.7 km</p>	
<p>Cab Interior Photos</p>		

**Inspection Report (On-Highway Truck Cab + Chassis)**

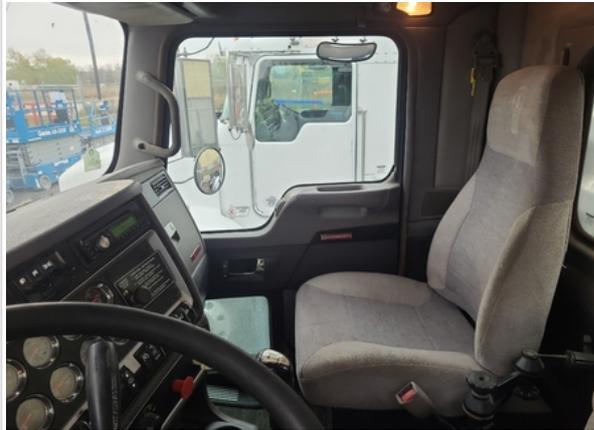

**Inspection Report (On-Highway Truck Cab + Chassis)**



**Inspection Report (On-Highway Truck Cab + Chassis)**



Inspection Report (On-Highway Truck Cab + Chassis)



**Inspection Report (On-Highway Truck Cab + Chassis)**



**Inspection Report (On-Highway Truck Cab + Chassis)**



**Inspection Report (On-Highway Truck Cab + Chassis)**



### Inspection Report (On-Highway Truck Cab + Chassis)

		
		
		
Odometer Activity	3 - Normal Wear & Tear	
Odometer Condition	Odometer is working and in good condition	
Controls/Switches/Gauges	3 - Normal Wear & Tear	
Controls/Switches/Gauges Condition	All switches/gauges are in good condition and functioning	
Horn	3 - Normal Wear & Tear	
Horn Condition	Horn is functioning as expected	
Reverse Alarm / Backup Camera	3 - Normal Wear & Tear	

## Inspection Report (On-Highway Truck Cab + Chassis)

Reverse Alarm / Backup Camera Condition	Reverse alarm working as expected
Heater & A/C	3 - Normal Wear & Tear
Heat & A/C Condition	Heater and A/C work as expected
Interior Lights	3 - Normal Wear & Tear
Interior Lights Condition	All interior lights are installed and functioning
Seats/Seat Belts	2 - Above Average Wear
Seats/Seat Belt Condition	Seat(s) in good condition, no stains or tears in upholstery, Seat belt does not secure properly, Other (see comments)
Comments	driver search belt inop
Cab Interior Overall Rating	3 - Normal Wear & Tear
Comments	overall cabin clean and good condition

## Engine Inspection Points

### Engine

Engine Type (Make, Model, Cylinders, Hp)	PACCAR - 6Cyl. - 430HP - 12.9L
Emissions Tier	Tier 4F
Engine Serial Number	Y008680
Engine Fuel Type	Diesel
Engine Photos	

Inspection Report (On-Highway Truck Cab + Chassis)




**Inspection Report (On-Highway Truck Cab + Chassis)**



**Inspection Report (On-Highway Truck Cab + Chassis)**



## Inspection Report (On-Highway Truck Cab + Chassis)

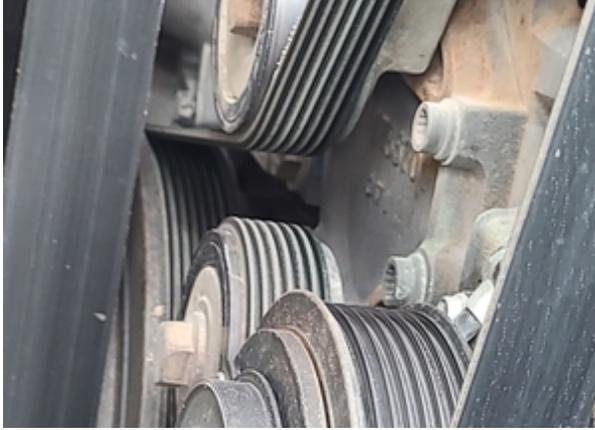	
<b>Blow-by (Visual Observation Check)</b>	Yes
<b>Comments</b>	minor blowby
<b>Unusual Noises (Upon Start-up, Idle, Shutdown)</b>	No
<b>Unusual Noise Notes</b>	No unusual noises heard
<b>Engine Smoke (Upon Start-up, Idle, Shutdown)</b>	No
<b>Engine Smoke Notes</b>	No engine smoke issues observed
<b>Engine Exhaust Color</b>	Clear
<b>Battery</b>	3 - Normal Wear & Tear
<b>Battery Condition</b>	Inaccessible, unable to determine condition
<b>Radiator</b>	3 - Normal Wear & Tear
<b>Radiator Condition</b>	Radiator fins & components appear to be in good working order, no signs of damage or leaks
<b>Belts</b>	3 - Normal Wear & Tear
<b>Belt Condition</b>	Belts appear in good condition & alignment with proper tension
<b>Hoses</b>	3 - Normal Wear & Tear
<b>Hose Condition</b>	Firm, pliant hoses with no signs of wear or leaks
<b>Water Pump</b>	3 - Normal Wear & Tear
<b>Water Pump Condition</b>	No unusual pump noises heard
<b>Cooling System Leaks</b>	No
<b>Coolant Color / Appearance</b>	3 - Normal Wear & Tear
<b>Coolant Color/Appearance Notes</b>	Normal Translucent appearance, no visual signs of contamination
<b>Oil Leaks</b>	Yes
<b>Oil Leak Notes</b>	No oil leaks seen, Other (see comments)
<b>Comments</b>	very minor seepage out of breather tube

## Inspection Report (On-Highway Truck Cab + Chassis)

Oil Leak Photos	
Oil Color / Appearance	3 - Normal Wear & Tear
Oil Color / Appearance Notes	Clean oil appearance, no signs of cross contamination, Appropriate oil level
Fuel Leaks	No
Equipped with DPF (Diesel Particulate Filter)	Yes
DPF Condition	3 - Normal Wear & Tear
DPF Condition Notes	Filter housing is intact with no signs of damage or malfunction, DPF indicator is not illuminated
DPF Photos	
Requires DEF (Diesel Exhaust Fluid)	Yes
DEF Tank	3 - Normal Wear & Tear
DEF Tank Condition	Area around DEF tank cap is clean, fluid is clear & appears free of contaminants

## Inspection Report (On-Highway Truck Cab + Chassis)


DEF Tank Photos	
Overall Engine Appearance	Clean & dry
Overall Engine Comments	Overall, engine looks to be in great condition with no major problems seen.

## Drivetrain Inspection Points

### Drivetrain

Transmission Info (Make/Model)	Eaton Fuller 13 Speed
Drive Type	4X6
Overdrive	N/A
Transmission	3 - Normal Wear & Tear
Transmission Condition	No unusual noises or vibrations
Transmission Condition Photos	


### Inspection Report (On-Highway Truck Cab + Chassis)

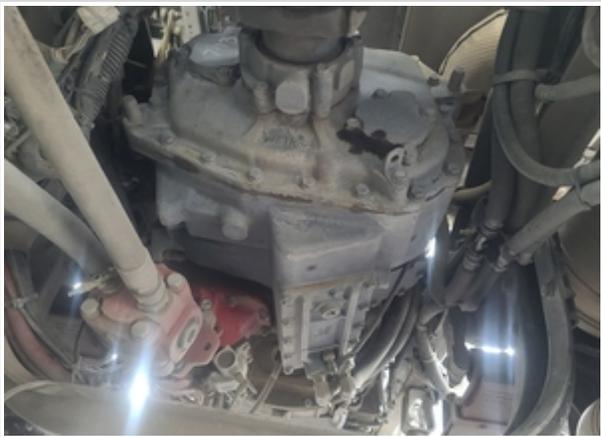		
		
<b>Clutch</b>	3 - Normal Wear & Tear	
<b>Clutch Condition</b>	Clutch is functioning as expected	
<b>Shift Lever</b>	3 - Normal Wear & Tear	
<b>Differential</b>	Check condition of the differential(s). Take photos and notes as relevant.	
<b>Rear Differential</b>	3 - Normal Wear & Tear	
<b>Rear Differential Condition</b>	Dry housing appearance, no unusual noises heard during operation	
<b>Rear Differential Photos</b>		

### Inspection Report (On-Highway Truck Cab + Chassis)

		
<b>Front Differential</b>	3 - Normal Wear & Tear	
<b>Front Differential Condition</b>	Dry housing appearance, no unusual noises heard during operation	
<b>Front Differential Photos</b>		
		

### Inspection Report (On-Highway Truck Cab + Chassis)

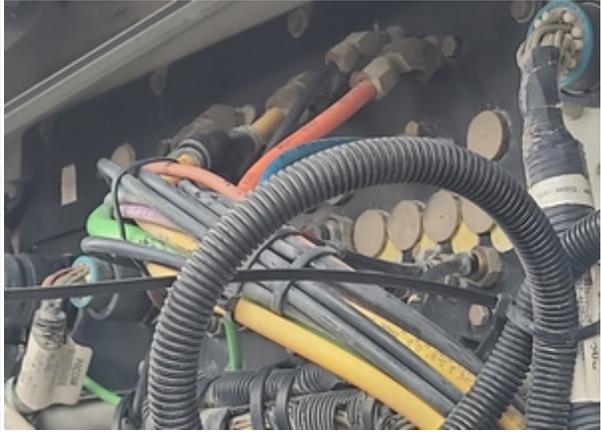		
<b>Brake System Type</b>	Air Brakes	
<b>Air Brakes Build Correct Pressure</b>	Yes	
<b>Air Brake System Leaks</b>	Yes	
<b>Comments</b>	consistent air leak underneath rear cab	
<b>Air Brake Hose Condition</b>	3 - Normal Wear & Tear	
<b>Air Brake System Photos</b>		
		

Inspection Report (On-Highway Truck Cab + Chassis)



## Inspection Report (On-Highway Truck Cab + Chassis)

	
Foot Brake	3 - Normal Wear & Tear
Foot Brake Condition	Good brake function
Engine Brake Configuration	2 Position
Engine Brake	3 - Normal Wear & Tear
Parking Brake	3 - Normal Wear & Tear
Parking Brake Condition	Good brake function
Overall Drivetrain Comments	Overall drivetrain in great condition

## Chassis & Axle Inspection Points

### Chassis


### Frame

Frame Condition	3
Frame Photos	

**Inspection Report (On-Highway Truck Cab + Chassis)**



### Inspection Report (On-Highway Truck Cab + Chassis)

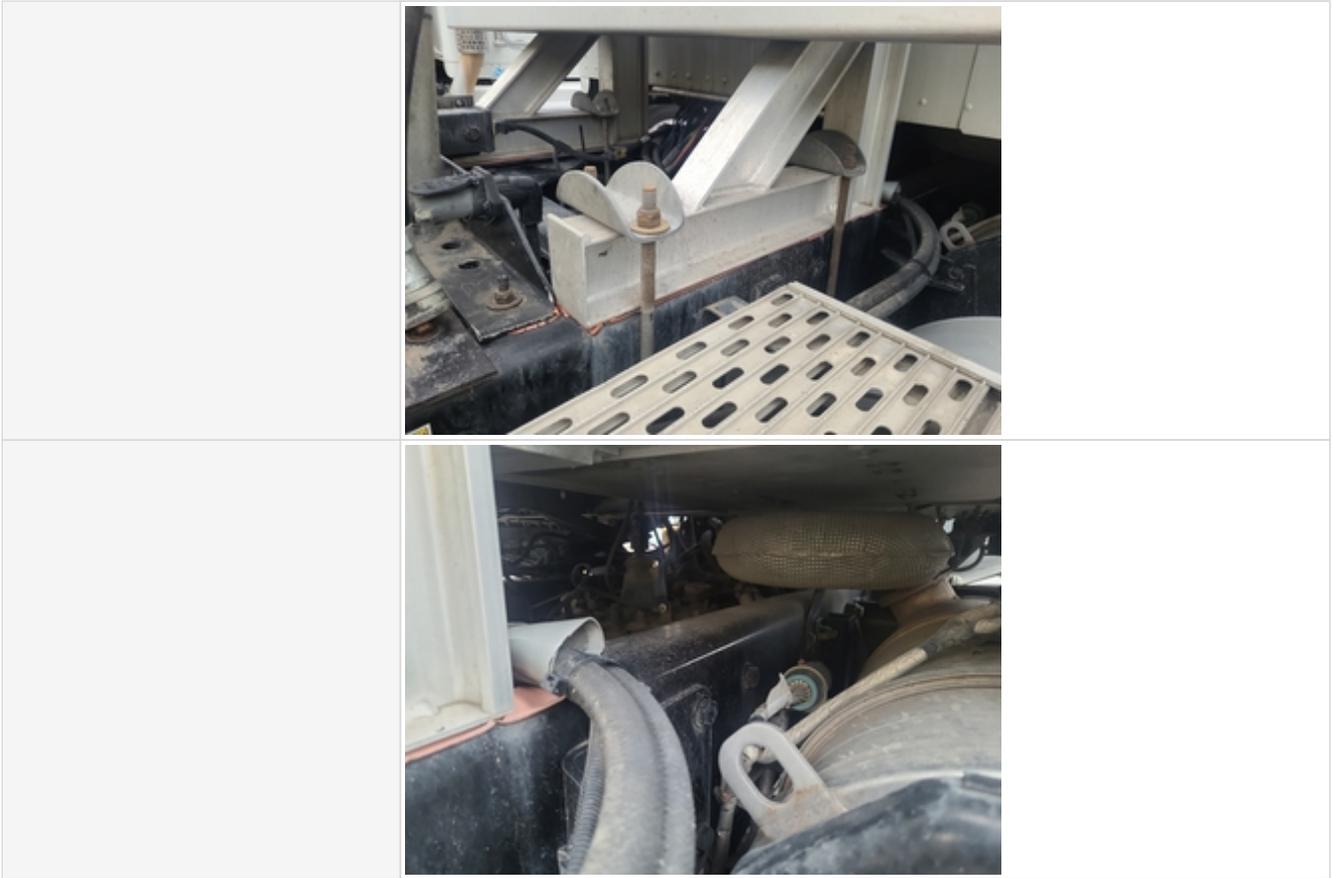

### Suspension

Suspension	3
Suspension Photos	


Inspection Report (On-Highway Truck Cab + Chassis)



Inspection Report (On-Highway Truck Cab + Chassis)




### Inspection Report (On-Highway Truck Cab + Chassis)

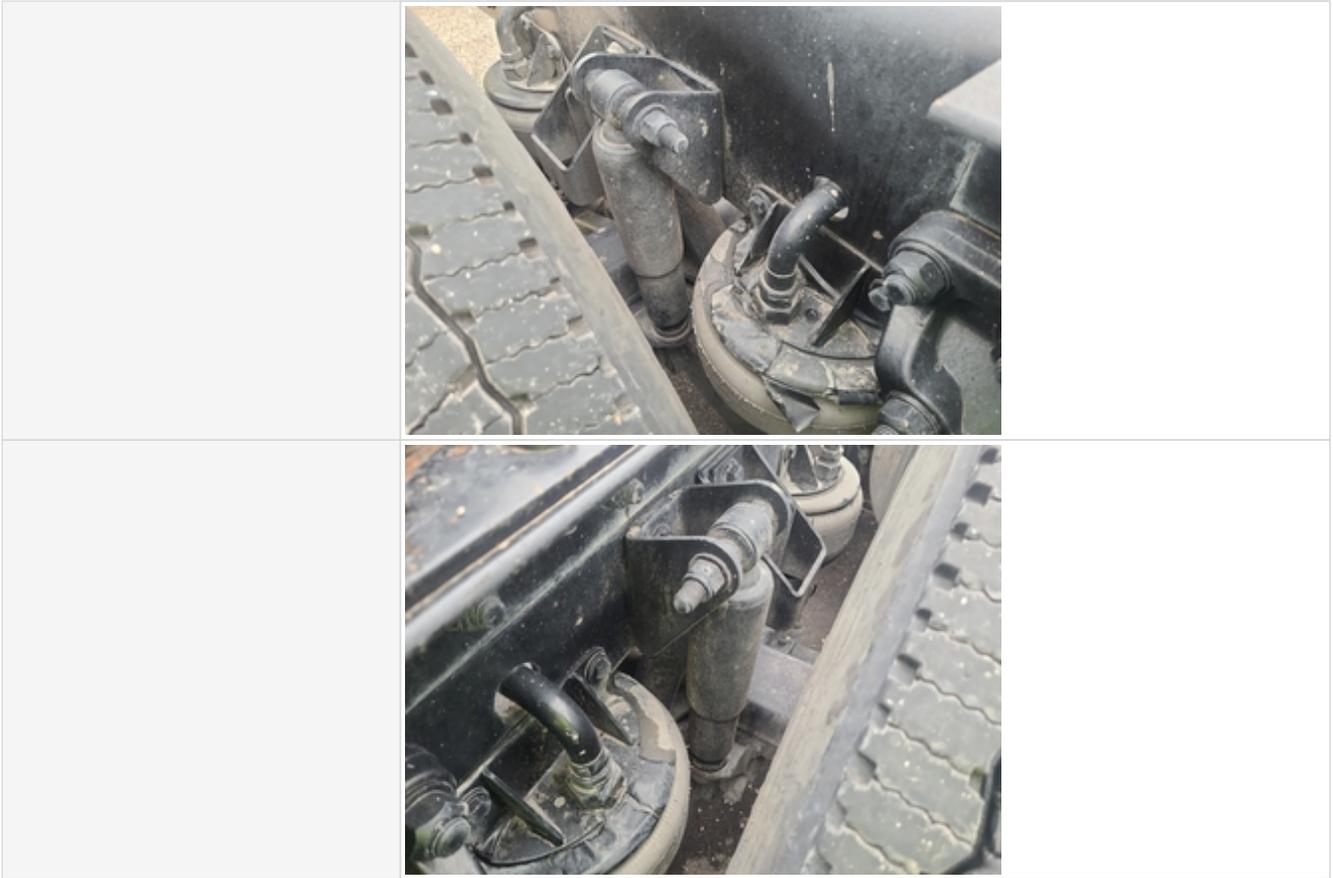

### Steering

Steering Components	3
Steering Components Photos	

**Inspection Report (On-Highway Truck Cab + Chassis)**

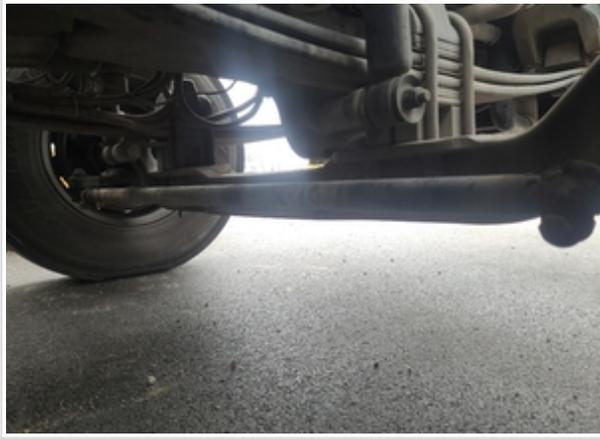		
		
		
Steer Axle Condition	3	

## Inspection Report (On-Highway Truck Cab + Chassis)

Steer Axle Photos	
-------------------	--

### Wheels & Tires

Wheels & Hub Condition	3
Wheel Seal Leaks	No
Tire Brand	Front - Michelin
Tire Size	11R22.5
Front Left Tire - Ratio Remaining	30%
Front Left Tire Photos	
Front Right Tire - Ratio Remaining	30%
Front Right Tire Photos	
Rear Right Tire - Ratio Remaining	50%


## Inspection Report (On-Highway Truck Cab + Chassis)

Rear Right Tire Photos	
Rear Left Tire - Ratio Remaining	30%
Rear Left Tire Photos	

## Brake Components

Brake Shoe Thickness	30%
Comments	most brakes above 70% of brake shoe material left
Brake Shoe Photos	

Inspection Report (On-Highway Truck Cab + Chassis)

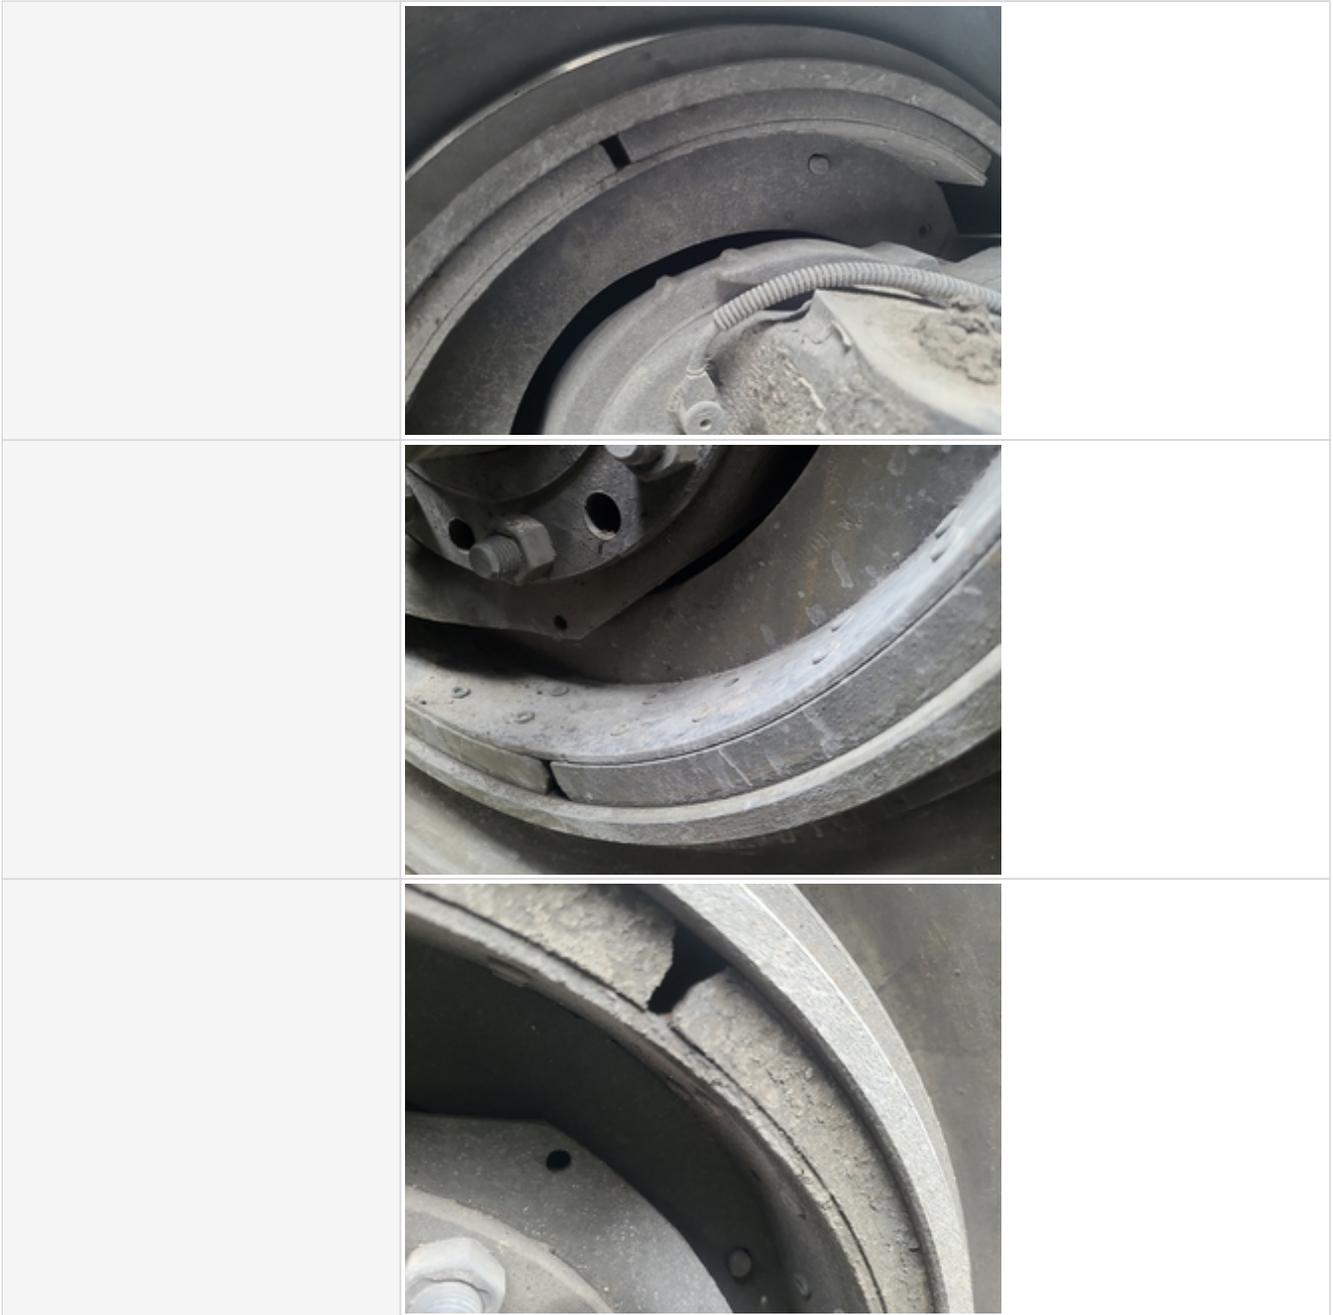

### Inspection Report (On-Highway Truck Cab + Chassis)



### Overall Chassis Condition

Overall Chassis	3
Overall Chassis Comments	Overall Chassis in Great condition
Overall Chassis & Undercarriage Photos	

## Inspection Report (On-Highway Truck Cab + Chassis)



<b>Additional Axles</b>	Check the condition of all other axles. Specify the position and type of axle. Note any damage or wear. Take photos.
-------------------------	--

### Functional Test

<b>Forward &amp; Reverse</b>	3 - Normal, Operating as Expected
<b>Steering</b>	3 - Normal, Operating as Expected
<b>Engine</b>	3 - Normal, Operating as Expected
<b>Controls</b>	3 - Normal, Operating as Expected
<b>Overall Functional Test Comments</b>	O wall all functions work well with no operating problems observed.
<b>Operating Video</b>	<a href="#">Click to Download</a>

### Inspection Summary

#### Overall Assessment

<b>Exterior Rating</b>	3 - Normal Wear & Tear
<b>Interior Rating</b>	3 - Normal Wear & Tear
<b>Safety Rating</b>	3 - Normal Wear & Tear
<b>Quality Rating</b>	3 - Normal Wear & Tear
<b>Functionality Rating</b>	3 - Normal, Operating as Expected
<b>Overall Rating</b>	3 - Normal Wear & Tear
<b>What's Great About the Machine</b>	Truck is in well maintained condition with no major leaks seen and no operating defects observed. Engine and transmission sound and work well
<b>What Needs Work</b>	Front windshield needs to be replaced. Driver side sear belts needs attention. Consistant air leak underneath cab needs to be repaired
<b>Date/Time</b>	12-20-2022