


Quick Start Guide




Foodpro Plus

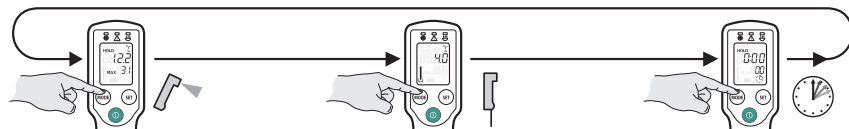

Scan IR Mode

Probe Mode


Time Mode

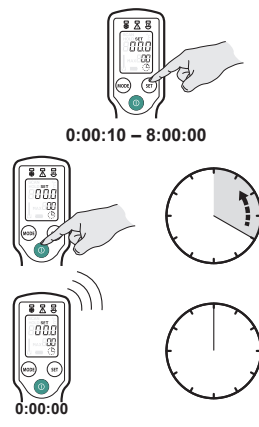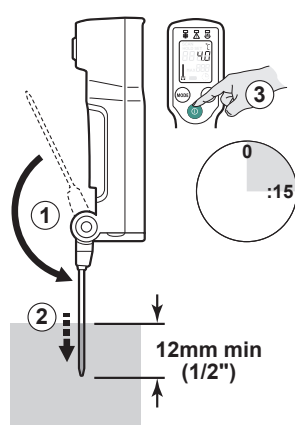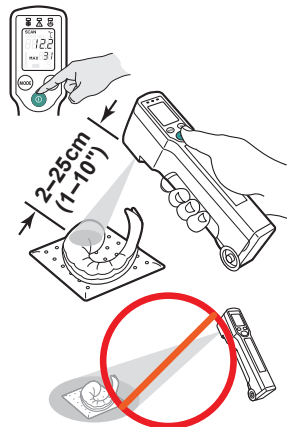


Service/Care

Battery Installation/ Setting °C/°F

Immediately change battery when Low Battery Light appears.

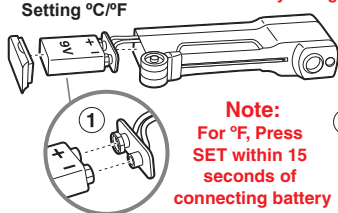


Note:
For °F, Press
SET within 15
seconds of
connecting battery

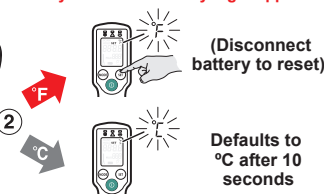


Defaults to
°C after 10
seconds

Probe Replacement

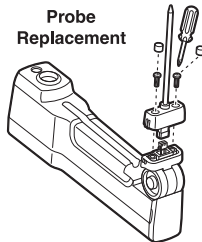

HACCP Check

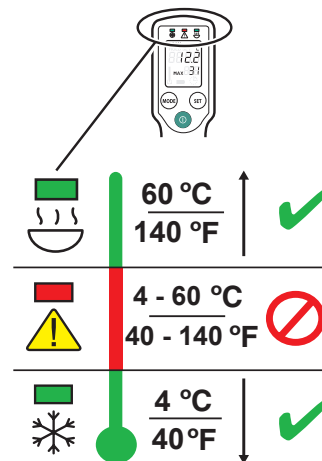

Temperatures



60 - 66 °C
(140 - 150 °F)



0 - 4 °C
(32 - 39 °F)






77 - 82 °C
(170 - 180 °F)



63 - 77 °C
(145 - 170 °F)

Applications

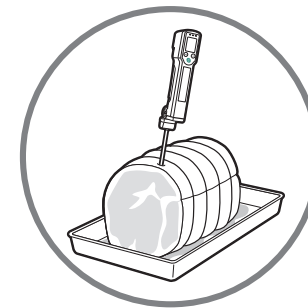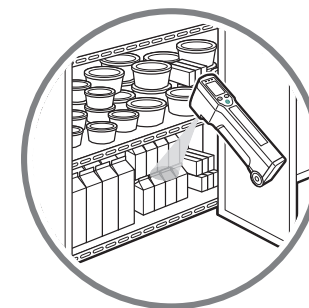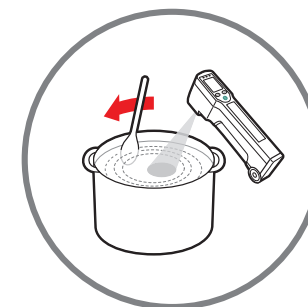

Cleaning

Clean IR Lens with Probe Wipe Daily.

