Operator Instruction Manual





EC 3000 Saybolt



Lovibond® Water Testing and Colour Measurement

Table of Contents

Environment:	
Introduction:	5
Keypad:	θ
Display Icons:	6
Power- USB:	6
Power- Battery:	6
Firmware and Version Number:	7
Settings	8
Instrument Diagnostics	8
Instrument Settings	g
Information	11
Power Saving Settings	11
Regional Settings	12
Date and Time	12
Projects:	13
New Projects	13
Set Tolerances	14
Averaging and Automatic Log (automatic saving)	15
Edit a Project	16
Delete a Project	16
Make a Project Default	17
Make a Project Current	18
View the Measurements	18
Delete a Measurement	18
Save a Measurement (manual saving)	19

Error Warnings:	20
Updating the firmware:	21
EC 3000 Kit Contents –Saybolt	23
EC 3000 Technical Data – Saybolt	24
Performing a Zero - Saybolt:	25
Performing a Test - Saybolt:	26
Performing a Liquid Instrument Validation using a Liquid Reference Standard - Saybolt	28
Performing an Instrument Validation using a Glass Refrence Standard – Saybolt	
Sales Offices	33

Environment:



This appliance is marked according to the European Directive 2002/95/EC on the waste of Electrical and Electronic Equipment (WEEE). By ensuring this product is disposed of correctly, you will help prevent potential negative consequences for the environment and human health, which could otherwise be caused by inappropriate waste handling of this product.



Introduction:

The Lovibond® EComparator Series provides an easy way to transition from subjective visual measurement to a non-subjective, accurate electronic measurement.

Colour graders who are used to the traditional comparator series sometimes find the upgrade or transition to an electronic system daunting. The assurance of relying on physical colour difference is diminished.

With the EComparator Series, users can view the colour in two different ways:

On-Screen Numerical Display

On-Screen Colour Display of sample and nearest colour scale standards

Touch screen technology allows the EComparator Series to show simple, specific and intuitive menus on screen. Users can set language, date and time, view preferences and create projects with individual tolerance settings. An on-screen warning system of:

Within Tolerance = Green;


Outside Tolerance = Red;

On Border of Tolerance = Amber

provides the user with immediate information on the sample.

The user friendly ergonomics and intuitive interface guarantee new users can be quickly trained and easily supported. Large data storage (> 20,000 readings), USB connectivity ensure readings can be stored and shared easily and quickly. Flexibility is further enhanced with software packages for Windows®, IOS® and Android $^{\text{TM}}$ with multiple language support on-screen.

Keypad:



Display Icons:

<u>lcon</u>	<u>Function</u>
O	Battery Low
	Powered by Battery
•=	Powered by USB
	SD Card OK
\wedge	Warning

Power-USB:

The USB port can be accessed by sliding the panel at the rear of the instrument.

Ensure the cable connector is inserted into the socket in the correct orientation. The symbol on the USB connector should be facing down.



The batteries can be replaced by removing the 4 x screws at the back of the instrument and removing the battery cover.



Top of Instrument






Firmware and Version Number:

The Firmware and Version Number will be displayed when the instrument is switched on.

(Please Note: "Scale Name" will be replaced by the Scale your EComparator measures).

Settings

1 - To enter the settings menu, press the settings icon at the bottom tool bar.








Instrument Diagnostics

- 2 For Instrument Diagnostics, press the Diagnostics Icon.
- 2a The instrument will perform diagnostics on the Memory, SD Card, LED and Light Sensor.



To view detailed information select Report.

Please contact you local service centre for help.


www.lovibondcolour.com/ServiceCenter







2c - The instrument will display the report. When finished, select Done.

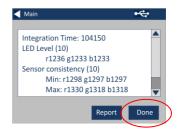

Instrument Settings

3 - For Instrument Settings, press the Instrument Icon


3a – To set the integration time, ensure the sample chamber is empty, and then press Set.

(This will set the optimum time for taking a measurement).


3b—The instrument will advise to check the Sample Chamber. Press OK when empty.

3c – The instrument will determine the integration time, a series of numbers will appear on the screen.



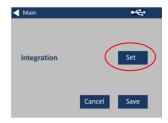



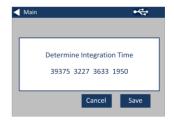

3d – Click OK when complete.



3e - To save the settings, press Save.



3f - To cancel the settings, press Cancel.



3g – To exit without saving, press Yes, or press No to continue.



Information

4a – The information screen will be displayed. Press the back arrow to return to the results screen.

(Please Note: "Scale Name" will be replaced by the Scale your EComparator measures).

Power Saving Settings

5 - For Power Saving Settings, press the Power Icon.

5a – Press the up and down arrows to adjust the time interval before the display goes to sleep in minute increments.

5b – Press the up and down arrows to set the time interbal before the instrument shuts down after being inactive.

To restart the instrument, press the power button.

5c - To save the settings, press Save, or to cancel the changes, press Cancel.

5d- If screen starts to dim, press anywhere on the screen to turn backlight on.











Regional Settings

6 - For Regional Settings, press the Regional Icon.

6a - Select the language that you would like the instrument to display.

The instrument will return to the settings screen.





Date and Time

7 - To set the Date and Time, press the Clock Icon.

The current time shown is the time the screen was opened, and does not continuously update.

7a – Use the up and down arrows to set the date and time.

7b - To save the settings, press Save, or to cancel the changes,

press Cancel.







Projects:


- 1 To enter the projects menu, press the Projects Icon on the bottom tool bar.
- 2 The projects screen will be displayed. The Project named at the top is the current project.
- 3 To view, or manage projects, click on View Projects.






New Projects

- 4 This will bring up a list of the current projects. To create a New Project, click on New.
- 5 To change the name, select the name box.

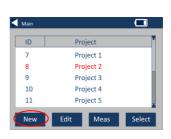



6 – Enter the new project name using the keypad, then select Return.



Set Tolerances

7 – The instrument will display the Project Settings Screen, to set the Tolerances, select Tolerance.


8 – To apply the tolerance limits, select the Tolerance checkbox.

9 – To change the tolerance values, use the appropriate up and down arrows. Select Done when complete.







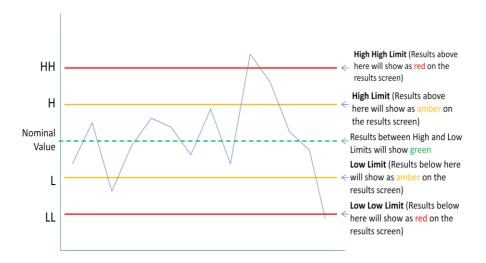


Averaging and Automatic Log (automatic saving)


10 – To change the Averaging and Automatic Log (automatic saving), select Measurements.


11 – To change the Averaging, use the up and down arrows

(This will set the number of measurements taken per test then take an average of those measurements).

12 – To set the automatic logging, select the Automatic Log checkbox. This will save every measurement that is taken. Select Done when complete.

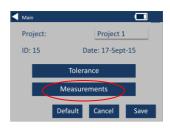

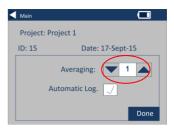

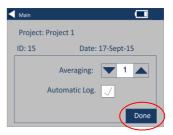

13 – To save all the settings, select Save.


NOTE: Until save is selected, neither Tolerance nor Measurements are saved.



Edit a Project

14 – To edit a project, go to the projects list. Highlight the project by clicking on it, and then select Fdit.

15 – This will bring you to the Project Settings Screen. To make changes follow steps 6-12.

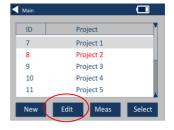




Delete a Project

16 – To delete the project, select Delete.



17 – The following prompt will appear. Select Yes to confirm.

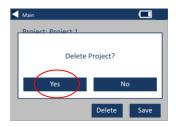


Make a Project Default


18 – To make a project Default, go to the projects list (this will highlight the project that is current when the instrument is switched on). Highlight the project and select Edit.

19 - Select Default.

20 – The following prompt will appear. Select Yes to confirm.

NOTE: The first project (ID 1) can not be deleted, but can be renamed.

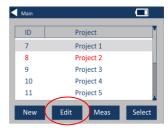


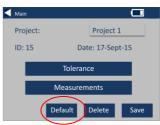



Make a Project Current


21 – To make a project current, go to the project list, highlight the project required then press Select. All readings will be saved into the current project.

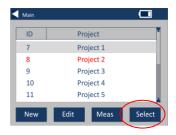


View the Measurements

22 – To view the measurements of a project, go to the projects list, highlight the project required then press Meas.


23 – This will bring up a list of the measurements stored for this project. If the tolerance limits are switched on (step 7), the results will be displayed as in the tolerance column (see page 15)

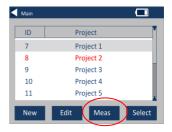

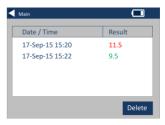


Delete a Measurement

24 – To delete a measurement, highlight the measurement then select Delete.

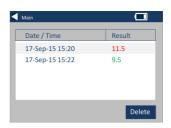

25 – The following prompt will appear. Select Yes to confirm.

26 – To view the measurements from the main project screen for the current project (named at the top of the screen), select View Measurements.

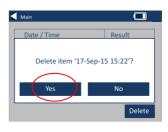



Save a Measurement (manual saving)

27 – If automatic saving is not enabled, you can **save** every measurement taken by selecting Projects.

28 – On the main projects screen, select Save Measurement. This will save to the current project.





Error Warnings:

Warning	Description
Error 1	SD Card Error
Error 2	Light Level Too High
Error 3	Light Level Too Low
Error 4	Sensor Error
Error 5	File System Error
Error 6	Communication Error
Error 7	Keypad Error
Error 10	Non Volatile Memory Error

Please contact you local Service Centre for help:

www.lovibondcolour.com/ServiceCentre

Updating the firmware:

The latest version of the EC 2000 and EC 3000 firmware can be obtained from the internet, www.lovibondcolour.com

1 - Ensure that the EComparator Instrument is connected to a Computer running a Microsoft® Operating System (XP,7,8).



NOTE: This update cannot be performed on an Apple Mac or Linux® system

2 - Switch off the instrument.



3 – Press and hold down the test key on the keypad whilst switching on the EComparator Series instrument.






4 - A drive named "EC UPDATE" will appear on your PC.




5 - Open the drive "EC_UPDATE" the contents of the drive will show a file named "firmware.bin\"/.

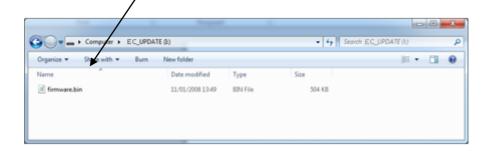


6 - Delete the file "firmware.bin"

7 - Now copy the Update File onto this drive.

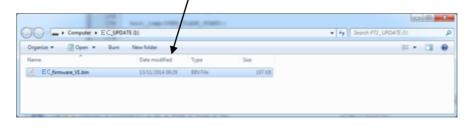

8 - Switch OFF the Instrument and then switch back it ON. The instrument will restart with the updated firmware.



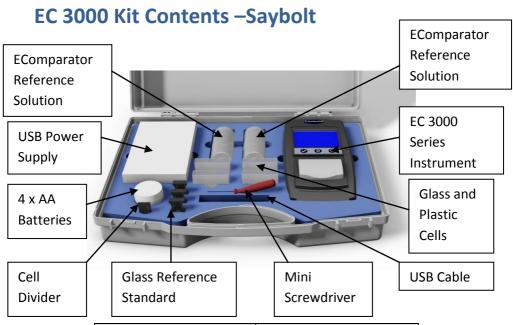

Item	Included
Instrument Type	EC 3000
Power Supply	•
USB Cable	•
Screwdriver	•
Pot of 4x AA Batteries	•
Liquid Reference Standard 1	•
Liquid Reference Standard 2	•
Glass Cell	• 2x W100 OG 50 mm
Plastic Cell	• 2x W100 50 mm
Glass Reference Standard 1	•
Glass Reference Standard 2	•
Clear Glass Standard	•

Available in the kit

EC 3000 Technical Data - Saybolt.

The Saybolt Colour scale is used for grading light coloured petroleum products including aviation fuels, kerosine, naphthas, white mineral oils, hydrocarbon solvents and petroleum waxes.

The colour range of the Saybolt-scale is similar to that of the Platinum-Cobalt/Hazen/APHA Colour (ASTM D 1209) scale and is therefore employed for the measurement of water-clear, colourless to slightly yellowish products.

The faintest coloration is Saybolt-colour number +30, the strongest evaluable Saybolt coloration value is -16

Guaranteed Agreement with International Standards; for many product types, a characteristic set of standards was agreed and adopted to aid colour control and the communication of colour specifications worldwide; the result is a selection of colour grading scales that have been adopted as international industry standards.

The EComparators are fully equivalent to the appropriate Visual International Standards and fully compliant with Automatic International Standards detailed below:

EC 3000 Saybolt (ASTM D156, D6045) because in the scope of ASTM: D6045 it states "This test method correlates to Test Method D 156 and Test Method D 1500 as calculated by the instrumentation".

Parameter	Details
Colour Scales	Saybolt
Range	-16 to +30
Resolution	1
Repeatability	±1

Performing a Zero - Saybolt:

1 – After initiation, the instrument will display:

2 – Ensure the sample chamber is empty.

- 3 Close the sample lid and press the zero key on the keypad or the display.
- 4 While performing a zero, the instrument will display:

5 - When complete, the instrument will display:











Performing a Test - Saybolt:

Note: Ensure that the sample being measured is free from turbidity; if necessary, filter the sample through a 0.45 micron filter paper.

1 – Fill a clean Cell 2/3 full with the sample.



2 - Place the cell in the sample chamber of the EComparator, push to the left hand side.

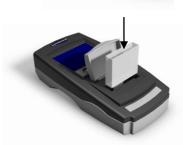

- 3 Close the sample lid and press the test key on the keypad or the display.
- 4 While performing a test, the instrument will display:



5 – If averaging is set the instrument will measure again and display:





6 - The instrument will display the result as:

- 7 Press the back arrow on the display to change between numeric and comparator mode.
- 8 Press the up and down arrows to view the stages / steps as they would be on the visual disc.







Performing a Liquid Instrument Validation using a Liquid Reference Standard - Saybolt


The EC 3000 Saybolt is supplied with two bottles of Validation Liquid.

These liquids are used to validate that the instrument is measuring within the specified tolerances.

- 1 –Select a bottle of validation liquid and ensure that the selected validation liquid is within its expiry date.
- 2 Ensure the sample chamber is empty.

- 3 Close the sample lid and press the Zero key.
- 4 While performing a zero, the instrument will display:











5 – Fill the supplied cell 2/3 with the reference solution.



- 7 Close the sample lid and press the test key on the keypad or the display.
- 8 While performing a test, the instrument will display:

9 - The instrument will display the result.

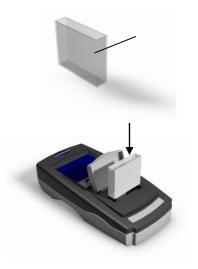







10 - Compare the result from the instrument to the value on the label of the validation liquid, to check it is within the specified tolerances.

EC 2000 Validation Liquid

Saybolt 14 +/-1


Part No: 135033

Batch No: 3142212 Expiry: 18 Feb 2016

Lovibond® Reference Standard

Performing an Instrument Validation using a Glass Refrence Standard – Saybolt


1 – Place the Clear GlassVerification Standard in the sample chamber on the right hand side.



4 - While performing a zero, the instrument will display:

5 - When the zero operation has been completed, remove the Clear Glass Verification Standard from the instrument.

6 – Place the selected standard in the sample chamber on the right hand side.

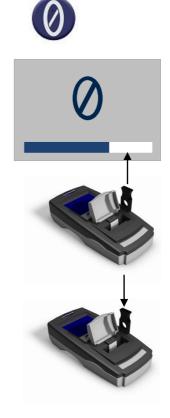

- 4- Press the test key on the keypad
- 4– The result will be displayed on the screen. Compare these results to those on the label of the standard
- 5- Press the back arrow on the display to change between numeric and comparator mode







Sales Offices

Germany

Tintometer GmbH Lovibond® Water Testing Schleefstraße 8-12 44287 Dortmund Germany

Tel: +49 (0)231/94510-0 Fax: +49 (0)231/94510-20 Email: sales@tintometer.de

North America

Tintometer Inc 6456 Parkland Drive Sarasota Florida 34243 USA

Tel: +1 941 758 8671 Fax: +1 941 727 9654

Email: sales@tintometer.us

Switzerland

Tintometer AG Hauptstraße 2 5212 Hausen AG Switzerland

Tel: +41 (0)56/4422829 Fax: +41 (0)56/4424121 Email: info@tintometer.ch

<u>India</u>

Tintometer India Pvt. Ltd. B-91, A.P.I.E. Sanath Nagar, Hyderabad 500018 India

Tel: +91 (0) 40 4647 9911 Toll Free: 1 800 102 3891

Email: indiaoffice@tintometer.com

United Kingdom

The Tintometer Ltd Lovibond House Solar Way Solstice Park Amesbury SP4 7SZ

Tel: +44(0)1980 664800 Fax: +44(0) 1980 625412 Email: sales@tintometer.com

South East Asia

Tintometer South East Asia Unit B-3-12-BBT One Boulevard, Lebuh Baku Nilam 2, Bandar Bukit Tinggi, Klang, 41200, Selangor D.E MALAYSIA.

Tel: +60 (0) 3 3325 2285/6 Fax: +60 (0) 3 3325 2287

Email: lovibond.asia@tintometer.com

<u>China</u>

Tintometer China Room 1001, China Life Tower, 16 Chaoyangmenwai Avenue Beijing 100020

China

Tel: +89 10 85251111 ext.330

Fax: +86 10 85251001

Email: chinaoffice@tintometer.com

www.lovibond.com

Lovibond and Tintometer are registered trademarks of The Tintometer Ltd. Amesbury, UK. All translations and transliterations of Lovibond and Tintometer are asserted as trademarks of The Tintometer Group.

The Bluetooth® mark, figure mark and combination mark are trademarks owned by the Bluetooth SIG and any use by the Tintometer® Group is under license. IOS® is a registered trademark of Cisco, Inc. and licensed to Apple, Inc. Android™ is a trademark of Google Inc. Windows® is a registered trademark of Microsoft. Apple® is a registered trademark of Apple Inc. Linux® is the registered trademark of Linus Torvalds in the U.S. and other countries.