



Component Checklist

Check you have received all parts against the component checklist and Hardware.

Tools Required:

Phillips Head Screw Driver

Hardware:

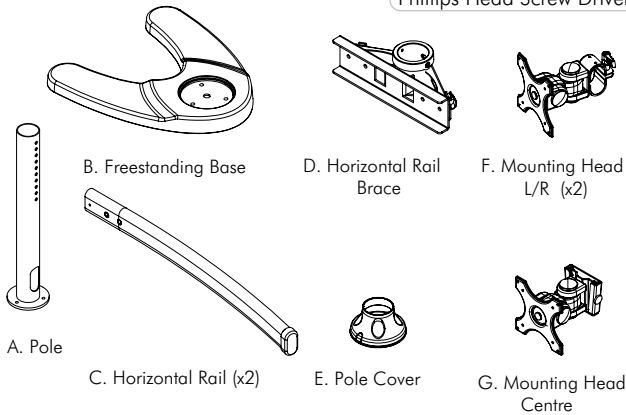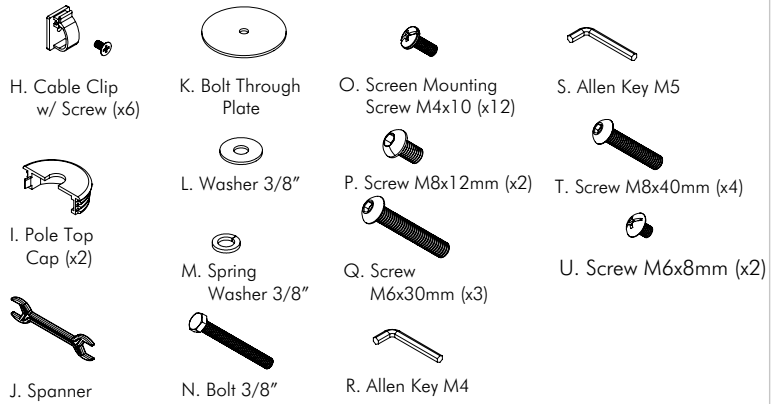


IMPORTANT INFORMATION:

! IMPORTANT - Install Spacedec Free Standing Triple as per Installation Instructions.


- ! This product supports a maximum load of 8kg (17.5lbs) in each screen.
- ! This product supports VESA mounting hole configurations: 75x75mm and 100x100mm.
- ! This product is designed to support three screens of similar weight & size when configured to use the freestanding base.
- ! Using less than three screens may result in the stand becoming unbalanced & unstable.
- ! The manufacturer accepts no responsibility for incorrect installation.

Step 1. Install the Pole to the desk.

Option 1: Bolt Through

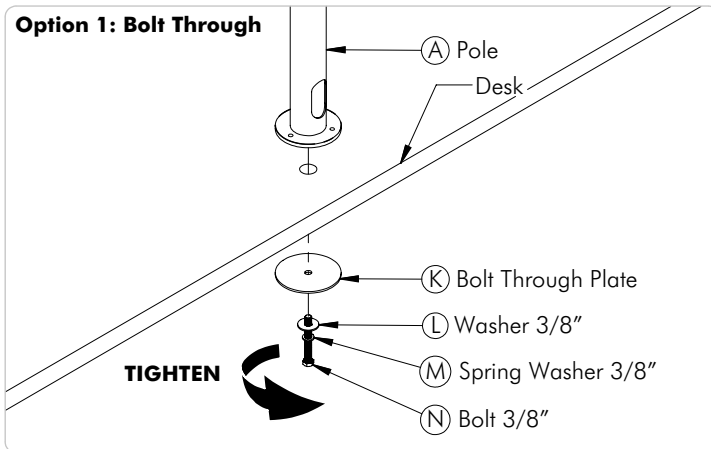


Option 2: Freestanding (with optional security bolt)

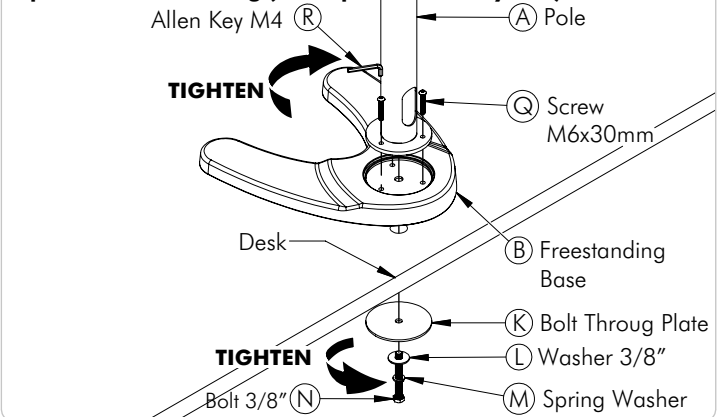


Step 2. Assemble Horizontal Support Rail.



- G. Mounting Head - Centre
1. Loosen Thumb Screw.
2. Detach Bracket to mount into Horizontal Rail.

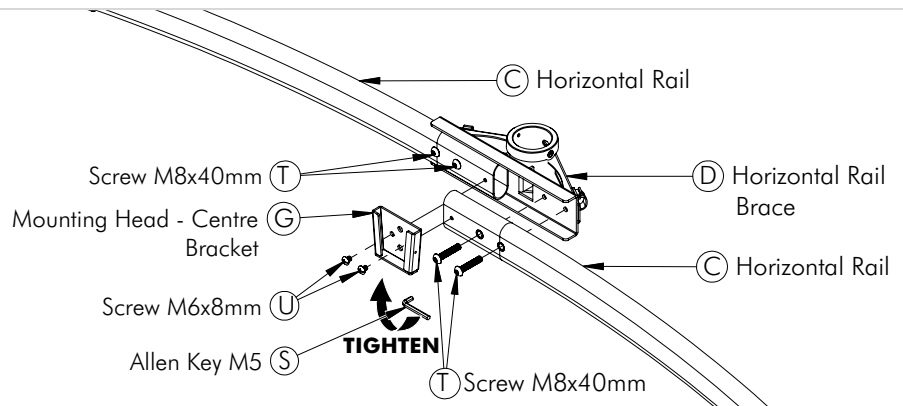


Step 3. Install Horizontal Rail to the Pole.

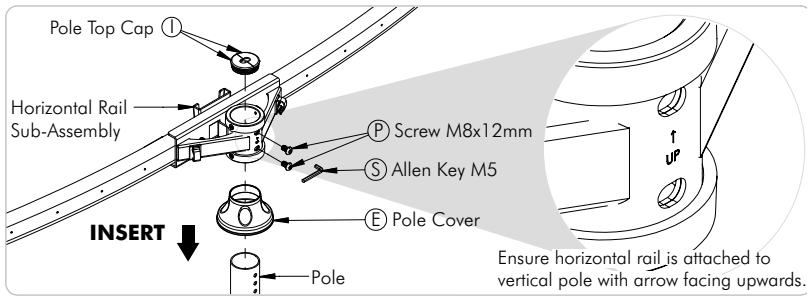


Step 4. Adjust Horizontal Rail Position.


Select the desired height of your rail to suit your screen size by inserting the screws in the various holes in the pole.

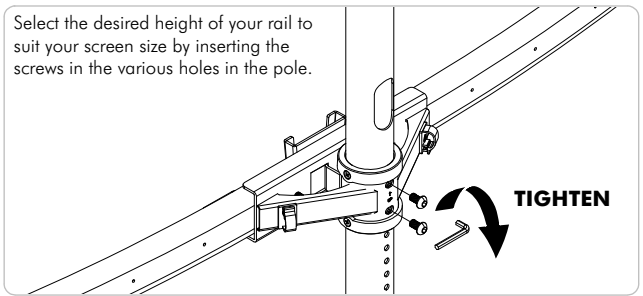

Step 4. Fasten Display to Mounting Heads.

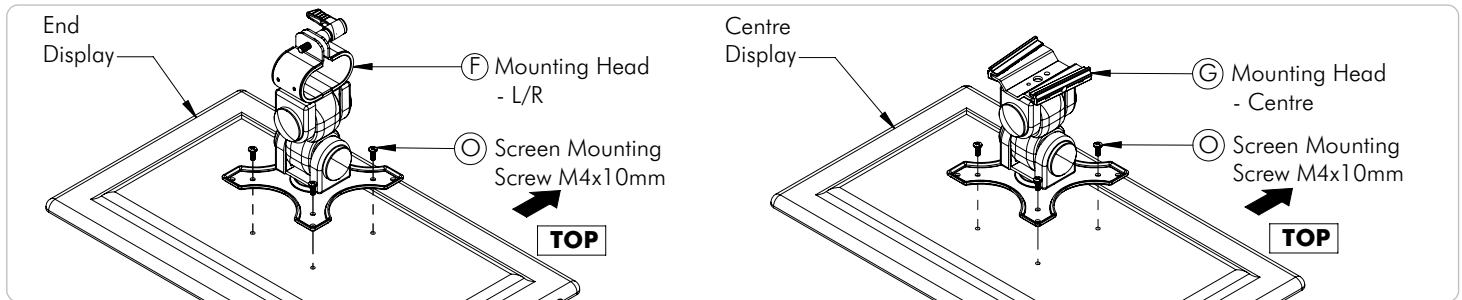


Step 6. Attach Display to Horizontal Rail.

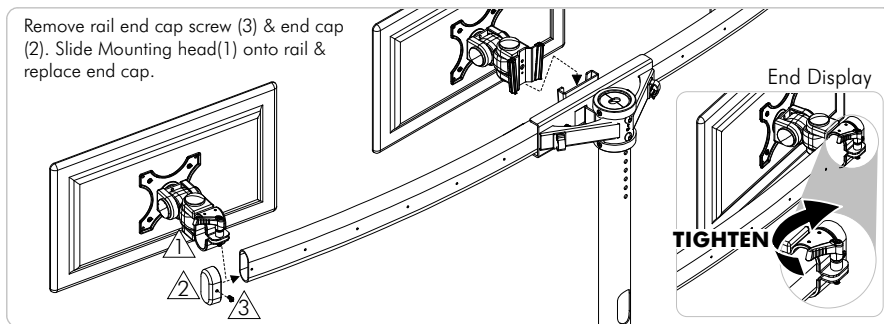


Step 7. Adjust Display Tilt Tension.

To adjust the tension of the tilt mechanism, first remove the cover cap to expose the tilt nut then using the spanner supplied, tension the nut until the display holds the desired position. Replace cover cap.

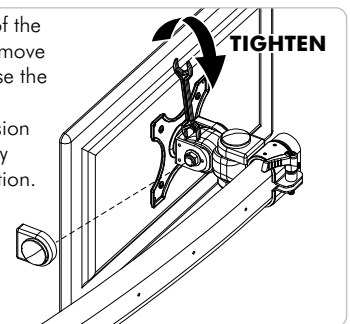

Step 8. Cable Management

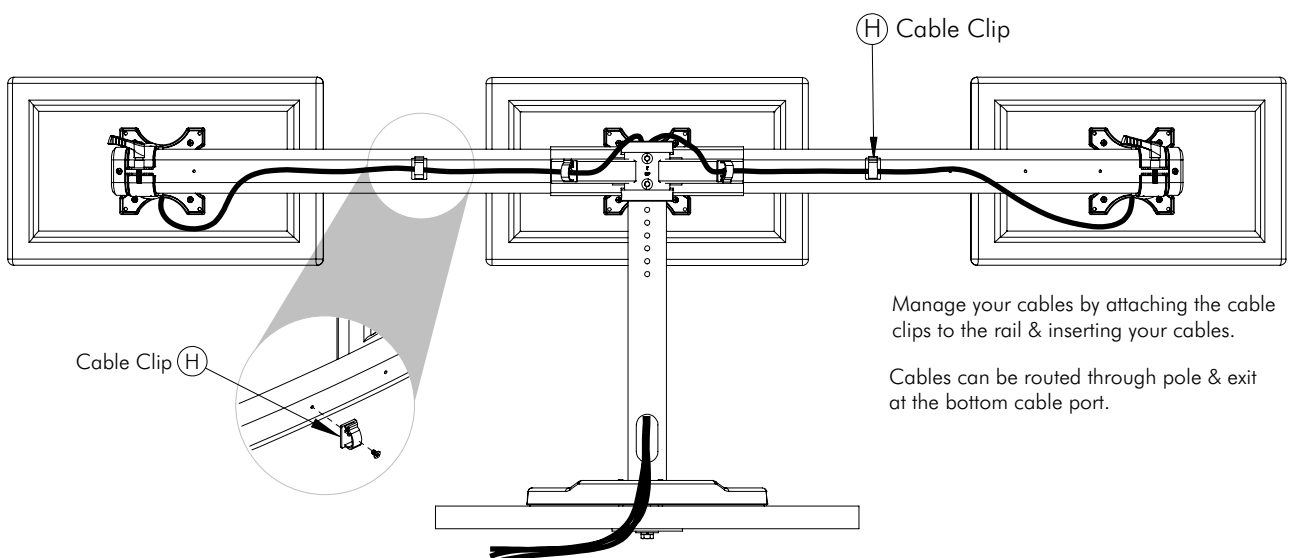

Installation Complete

