




# SPD910

## Installation



Differential pressure, vacuum, overpressure switch  
 Differens-, vakuüm-, övertryckströmställare  
 Differenz-, Vakuüm-, Überdruckwächter  
 Manostat pour pression différentielle, depression et surpression  
 Interruptor de diferencia, vacío, hiperpresión  
 Interruttore differenziale per vuoto e sovrappresione

Instruction  
 Montageanvisning  
 Bedienungsanleitung  
 Instructions d'installation  
 Instrucciones de empleo  
 Istruzioni per installazioni

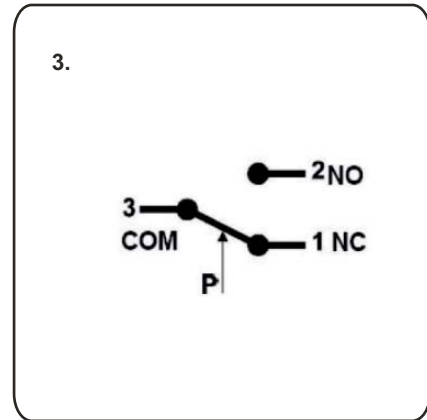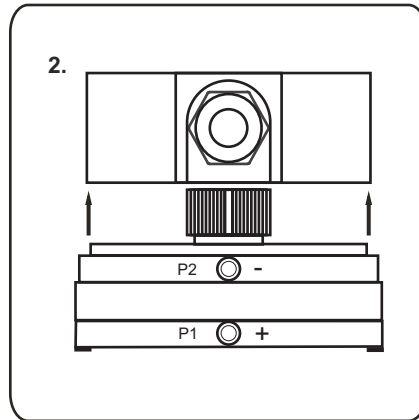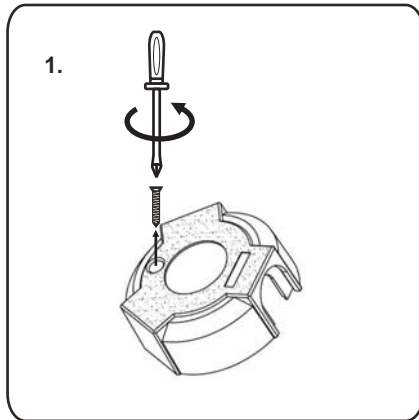

4.

Adjusting of upper / lower switching point  
 Inställning av övre / undre tröskelvärde  
 Einstellen der oberen / unteren Schaltpunkte  
 Reglage du point de commutation supérieur / inférieur  
 Ajustar de los puntos de conmutacion alto / bajo  
 Regolazione del punto d'interruzione superiore / inferiore

5.

Recommended installation vertical (factory calibration)  
 Rekommenderad placering är vertikala (fabrikskalibrering!)  
 Empfohlene Einbaulage vertikal (Werkeichung)  
 Position de montage conseillée: verticale (etalonnage en usine)  
 Modo de instalacion sugerido: vertical (calibracion de fabrica)  
 Posizione di montaggio raccomandata: verticale (taratura di fabbrica)

Horizontal installation, electrical connections upward, switching points 15 Pa higher  
 Placering horisontal, elanslutning uppåt, brytpunkten blir 15 Pa högre  
 Einbaulage horizontal, elektrische Anschlüsse nach oben, Schaltpunkte 15 Pa höher  
 Position de montage horizontale, raccords électriques vers le haut, sont plus élevés de 15 Pa  
 Modo de instalacion: horizontal, conexiones electrical arriba, son 15 Pa mas altos  
 Posizione di montaggio orizzontale, collgamenti elettrici verso l'alto, sonno di 15 Pa piu alti

Horizontal installation, electrical connections downward, switching points 15 Pa lower  
 Placering horisontal, elanslutning nedåt, brytpunkten blir 15 Pa lägre  
 Einbaulage horizontal, elektrische Anschlüsse nach unten, Schaltpunkte 15 Pa tiefer  
 Position de montage horizontale, raccords électriques vers le bas, sont 15 Pa inférieurs  
 Modo de instalacion: horizontal, conexiones electrical abajo, son 15 Pa mas bajos  
 Posizione di montaggio orizzontale, collgamenti elettrici verso il basso, sonno di 15 Pa plu bassi

6.

Drilling template  
 Borrmall  
 Bohrschablone  
 Gabarit de perçage  
 Plantilla para

Note With the safety cover removed, contact with terminals 1, 2 and 3 poses a lethal C hazard (mains power voltage)!

Varning Efter att skyddsskapan har avlägsnats består livsfara vid berörande av klämmorna 1, 2 och 3 (nätspänning)!

Achtung Nach Entfernen der Schutzhaube (A) besteht Lebensgefahr beim Berühren der Klemmen 1, 2 und 3 (Netzspannung)!

Attention Apres avoir enlevé le capot de protection, il y a danger de mort a toucher le bornes 1, 2 et 3 (tension de secteur)!

Atencion Peligro mortal despues de quitar la capota protectora (A) si se tocan los bornes 1, 2, y 3 (tension de red)

Attenzione Dopo aver asportato la calotta di protezione sussiste pericolodi morte al contatto con i morsetti 1, 2 e 3 (tensione di rete)!

# SPD910

## Installation



Differential pressure, vacuum, overpressure switch  
 Differens-, vakuum-, övertryckströmställare  
 Differenz-, Vakuum-, Überdruckwächter  
 Manostat pour pression différentielle, depression et surpression  
 Interruptor de diferencia, vacío, hiperpresión  
 Interruttore differenziale per vuoto e sovrappresione

Instruction  
 Montageanvisning  
 Bedienungsanleitung  
 Instructions d'installation  
 Instrucciones de empleo  
 Istruzioni per installazioni



部件名称 Part Name	有害物 - Hazardous Substances					
	(Pb)	汞 (Hg)	(Cd)	六价 (Cr (VI))	多溴 苯 (PBB)	多溴二苯醚 (PBDE)
金属部件 Metal parts	X	O	O	O	O	O
塑料部件 Plastic parts	O	O	O	O	O	O
子件 Electronic	O	O	O	O	O	O
触点 Contacts	O	O	O	O	O	O
和 附件 Cables & cabling accessories	O	O	O	O	O	O

本表格依据SJ/T11364的 定 制。

O: 表示 有害物 在 部件所有均 材料中的含量均在GB/T 26572 定的限量要求以下。

X: 表示 有害物 至少在 部件的某一均 材料中的含量超出GB/T 26572 定的限量要求。

(企 可在此处, 根据实 情况对上表中打的技术原因 行 一步 明。)



This table is made according to SJ/T 11364.

O: indicates that the concentration of hazardous substance in all of the homogeneous materials for this part is below the limit as stipulated in GB/T 26572.

X: indicates that concentration of hazardous substance in at least one of the homogeneous materials used for this part is above the limit as stipulated in GB/T 26572