




TECHNICAL DATA SHEET

PRODUCT INFORMATION

DuPont™ Tyvek® IsoClean® Boot Cover. Bound Seams. Gripper™ Sole. Covered Elastic Opening. Ties at Ankles. 18" High. White.

ATTRIBUTES

Full Part Number	IC458BWHxx0100yy (xx=size) ?
Fabric/Materials	Tyvek® IsoClean®
Design	Boot Covers
Seam	Bound
Color	White
Quantity/Box	100 per case
Sizes	MD, LG, XL
Option Codes	OC

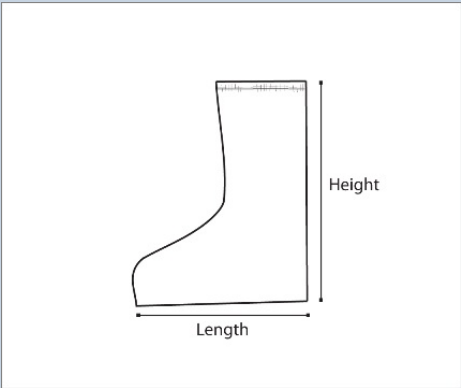

SIZE TABLE

SIZE	BOOT LENGTH	BOOT HEIGHT	MENS SHOE	WOMENS SHOE
MD	11 1/2	18	7	9
LG	14 1/4	18	14	16
XL	16	18	19	21

PHYSICAL PROPERTIES

PROPERTY	TEST METHOD	TYPICAL RESULT	STDDEV
Basis Weight	ASTM D3776	1.33 oz/yd ²	0.06 oz/yd ²
Burst Strength - Mullen	ASTM D774	56 psi	10 psi
Breaking Strength - Grab (MD)	ASTM D5034	17 lb _f	3 lb _f
Breaking Strength - Grab (CD)	ASTM D5034	21 lb _f	3 lb _f
Particle Shedding (Helmke Drum)	TEST-RP-CC003.4	Category I	
Bacterial Filtration Efficiency (3.0 micron)	ASTM F2101	98.1%	1.8%
Hydrostatic Head	AATCC 127	77 cm H ₂ O	10 cm H ₂ O
Wearing Apparel Flammability	16 CFR 1610	Class 1	

WARNING

As of January 2023, all DuPont Personal Protection products are manufactured under specifications that exclude components containing natural rubber latex. Tyvek® 500, Tyvek® 600 and Tyvek® 800 styles made before January 2023 contain natural rubber latex, which may cause allergic reactions in some sensitized individuals. Anyone who begins to exhibit an allergic response during the use of DuPont products should immediately cease using these products and should report it to DuPont at +1 (888) 439-2988 so that an investigation can be initiated.


CLEANROOM WARNINGS

Warning: Cleanroom apparel should not be used around heat, flames, sparks or in potentially flammable or explosive environments. Cleanroom fabrics should have slip-resistant materials on the outer sole of boots, shoe covers, or other garment surfaces in conditions where slipping could occur. Silicone Statement: All DuPont Personal Protection products are manufactured under specifications that do not contain silicone, with some exceptions. Tyvek® friction-coated shoe covers or Tyvek® garments with friction-coated shoe covers might contain silicone. This includes styles TY122, TY121, FC450 and FC454. Tychem® 6000 AL styles TF630 and TF640T contain a silicone valve diaphragm. End users who are consuming these styles and who have concerns about silicone contamination should conduct their own testing to ensure they are suitable for their application(s). Latex statement: As of January 2023, all DuPont Personal Protection products are manufactured under specifications that exclude components containing natural rubber latex. Tyvek® 500, Tyvek® 600 and Tyvek® 800 styles made before January 2023 contain natural rubber latex, which may cause allergic reactions in some sensitized individuals. Anyone who begins to exhibit an allergic response during the use of DuPont products should immediately cease using these products and should report it to DuPont at +1 (888) 439-2988 so that an investigation can be initiated. As of January 2023, Tyvek® 500, Tyvek® 600 and Tyvek® 800 are manufactured under specifications that exclude components containing natural rubber latex.

Anyone who begins to exhibit allergic response during the use of DuPont products should immediately cease using these products. The incident should also be reported to DuPont at 1.800.441.3637.

DuPont™ SafeSPEC™ - We're here to help

Our powerful web-based tool can assist you with finding the appropriate DuPont garments for chemical and controlled environment hazards.

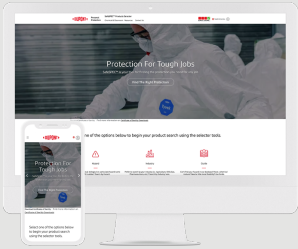

DUPONT

DuPont - SafeSPEC

DuPont Personal Protection

SafeSPEC™

in

DuPont Personal Protection

▶

DuPont Personal Protection

CREATED ON: JANUARY 23, 2026