

VIN: Z45250525069

2005 GENIE Z-45-25 / 0

Specifications	
Year	2005
Make	GENIE
Model	Z-45/25
Date of Inspection	04/03/2024
Location of Inspection	1800 Harrison Ave , Kearny, NJ, 07032, USA
Serial Number	Z45250525069
Engine Hours	571
EMS Warning Lights	Active Warnings
Travel Control	No Damages Observed
Operator's Seat	N/A
Mirrors	N/A
Radio	N/A
A/C	N/A
Steering Wheel	N/A
Pedals	No Damages Observed
Floorboard	No Damages Observed
Power Mirrors	N/A
Heated Mirrors	N/A
Switches and Controls	No Damages Observed
Steps	N/A
Handrails	N/A
Oil Dipstick	Low Level / Good Color
Engine Compartment	See Notes
Exhaust Pipe	See Notes
Axles	No Damages Observed
Backup Camera	N/A
ROPS	N/A
Front Lights	No Damages Observed
Rear Lights	No Damages Observed
Front Right Tire Condition	No Damages Observed
Front Right Tire Brand	Outrigger
Front Right Tire Size	355/55D625
Rear Right Tire Condition	See Notes
Rear Right Tire Brand	Outrigger
Rear Right Tire Size	355/55D625
Front Left Tire Condition	See Notes
Front Left Tire Brand	Outrigger
Front Left Tire Size	355/55D625
Rear Left Tire Condition	No Damages Observed
Rear Left Tire Brand	Outrigger
Rear Left Tire Size	355/55D625

Equipment Photo



Video Inspection Link

https://app.aspenfieldservices.com/jobs/video/M2F5jeCAGfMeDM75n

Notes / Description

The hours appear to be low for the age of the unit. The lower sheet metal on the basket is paint is worn off and metal is rusted and bent. The rails on the basket have paint missing and metal is rusty. The fire extinguisher is missing from the basket. The EMS panel is showing there is a red light warning and the unit either has a check engine warning or an engine oil pressure problem. The engine coolant is low in the reservoir. The engine oil filter is rusty. The exhaust pipe tip is rusty. The plastic fuel tank appears to have a hole rubber into it on the side. The engine oil appears to be above the full mark on the dipstick. The hydraulic hose fittings are rusty to going to the body lift cylinder. The hydraulic hose appears to have cracks in it by the front left steering cylinder. The rear right tire has gouges in the sidewall by the lip of the wheel and the front left tire has a small gouge in the rubber by the lip of the wheel. There is green fluid under the unit at the time of inspection it possibly appears to look like coolant. The travel alarms did not operate in the



Front Left / 04-03-2024



Front / 04-03-2024



Front Right / 04-03-2024



Rear Right / 04-03-2024




Rear / 04-03-2024



Rear Left / 04-03-2024



Serial Number: Z45250525069 / 04-03-2024

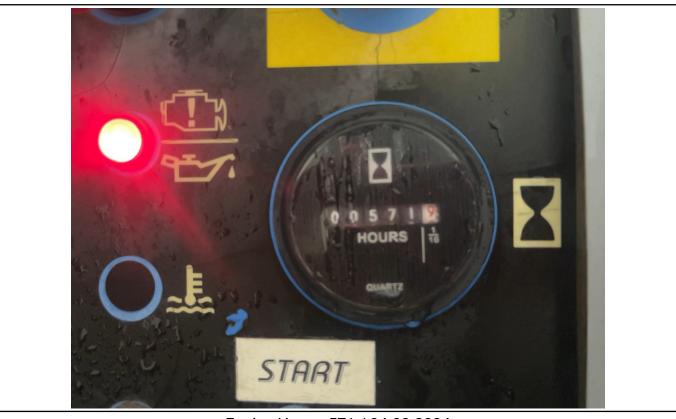

Engine Hours: 571 / 04-03-2024



EMS Warning Lights / 04-03-2024



Switches and Controls / Travel Control / 04-03-2024




Pedals / 04-03-2024




Floorboard / 04-03-2024



Engine Compartment / Coolant Level / 04-03-2024

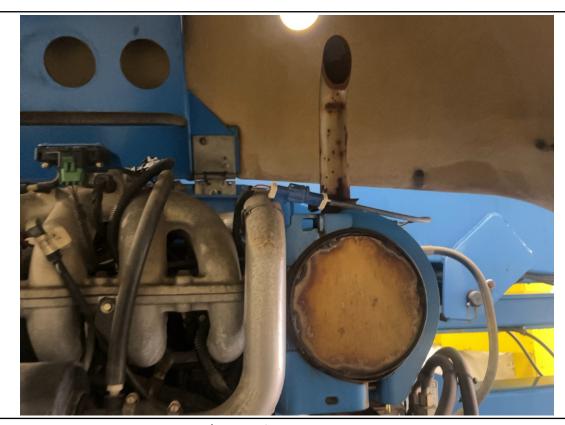

Exhaust Pipe / 04-03-2024

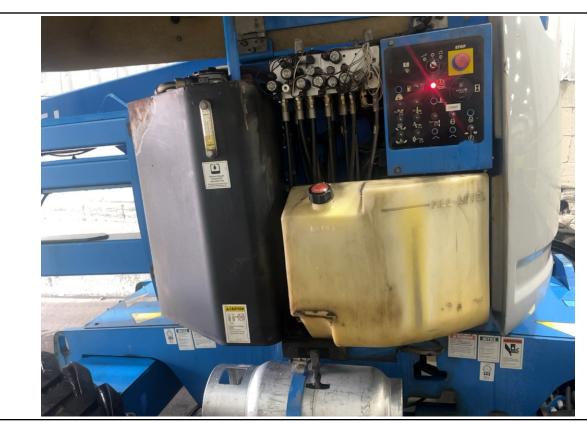


Engine Compartment / 04-03-2024



Oil Dipstick / 04-03-2024



Oil Dipstick / 04-03-2024

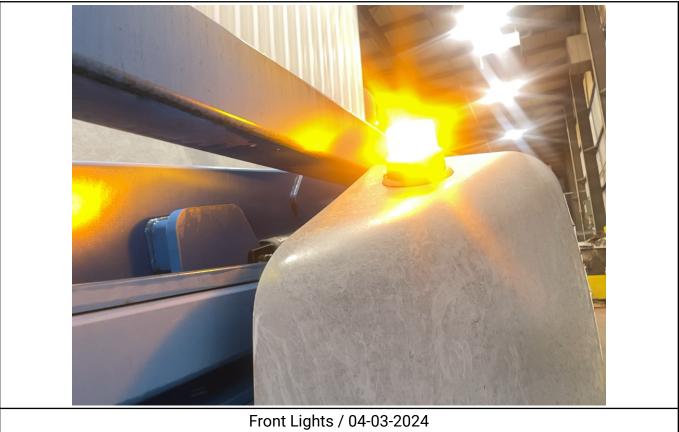



Rear Lights / 04-03-2024



Axles / 04-03-2024



Axles / 04-03-2024



Axles / 04-03-2024



Axles / 04-03-2024



Axles / 04-03-2024



Axles / 04-03-2024



Front Right Tire Condition / 04-03-2024



Front Right Tire Brand / 04-03-2024



Front Right Tire Size / 04-03-2024



Rear Right Tire Condition / 04-03-2024



Rear Right Tire Brand / 04-03-2024



Rear Right Tire Size / 04-03-2024



Front Left Tire Condition / 04-03-2024



Front Left Tire Brand / 04-03-2024



Front Left Tire Size / 04-03-2024



Rear Left Tire Condition / 04-03-2024



Rear Left Tire Brand / 04-03-2024



Rear Left Tire Size / 04-03-2024