


ROLLNLOCK REQUEST FOR INSPECTION

Climbing Technology has voluntarily issued a request for inspection of the ROLLNLOCK pulley/rope clamp (Ref. No. 2D652) by the user.

One of our customers has detected a defect in the functioning of the "sheave position lever" (F). This defect can lead to an accidental locking of the sheave position lever on its pin (H) on the plate.

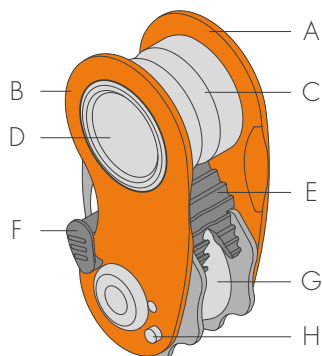


As a result of this defect, when using the device in "hauling pulley" mode, the lever may inadvertently engage the pin suddenly disabling the locking function and releasing the load or person.

The products affected by this defect are those with the following batch numbers: 0120; 0220; 0320; 0121; 0221.

Attention:

- if the device has the check mark on the marking shown in the figure, you DON'T need to carry out any inspection;
- if the device does not have the check mark on the marking shown in the figure, you MUST carry out the inspection as indicated.

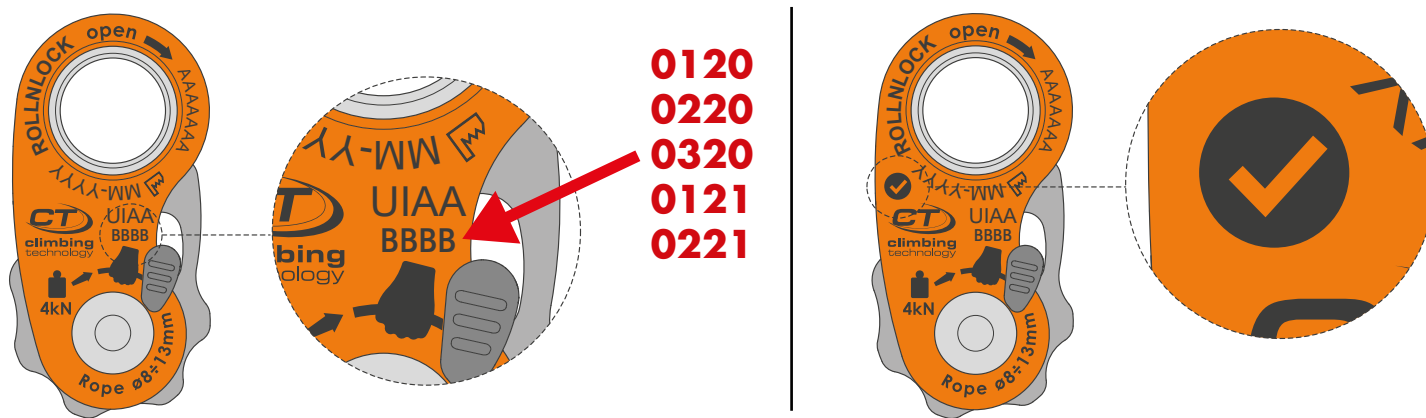

To date, no accidents or injuries are known.

We ask you to carry out the inspection procedure indicated below. If the product in your possession is affected by this problem, please contact us to arrange shipment at our expense:

- e-mail: commerciale@aludesign.it / vendite@aludesign.it
- phone: +39 035 783595 – ext. 4 from Italy – ext. 5 from abroad

Please clearly indicate both on the package and inside it, your details (name and surname, address, e-mail, phone number). We need this information for the delivery of the replacement product.

Climbing Technology ensures the safety and quality of all its products. Your safety is our highest priority.


We apologize for any inconvenience caused. The replacement product will be shipped to you as soon as possible.

ROLLNLOCK REQUEST FOR INSPECTION

INSPECTION PROCEDURE



Place the device on a stable surface near an edge as shown.

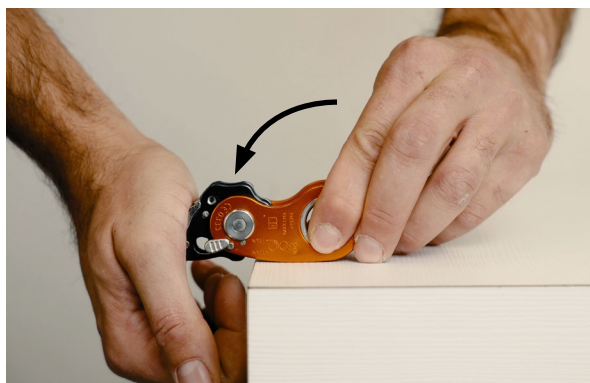

Use one hand to hold the device by the connection hole. With the other hand, rotate the cam outward and press down firmly with the palm. Finally, release the cam.



If the cam returns to its original position, it means that the product is not defective and can be used freely.



If the cam goes over the pin on the plate and remains stuck in that position, it means that the product is defective: it can no longer be used under any circumstances and it must be returned to the company.



For a better understanding of the procedure please have a look at the dedicated video:
https://youtu.be/9_REFm9DdxM