
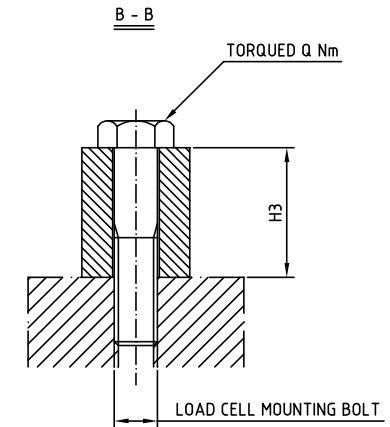
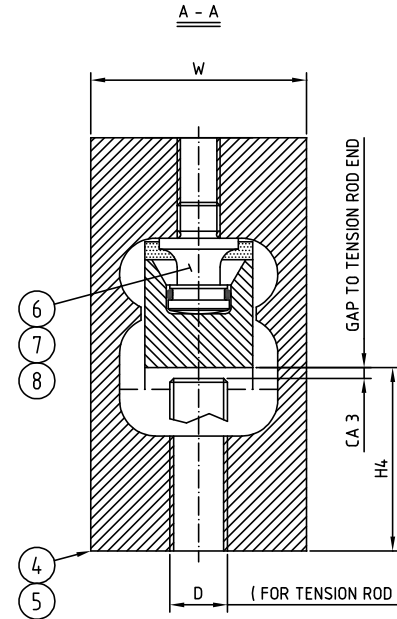



TENSION ADAPTER FOR SB4 / SB5 / SB14 / SLB

Rev	Date	Sign/Appr	Description
1	030528	N.A	Minor corrections

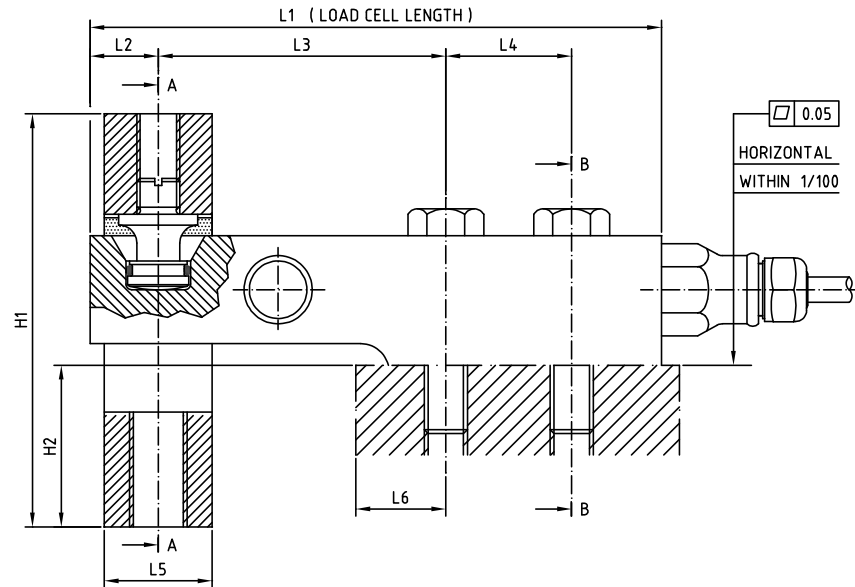

TENSION ADAPTER FOR SB6-0.2 / 0.5 / 1 / 2 kN

PARTS LIST, ZINC PLATED: 4-7041-A
PARTS LIST, STAINLESS: 4-7041-B

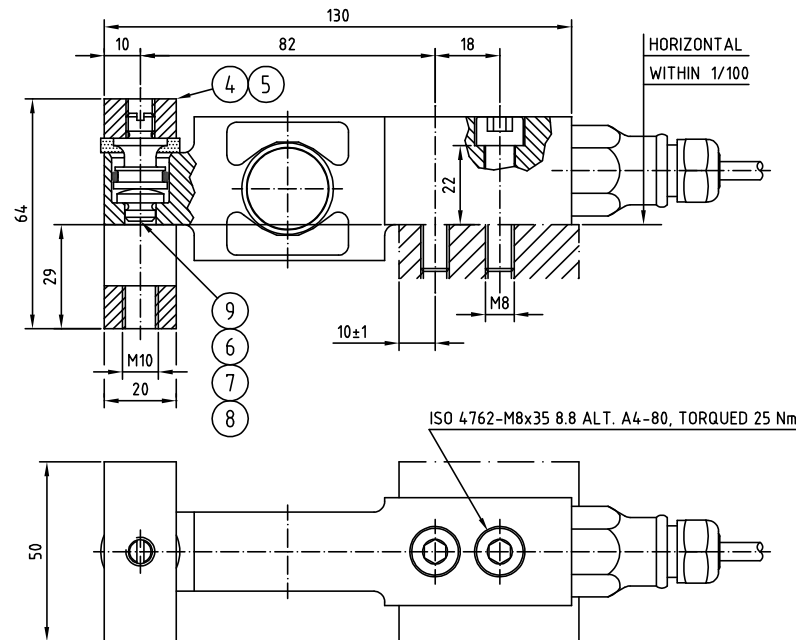

USE QUALITY 10.9 ALT. A4-100 FOR LOAD CELL SB14/SLB-5klb.
FOR OTHER LOAD CELLS USE QUALITY 8.8 ALT. A4-80.

PARTS LIST ZINC PLATED	PARTS LIST STAINLESS	FOR LOAD CELL TYPE	L1	L2	L3	L4	L5	L6	H1	H2	H3	H4	D	W	MOUNTING BOLT ISO 4014	Q
4-7042-A	4-7042-B	SB4/SB5-5/10/20 kN	155	15	80	35	30	min 20	115	45	36	51	M16	60	M12x55	90
		SB14-0.5/1 klb	133.4	12.7	76.2	25.4	30	20±1	115	50	31	51.5	M16	60	M12x50	90
		SLB-0.2/0.5/1/2.5 klb	136.4	12.7	76.2	25.4	30	17.3±1	115	50.9	30.1	50.9	M16	60	M12x50	90
		SB14-2.5/5klb	133.4	12.7	76.2	25.4	30	20±1	115	50	31	50.5	M16	60	M12x50	120
4-7043-A	4-7043-B	SLB-5klb	136.4	12.7	76.2	25.4	30	17.3±1	115	50.9	30.1	50.9	M16	60	M12x50	120
		SB4/SB5-50 kN	190	21	105	40	40	min 35	165	70	49	78	M24	80	M20x80	400
		SB14-10klb	178.3	19.1	95.3	38.1	40	min 35	165	75.5	43.6	81	M24	80	M20x70	400
4-7044-A	4-7044-B	SB4-100 kN	245	30	135	50	50	min 50	230	95	73	107.5	M30	100	M24x110	700

NOTE: SAFE LOAD LIMIT = 200% / ULTIMATE LOAD = 300%

Qty	Group	Item	Description	Material/Drq No	Remarks
D	C	B	A	N.A	N.A
			00-01-26-		
TENSION ADAPTER TYPE 52-31 FOR LOAD CELL TYPE SB4/SB5/SB6/SB14/SLB ASSEMBLY / OUTLINE DRAWING					Tolerances, un- less otherwise specified, acc. to ISO 2768 medium. Hole tol. acc. to ISO 101. H12.
2-7045					Rev. No. 1