


PHASE DETECTOR 3129-10 & 3129

Field Measuring Instruments






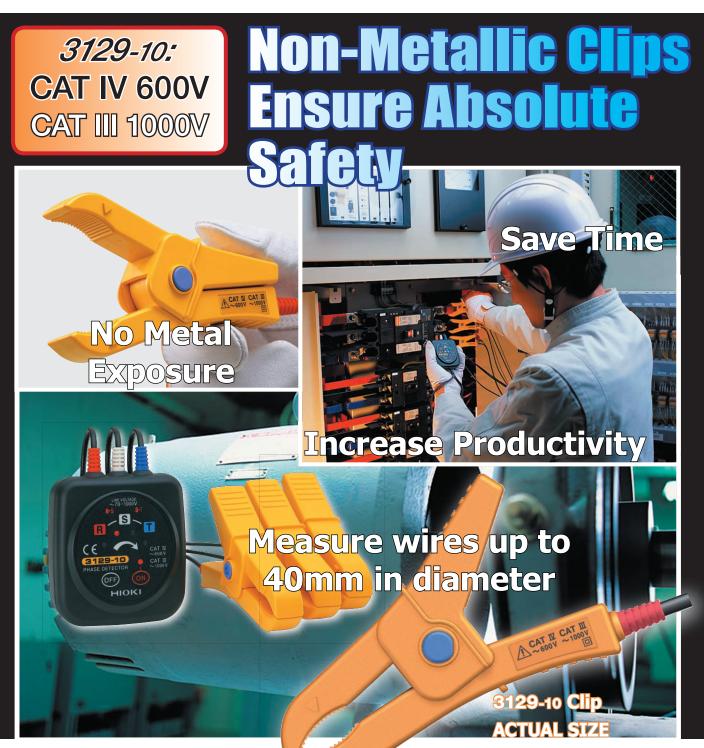









The Best Features - Only from HIOKI

Safest in Its Class

CAT IV 600V CAT III 1000V



3129-10: CAT IV 600V/CAT III 1000V Anticipated Transient Overvoltage of 8000V

3129: CAT III 600V Anticipated Transient Overvoltage of

Extra-large Clips

Wide AC70V to 1000V



Clamp thick conductors from 10mm to 40mm


Conveniently caters to virtually all wiring environments

Quick and Easy Testing with

Clear Audio and



Based on the electrostatic induction theory, the 3129 series Phase Detectors can safely and accurately detect phase rotation in three-phase circuits. Correct rotation is indicated by a crystal clear beeping tune, while bright red LEDs show rotation direction.



Thick wires can be clamped easily between the ▼ marks for proper detection.



Proper electrical testing requires that all three phases be clamped.

■ Specifications

•	3129-10 for Thick Conductors	3129 for Thin Conductors
Functions	Phase detection (positive and negative)	
Voltage Detection Method	Electrostatic induction method	
Clamp Diameter (insulated wiring)	10 to 40mm	2.4 to 17mm
Voltage Range	3-phase 70 to 1000V AC (continuous sine wave)	3-phase 70 to 600V AC (continuous sine wave)
Frequency Range	45Hz to 66Hz	
Safety	CATIII 1000V, CAT IV 600V (Anticipated Transient Overvoltage of 8000V)	CAT III 600V (Anticipated Transient Overvoltage of 6000V)
Phase Indication	Positive: 4 LEDs lit in clockwise order and 3 short beeps Negative: 4 LEDs lit in counterclockwise order and one continuous beep	
Battery Check Function	Ready: ON lamp lights / Battery low: ON lamp blinks	
Power Supply	Two "AA" (R6P) size batteries; rated voltage: 3.0V DC; maximum rated power: 300mVA; continuous use: approx. 70 hours (standby)	
Dimensions	70W x 75H x 30D mm (2.76"W x 2.95"H x 1.18"D); Cord length: 0.7m (25.76")	
Mass (incl. batteries)	240g (8.5 oz)	200g (7.1 oz)
Usage Environment	Indoors, altitude up to 2000m Operating temperature: 0 to 40°C (32 to 104°F), max. 80% rh (no condensation) Storage Temperature: -20 to 60°C (-4 to 140°F), max. 80% rh (no condensation)	
Accessories	Carrying case, wrist strap, R6P batteries x 2, spiral tube	



DISTRIBUTED BY