

Keysight Technologies

Troubleshooting Three-Phase AC Motors with U1210 Series Handheld Clamp Meters

Application Note



Introduction

In today's world, the three-phase AC induction motors are widely used in commercial and industrial applications ranging from grain dryers to saw mills, conveyor belt systems, refrigeration, and air conditioning due to its simplicity, rugged construction, and relatively low manufacturing costs. The use of electric motors has increased productivity significantly and lowered operational costs. However, unexpected electric motor failure could result in lost capacity as well as excessive repair and unnecessary maintenance costs.

As the motor-control systems become more complex, troubleshooting has become more difficult without the use of proper test tools. In this application note, you will discover the common causes of a three-phase AC motor failure and how to diagnose them with the Keysight Technologies, Inc. U1210 Series Handheld Clamp Meters, thereby preventing costly replacement.



Common Causes of Motor Failure

Motor failure can be caused by various electrical or mechanical conditions. Based on motor manufacturers' analysis, about 44% of motor failure problems are related to heat resulting from overloads and single phasing. The overheating problem reduces motor winding insulation life by half for every 10 °C increase in winding temperature. In other words, operating a motor at 10 °C above its maximum temperature rating will reduce its expected life expectancy by 50%.

Motor Overload Caused by Voltage Unbalance

Motor failure is a common result of voltage unbalance. Voltage unbalance occurs when the line voltages on a three-phase supply are unequal. With 1% of voltage unbalance, it can actually cause 6 to 10% current unbalance. Therefore, the motor will draw more current than it is rated for. If this condition is allowed to continue, the motor will be damaged because additional slippage causes additional heating that the motor overload protector cannot predict.

However, a current unbalance does not necessarily mean that a voltage unbalance exists. For example, there may be a loose terminal connection on one leg of the motor or there may be a buildup of carbon or dirt on one set of contacts of the contactor. The current will flow to the path of least resistance and cause the current to increase in the other leg of the motor.

Common Causes of Voltage Unbalance

- Unbalanced incoming utility power supply
- Open phase on the primary three-phase transformer on the distribution system
- A blown fuse on a three-phase bank of power-factor improvement capacitors
- Open delta-connected transformer banks
- Unequal impedances of the three-phase transmission and distribution lines
- Unbalanced distribution of single-phase loads such as lighting

Symptoms of Motor Voltage Unbalance

Symptoms of motor problems related to either voltage unbalance or to voltages not matching the nameplate rating are not always easy to diagnose. System load variation and variations in other system characteristics can significantly affect both utility and facility distribution voltages. Here are a few symptoms that may trigger voltage-unbalance investigation:

- Nuisance tripping of a motor-protective device.
- High numbers of motor failures
- Difficult getting a specific motor started

How to Identify Unbalance Power Source to Three Phase AC Motor

When testing for voltage unbalance, the phase-to-phase voltages should be measured rather than the phase-to-neutral voltages. If an unbalance is found, then the following test can help determine whether the source of the problem is the motor itself or the power supply to the motor.

Steps for Performing Test

1. Record the current flowing through each motor lead as shown in Figure 1.
2. Rotate all three input power lines by one position as shown in the diagram below.
3. Measure and record the current in each lead in the new setup.
4. Rotate all three input power lines by one more position.
5. Measure and record the current in each lead in the new setup.
6. Determine the average current and the maximum deviation from the average current in each rotation configuration.
7. Compare the three combinations with maximum current deviation.
8. If the combination always contains the same motor lead, this indicates a problem with the motor. If the combination always contains the same power line, then the power supply may be at fault.
9. Figure 1 indicates that the incoming power is the source of unbalance because the maximum current deviation follows the input power line.



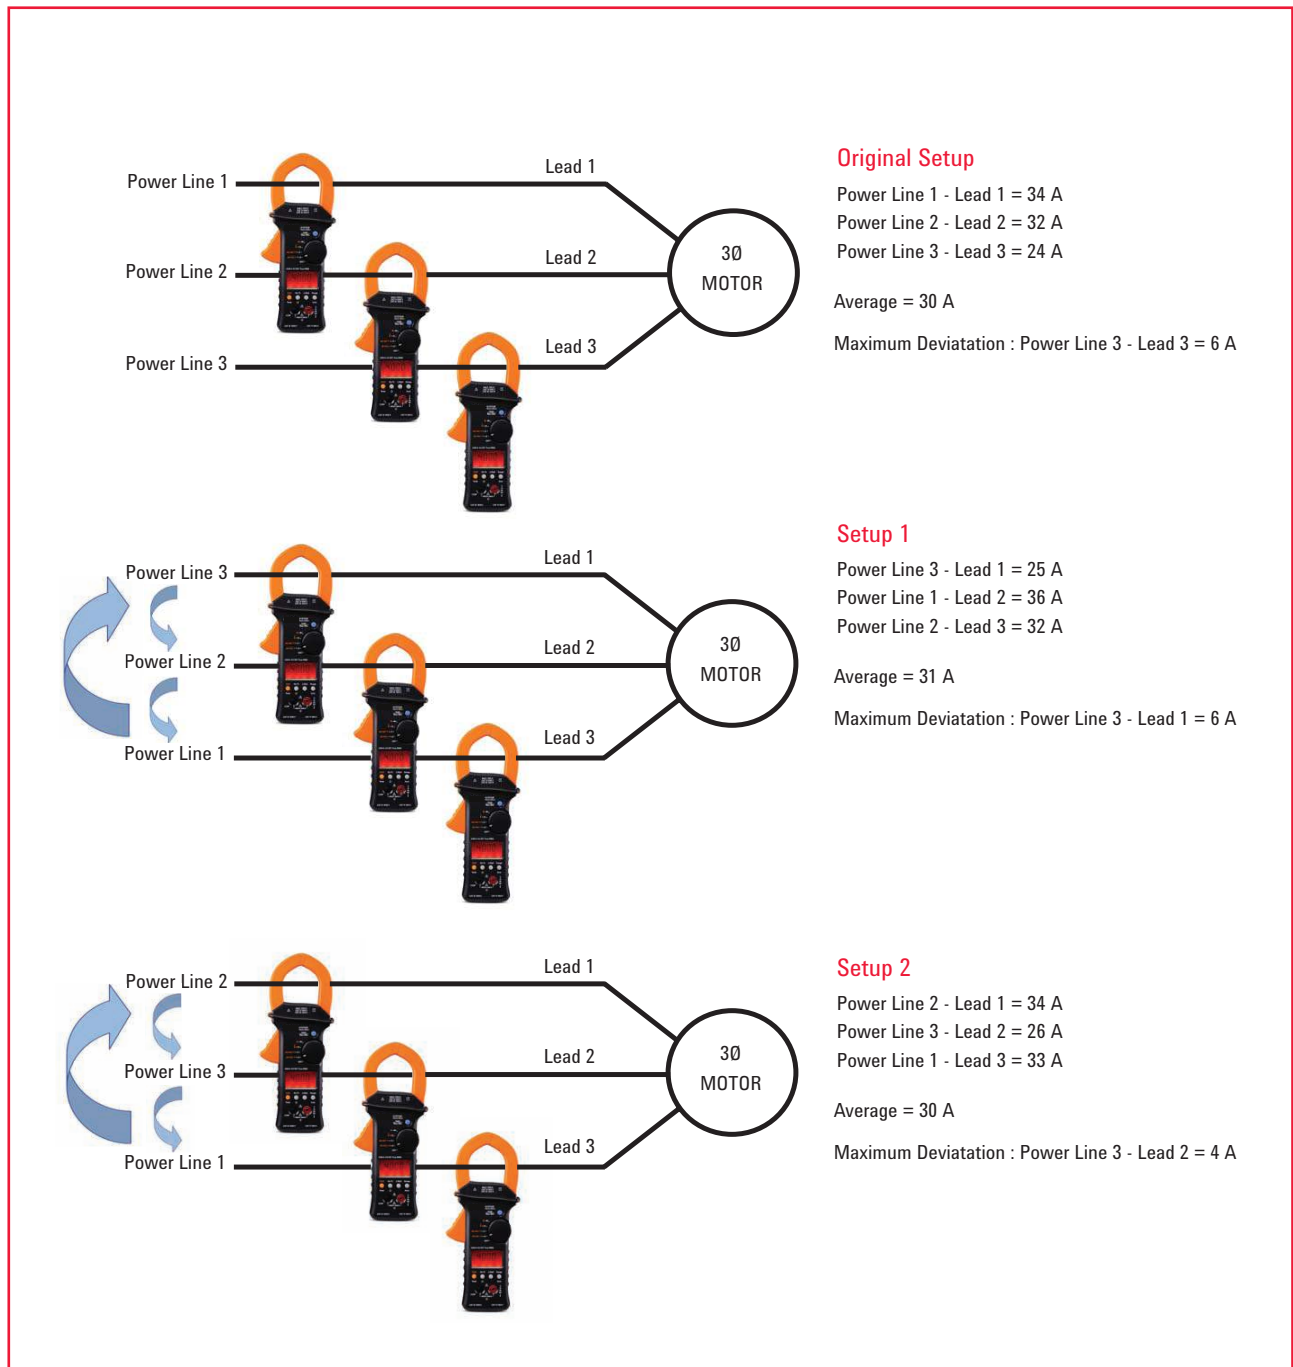


Figure 1. Steps to identify the source of unbalance

How to Identify Motor Single Phasing

Single phasing is a condition in which one leg of a three-phase motor is open. When motor is interrupted by the loss of a phase, the other two phases of the motor will attempt to pick up the load that the lost phase was carrying. If the motor is loaded, it will push the current draw of the motor beyond the “must-trip” current of the overload protection. The test below can help you to identify the single-phasing condition in the three-phase AC motor.

Steps for Performing Test

1. Measure and record the current in each motor lead as shown in Figure 2.
2. During normal operation, all the current drawn in each phase are the same. Single-phasing is present only when one of the motor lead current measurements is 0 A.
3. This situation could be due to a damaged motor starter contact, burned-open overload relay, or a switch or circuit breaker on the main, feeder or motor branch circuit. A thorough check is needed.

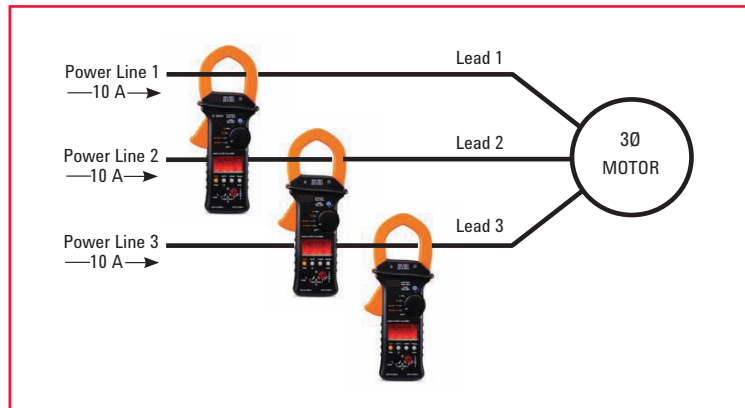


Figure 2. Motor under normal condition

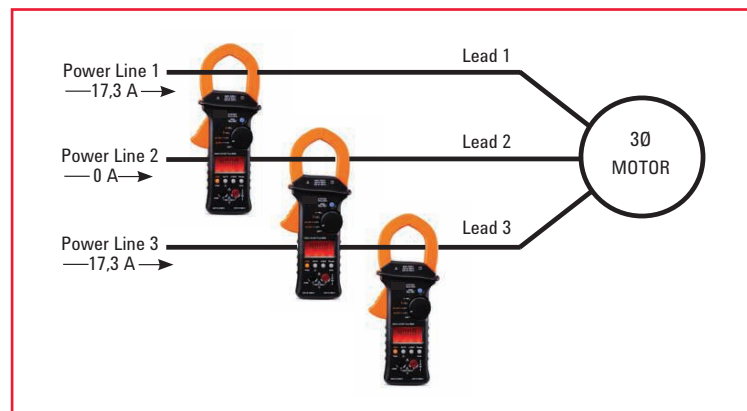


Figure 3. Motor under single-phasing

Summary

Industrial applications use three-phase motors extensively in high-power applications. Any voltage unbalance or current unbalance can create excessive heat that damages the motors. Unanticipated failure of motors in critical service may damage equipment and affect plant availability. Proper predictive and preventive maintenance should be in place to reduce these motor failures. Electricians and technicians must equip themselves with the right tools, such as Agilent U1210 Series Handheld Clamp Meters, in order to perform such preventive maintenance program effectively. Furthermore, the large jaw openings of Agilent U1210 Series Handheld Clamp Meters provide the best fit for other applications such as current measurement in transformers.

myKeysight

myKeysight

www.keysight.com/find/mykeysight

A personalized view into the information most relevant to you.



www.axiestandard.org

AdvancedTCA® Extensions for Instrumentation and Test (AXIe) is an open standard that extends the AdvancedTCA for general purpose and semiconductor test. Keysight is a founding member of the AXIe consortium. ATCA®, AdvancedTCA®, and the ATCA logo are registered US trademarks of the PCI Industrial Computer Manufacturers Group.



www.lxistandard.org

LAN eXtensions for Instruments puts the power of Ethernet and the Web inside your test systems. Keysight is a founding member of the LXI consortium.



www.pxisa.org

PCI eXtensions for Instrumentation (PXI) modular instrumentation delivers a rugged, PC-based high-performance measurement and automation system.



Three-Year Warranty

www.keysight.com/find/ThreeYearWarranty

Keysight's commitment to superior product quality and lower total cost of ownership. The only test and measurement company with three-year warranty standard on all instruments, worldwide.



Keysight Assurance Plans

www.keysight.com/find/AssurancePlans

Up to five years of protection and no budgetary surprises to ensure your instruments are operating to specification so you can rely on accurate measurements.



www.keysight.com/quality

Keysight Technologies, Inc.
DEKRA Certified ISO 9001:2008
Quality Management System

Keysight Channel Partners

www.keysight.com/find/channelpartners

Get the best of both worlds: Keysight's measurement expertise and product breadth, combined with channel partner convenience.

www.keysight.com/find/clampmeter

For more information on Keysight Technologies' products, applications or services, please contact your local Keysight office. The complete list is available at: www.keysight.com/find/contactus

Americas

Canada	(877) 894 4414
Brazil	55 11 3351 7010
Mexico	001 800 254 2440
United States	(800) 829 4444

Asia Pacific

Australia	1 800 629 485
China	800 810 0189
Hong Kong	800 938 693
India	1 800 112 929
Japan	0120 (421) 345
Korea	080 769 0800
Malaysia	1 800 888 848
Singapore	1 800 375 8100
Taiwan	0800 047 866
Other AP Countries	(65) 6375 8100

Europe & Middle East

Austria	0800 001122
Belgium	0800 58580
Finland	0800 523252
France	0805 980333
Germany	0800 6270999
Ireland	1800 832700
Israel	1 809 343051
Italy	800 599100
Luxembourg	+32 800 58580
Netherlands	0800 0233200
Russia	8800 5009286
Spain	0800 000154
Sweden	0200 882255
Switzerland	0800 805353
	Opt. 1 (DE)
	Opt. 2 (FR)
	Opt. 3 (IT)
United Kingdom	0800 0260637

For other unlisted countries:
www.keysight.com/find/contactus
(BP-07-10-14)

