


Lock Functions	A B C						D E F					
8700USD-ADL	●						●					
8701USD*							●					
8702USD*				●			●					
8703USD*							●					
8722USD	●						●					
8724USD	●						●					
8725USD	●						●					
8739USD						○						
8742USD	●						●					
8745USD							●					
8745USD	●						●					
8748USD	●						●					
8749USD	●						●					
8756USD	●						●					
8758USD	●						●					
8759USD	●						●					
Required Holes												
Optional Holes												

(no strike needed)

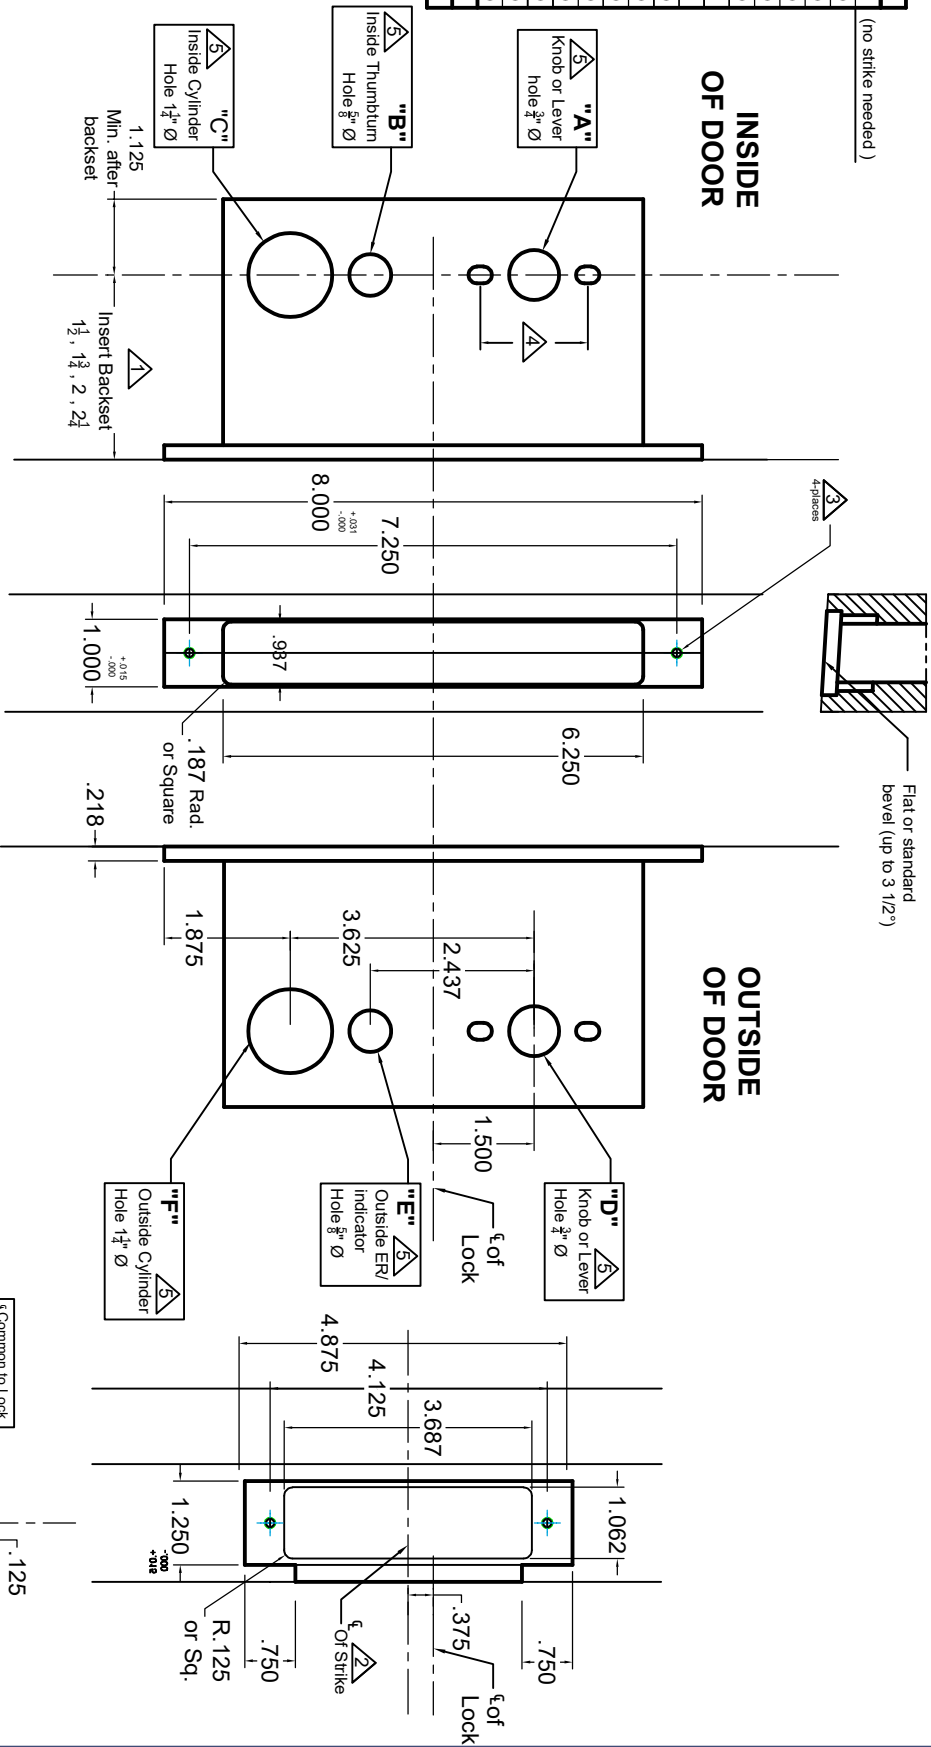


Notes:

- Insert backset here 1 1/2", 1 3/4", 2", 2 1/4"
- ASA strike 3/8" BELOW centerline of lock. **NOTE: use template #T-ALH.ASADB.STK for #s 8801, 8802 and 8803**
- Prep for #12 wood or 12-24 machine screws
- Thru bolting holes ONLY if required. See trim manufacturers standard template for details.
- Accurate lock's accommodates 1 1/2" to 1 1/4" center to centers and up to 1/2" dia. post.
- If there are any additional questions about the thru-bolting, please contact our office.
- Knob, thumbturn and ER holes may vary from different trim manufacturers. Please refer to their templates to confirm these dimensions.

Additional Notes:

- a) **Responsibility:** Door and frame manufacturers are responsible for providing adequate construction or re-inforcement for proper installation of hardware shown.
- b) Please contact us if a double lip strike is needed - for a proper template
- c) See catalog / spec sheets for additional lock details

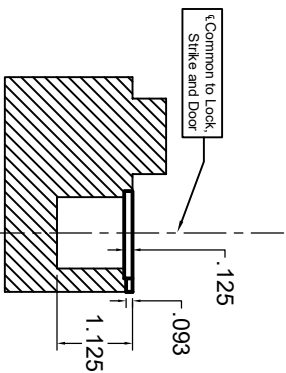

ACCURATE LOCK & HARDWARE

AMERICAN CRAFTED SINCE 1972

Standard 8700USD - Upside Down
(Lever High) Template
All Backsets

T-ALH.8700USD