


Viega ProPress Tee Copper P x P x P - Model 2918

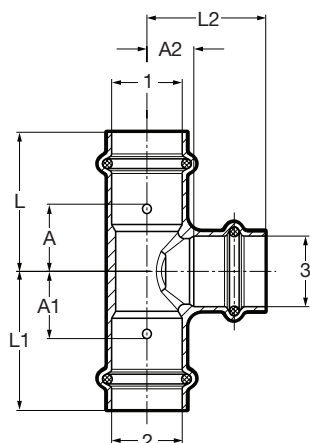

Continued from previous page

Part No.	Size (in)	A (in)	A1 (in)	A2 (in)	L (in)	L1 (in)	L2 (in)
	1 2 3						
14568	1¼ x 1 x 1	0.88	1.28	0.91	1.91	2.19	1.81
94757	1¼ x 1¼ x ½	0.65	0.65	0.93	1.67	1.67	1.67
77452	1¼ x 1¼ x ¾	0.77	0.77	0.89	1.79	1.79	1.77
77447	1¼ x 1¼ x 1	0.88	0.88	0.90	1.91	1.91	1.81
77457	1½ x 1½ x 1½	1.13	1.13	1.13	2.56	2.56	2.56
79660	1½ x 1 x ¾	0.67	1.39	1.16	2.17	2.44	2.05
15458	1½ x 1 x 1	0.74	1.54	1.06	2.17	2.44	1.97
15463	1½ x 1 x 1½	1.13	1.83	1.13	2.56	2.74	2.56
22233	1½ x 1¼ x ¾	0.67	1.08	1.15	2.09	2.11	2.05
15453	1½ x 1¼ x 1	0.74	1.29	1.18	2.17	2.32	2.09
15483	1½ x 1¼ x 1¼	0.86	1.33	1.13	2.28	2.36	2.17
15448	1½ x 1½ x ½	0.47	0.47	1.10	1.89	1.89	1.85
77462	1½ x 1½ x ¾	0.66	0.66	1.14	2.09	2.09	2.05
77467	1½ x 1½ x 1	0.74	0.74	1.18	2.17	2.17	2.09
77472	1½ x 1½ x 1¼	0.86	0.86	1.13	2.28	2.28	2.17
77477	2 x 2 x 2	1.37	1.37	1.37	2.95	2.95	2.95
15518	2 x 1¼ x 1¼	0.94	1.84	1.33	2.52	2.87	2.36
15513	2 x 1½ x ¾	0.70	1.25	1.38	2.28	2.68	2.28
15498	2 x 1½ x 1	0.82	1.45	1.38	2.40	2.87	2.28
15508	2 x 1½ x 1¼	0.94	1.55	1.49	2.52	2.97	2.52
15503	2 x 1½ x 1½	1.13	1.65	1.37	2.72	3.07	2.80
22228	2 x 1½ x 2	1.38	1.89	1.38	2.95	3.33	2.95
15538	2 x 2 x ½	0.54	0.54	1.30	2.13	2.13	2.05
94777	2 x 2 x ¾	0.79	0.79	1.26	2.37	2.37	2.17
94772	2 x 2 x 1	0.91	0.91	1.30	2.49	2.49	2.21
77487	2 x 2 x 1¼	1.04	1.04	1.37	2.62	2.62	2.40
77482	2 x 2 x 1½	1.13	1.13	1.37	2.72	2.72	2.80