



Viega ProPress Tee Zero Lead Bronze P x P x FPT - Model 2917.2ZL

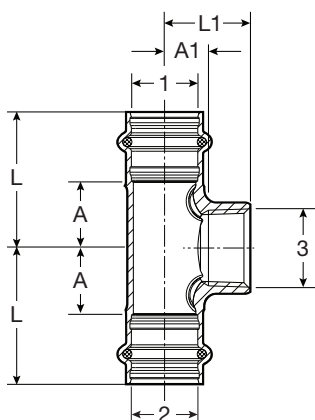


Part No.	Size (in)			A (in)	A1 (in)	L (in)	L1 (in)
	1	2	3				
79580	1/2	1/2	1/2 FPT	0.79	0.69	1.61	1.30
79585	3/4	3/4	1/4 FPT	0.67	0.79	1.57	1.18
79590	3/4	3/4	1/2 FPT	0.79	0.88	1.69	1.42
79595	3/4	3/4	3/4 FPT	0.91	0.59	1.81	1.14
79760	1	1	1/2 FPT	0.79	1.04	1.69	1.57
79765	1	1	3/4 FPT	0.91	1.06	1.81	1.61
79770	1 1/4	1 1/4	1/2 FPT	0.83	1.16	1.85	1.69
79775	1 1/4	1 1/4	3/4 FPT	0.95	1.18	1.97	1.73
79780	1 1/2	1 1/2	1/2 FPT	0.87	1.24	2.28	1.77
79785	1 1/2	1 1/2	3/4 FPT	0.94	1.30	2.36	1.85
79790	2	2	1/2 FPT	0.98	1.59	2.56	2.13
79795	2	2	3/4 FPT	1.06	1.65	2.64	2.20

Viega ProPress Tee P x P x FPT - Model 0917.2XL

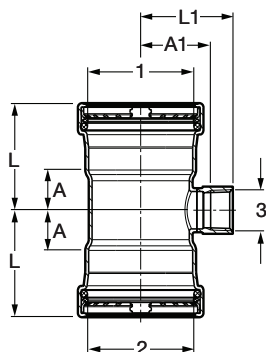

Part No.	Size			A (in)	A1 (in)	L (in)	L1 (in)
	1	2	3				
20883	2 1/2	2 1/2	3/4 FPT	1.02	1.78	2.72	2.34
20878	2 1/2	2 1/2	2 FPT	1.54	1.90	3.23	2.60
20893	3	3	3/4 FPT	1.04	2.03	3.01	2.59
20888	3	3	2 FPT	1.56	2.16	3.52	2.85
20873	4	4	3/4 FPT	1.08	2.53	3.34	3.09
20868	4	4	2 FPT	1.59	2.69	3.96	3.38

Viega ProPress Adapter Zero Lead Bronze P x MPT - Model 2911ZL

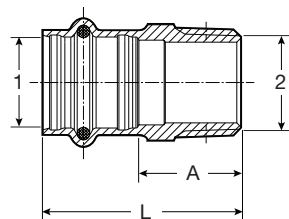

Part No.	Size (in)		A (in)	L (in)
	1	2		
79210	1/2	3/8 MPT	0.77	1.59
79215	1/2	1/2 MPT	0.89	1.71
79220	1/2	3/4 MPT	1.00	1.83
79225	3/4	1/2 MPT	1.02	1.93
79230	3/4	3/4 MPT	1.02	1.93
79235	3/4	1 MPT	1.18	2.09
79240	1	3/4 MPT	1.18	2.09
79245	1	1 MPT	1.26	2.17
79250	1	1 1/4 MPT	1.54	2.44
79255	1 1/4	1 MPT	1.22	2.24
79260	1 1/4	1 1/4 MPT	1.34	2.36
79265	1 1/4	1 1/2 MPT	1.48	2.50
79270	1 1/2	1 1/4 MPT	1.34	2.76
79275	1 1/2	1 1/2 MPT	1.28	2.70
79280	1 1/2	2 MPT	1.65	3.07
79285	2	1 1/2 MPT	1.54	3.11
79290	2	2 MPT	1.50	3.07