

# Digi-Sense™ Data Loggers with TraceableLIVE® Wireless Technology



## Get alerts before you lose valuable samples

- Remotely monitor your critical environments 24/7 via Wi-Fi\*
- View current conditions anywhere—cloud-based interface sends email, text, and push notifications
- Securely connect to data via smartphone, tablet, or PC
- No software required—web, Android™, Apple® iOS data visibility
- Ensure accurate, reliable measurements with included NIST-traceable calibration
- Use included Velcro® strip and magnetic strip for surface mounting, or use the built-in stand on a benchtop

Digi-Sense data loggers with TraceableLIVE wireless technology provide a simple, efficient, and reliable way to ensure your critical samples are not compromised due to parameter variations. This latest technology is ideal for monitoring a process in real time, any time. Plus you get the value, accuracy, and peace of mind of NIST-traceable calibration at a noncalibrated price.

TraceableLIVE allows you to view current conditions from anywhere with a cloud-based interface. No additional software is needed and connecting is simple with a low-cost TraceableLIVE subscription.

Once setup is complete, you can view conditions in real time; set alarm parameters; view data logging history; generate data reports in real time; get email, text and push notifications; and receive alerts for temperature alarm, connectivity interruption and low battery.

\*Requires a TraceableLIVE subscription.


## A. Digi-Sense Temperature/Humidity Data Loggers

- Range from 32 to 131°F (0 to 55°C)
- Built-in bench stand makes it easy to read the temperature and humidity measurements
- Available with ambient sensor dongle or external probe with 10-ft (3-m) cable



## B. Digi-Sense Ultra-Low Temperature Data Loggers

- Measure down to -130°F (-90°C)
- Mount probe inside of a freezer—micro cable allows freezer door to close on it
- Includes one or two 316 SS RTD probe(s) with 6-ft (1.8-m) cable

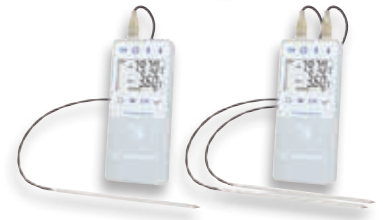

## C. Digi-Sense Data Logging Refrigerator/Freezer Thermometers

- Range from -58 to 140°F (-50 to 60°C)
- Choice of probe styles to suit your application
- Models with bottle probe are temperature-buffered to protect sensor from rapid changes when refrigerator door is opened



## D. Digi-Sense Multiparameter Data Loggers

- Measure temperature, humidity, CO<sub>2</sub>, or barometric pressure levels
- Choose from meters with a dongle to measure ambient conditions, or external sensor to monitor conditions in chambers or other enclosed environments



## Specifications

**Sampling rate:** 9 to 12 seconds

**Max number of stored alarms:** 100

**Memory:** 672 (7 days if set to 15-minute intervals)

**Power:** four AAA batteries (included)

Sensor included	Parameters			Catalog number
	Range	Resolution	Accuracy	
<b>A. Temperature/humidity data loggers</b>				
Ambient sensor dongle	Temp: 32 to 131°F (0 to 55°C) Humidity: 0 to 100% RH	Temp: 0.01° Humidity: 0.1%	Temp: ±0.72°F (±0.4°C) Humidity: ±3% (20 to 80% RH), ±5% (remaining)	<b>ML-18000-29</b>
External probe with 10-ft (3-m) cable				<b>ML-18000-30</b>
<b>B. Ultra-low temperature data loggers</b>				
One 316 SS probe with 6-ft (1.8-m) cable	-130 to 221°F (-90 to 105°C)	0.01°	±0.18°F (±0.1°C)	<b>ML-18000-27</b>
Two 316 SS probes with 6-ft (1.8-m) cable				<b>ML-18000-28</b>
<b>C. Refrigerator/freezer data loggers</b>				
Two bottle probes	-58 to 140°F (-50 to 60°C)	0.01°	±0.45°F (±0.25°C)	<b>ML-99460-00</b>
One bottle probe and one bullet probe with detachable sensor and 10-ft (3-m) cable				<b>ML-99460-05</b>
Two bullet probes				<b>ML-99460-10</b>
Two SS probes with detachable sensor and 10-ft (3-m) cable				<b>ML-99460-15</b>
<b>D. Multiparameter data loggers</b>				
Ambient sensor dongle for temperature/humidity/CO <sub>2</sub>	Temp: 32 to 131°F (0 to 55°C) Humidity: 0 to 95% RH CO <sub>2</sub> : 0 to 10,000 ppm	Temp: 0.01° Humidity: 0.01% CO <sub>2</sub> : 5% reading + 70 ppm	Temp: ±0.72°F (±0.4°C) Humidity: ±3% (5 to 75% RH), ±5% (remaining) CO <sub>2</sub> : 1 ppm	<b>ML-18000-31</b>
External probe with 3-ft (0.9-m) cable for temperature/humidity/CO <sub>2</sub>	Temp: 32 to 131°F (0 to 55°C) Humidity: 0 to 95% RH CO <sub>2</sub> : 0 to 20%	Temp: 0.01° Humidity: 0.01% CO <sub>2</sub> : 5% reading + 1 digit	Temp: ±0.72°F (±0.4°C) Humidity: ±3% (5 to 75% RH), ±5% (remaining) CO <sub>2</sub> : 0.01%	<b>ML-18000-32</b>
Ambient sensor dongle for temperature/humidity/barometric pressure	Temp: 32 to 131°F (0 to 55°C) Humidity: 0 to 100% RH Barometric pressure: 500 to 1100 mbar	Temp: 0.01° Humidity: 0.01% Barometric pressure: 1 mbar	Temp: ±0.72°F (±0.4°C) Humidity: ±3% (5 to 75% RH), ±5% (remaining) Barometric pressure: ±4 mbar	<b>ML-18000-33</b>

4451

**Cole-Parmer®**

### In the US

625 E. Bunker Court  
Vernon Hills, IL 60061  
Call toll-free: 1-800-323-4340  
Phone: 1-847-549-7600  
Fax: 1-847-247-2929  
[www.coleparmer.com](http://www.coleparmer.com)

### In Canada

Call toll-free: 1-800-363-5900  
[www.coleparmer.ca](http://www.coleparmer.ca)

### In China

Call: +86-21-5109-9909  
[www.coleparmer.com.cn](http://www.coleparmer.com.cn)

### In Germany

Call: +49 (0) 9377 9203-0  
[www.coleparmer.de](http://www.coleparmer.de)

### In India

Toll-free: 1-800-266-1244  
[www.coleparmer.in](http://www.coleparmer.in)

### In the United Kingdom

Call: +44-20-8574-7556  
[www.coleparmer.co.uk](http://www.coleparmer.co.uk)

### International customers

Call: 1-847-549-7600 to reach our International Sales Department.

