



Simpson 4002/4003 is a rugged, dual display, 6600 count, portable multimeter with wide selection of measurements. The other key features include MIN/MAX, Data Hold and Peak Hold

Special Features

- Direct and alternating voltages from 100 μ V ... 1000V
- Direct and alternating currents from 10 μ A ... 10.00A
- Resistance from 100m Ω ... 60.00M Ω
- Capacitance from 1pF ... 40.00 mF with zero correction
- Frequencies from 10.00Hz ... 10MHz
- Diode measurement and continuity testing
- Hold measurement .
- Relative measurement
- Duty cycle (%) measurement
- Temperature measurement with K type Thermocouple
- Peak value measurement

Application

Simpson 4002/4003 digital multimeters are suited for universal, general applications in the electrical and electronics radio and television service, training and education.

Dual Display

The dual display included a main display and a sub display. Main display always display current measurement value where as sub display shows some special measurements like maximum/ minimum value, reference value for relative value measurement. Also dual display is used to display at the same time Voltage/ Current with Frequency, Frequency with Duty cycle etc.

Peak Hold

Minimum and maximum Peak values are hold in VAC, mAAC, AAC.

MIN/MAX Function

By pressing min/max button instrument will start recording minimum and maximum readings. All functions can measure MIN/MAX except Hz/Duty functions.

Temperature measurement

Multimeters measures temperature with "K" type thermocouple (NiCr - Ni) sensor in the range from 0C to 1300°C, 32°F...2372°F.

Indication of negative values on the analog scale.

When measuring DC quantities negative values are shown on the analog scale so that variations of the measured value can be observed at the Zero point.

Analog Scale

Analog scale that updates at the rate 28 times/sec to observe variations in the measured values

Protection from dust and water:

Instrument: IP 50

For terminals: IP20 as per IEC60529

Applicable International Safety standards

1000 V CAT III/600V CAT IV as per International Safety standard IEC 61010-1- 2010 and IEC 61557

Auto Power OFF (APO)

Multimeter has a default auto power off function. If the Meter is idle for more than the 15 minutes, the meter automatically turns the power off.

Hold

By pressing the HOLD/ON key, the currently displayed Measurement value can be held and "HOLD" is simultaneously displayed.

Relative measurement (REL)

By pressing and holding PEAK and then pressing AUTO/MAN key, the zero correction is made and relative Value is measured. It is not active in Hz/ Duty functions.

Automatic blocking System(ABS)

The automatic terminal blocking system prevents incorrect connection of test lead and incorrect selection of measurement quantity, which provide safety to the user.

Auto and Manual ranging modes

In AUTO ranging mode the instrument automatically selects the range with best resolution depending on the applied input. In manual ranging mode range is user selectable using AUTO/MAN Key.

Note: For AAC, ADC, Temperature, Continuity, Diode and Duty cycle measuring range is manual. No AUTO range selection is possible.

Diode and Continuity testing

This provides for the testing of the polarity of diodes, as well as inspection for short -circuits and circuit interruptions. In addition to the display, resistance of less than 30 Ω(approx.) Are Indicated with an acoustic signal.

Backlit

Large white LED backlit to work in poorly light area

ContinuousON mode

In this mode, AUTO POWER OFF is disabled.

Reference conditions for Accuracy

Reference Temperature	23°C/ 73.4°F ± 2K
Relative Humidity	45%...55% RH
Waveform of measured quantity	Sinusoidal
Input frequency	50 or 60 Hz ±2%
Battery Voltage	3 V ± 0.1 V

Applicable regulations and standards


EMC Immunity	IEC 61326-1 : 2012, Table A.1 *
Immunity	IEC 61000-4-2 : 8 KV atmosphere discharge, 4 KV contact discharge
	IEC 61000-4-3 : 3 V/m
Safety	IEC 61010-1-2010
IP for water & dust	IEC 60529
Pollution degree:	2
Installation category:	1000 V CATIII / 600 V CATIV (for 4002)
	1000 V CATII / 600 V CATIII (for 4003)
High Voltage Test	6.7 kV (IEC 61010-1-2010) (for 4002)
	3.5 kV (IEC 61010-1-2010) (for 4003)

* Short-term measured value deviation may occur during electro-magnetic interference thus reducing the specified operating quality

Environmental Conditions

Operating temperature	0 to +50°C, 32 °F...122 °F
Storage temperature	- 25 to +70°C, -13°F...158°F
Relative humidity	<75% non condensing
Terminal Protection	IP 50 for instrument and IP 20 for terminals
Altitude	Up to 2000 m

Battery

Battery Voltage	2 X 1.5 V Cells
Battery type	Alkaline manganese Dioxide cells.
Battery Life	for 4002, 4003 : 600 hrs. for VDC, ADC 300 hrs. for VAC, AAC : 400 hrs. for VDC, ADC 200 hrs. for VAC, AAC
Battery test	Automatic display of  symbol when battery voltage drops below approx. 2.4V

Specifications

Meas. Function	Measuring Range	4002	4003	Resolution	Input Impedance	Digital display Inherent deviation at reference condition + (...%rdg + ...digits)	Overload capacity ¹⁾			
							Overload Values	Overload Duration		
V(DC)	660.0mV	●	●	100 μV	>100MΩ // <40pF	0.7+5	1000 V DC AC eff / rms Sine wave	Cont.		
	6.600V	●	●	1mV	11 MΩ // <40pF	0.4+5				
	66.00V	●	●	10mV	10 MΩ // <40pF	0.4+5				
	660.0V	●	●	100mV	10 MΩ // <40pF	0.4+5				
	1000.0V	●	●	1V	10 MΩ // <40pF	0.4+5				
V(AC)	660.0mV	●	●	100 μV	>100 MΩ // <40pF	1.2+5			1.0+3	
	6.600V	●	●	1mV	11 MΩ // <40pF					
	66.00V	●	●	10mV	10 MΩ // <40pF					
	660.0V	●	●	100mV	10 MΩ // <40pF					
	1000V	●	●	1V	10 MΩ // <40pF					
A(DC)					Voltage Drop		0.7A	Cont.		
	66.00mA	●	●	10 μA	66.00mV	0.8+5				
	660.0mA	●	●	100 μA	66.00mV	0.8+5				
A(AC)			16A	10mA	10.00mV	1.5+5	12A	Cont.		
	66.0mA	●	●	10 μA	66.00mV	0.8+5	0.7A			
	660.0mA	●	●	100 μA	66.00mV	0.8+5	12A			
∠(AC)	66.00A	●		10mA	66.00mV	0.8+5	0.7A	Cont.		
	660.0A	●		100mA	66.00mV	0.8+5				
Ω					No load Voltage		1000 V DC AC eff / rms Sine wave	10 Sec.		
	660.0 Ω	●	●	100mΩ	-3.3V	0.8+5				
	6.600KΩ	●	●	1Ω	-1.08V	0.8+5				
	66.00KΩ	●	●	10 Ω	-1.08V	0.8+5				
	660.0KΩ	●	●	100 Ω	-1.08V	0.8+5				
	6.600MΩ	●	●	1KΩ	-1.08V	1.0+5				
66.00MΩ	●	●	10KΩ	-1.08V	2.0+5					
BUZZER	660.0 Ω	●	●	100mΩ	-3.3V	0.8+5				
DIODE	2.000V	●	●	1mV	3.3V	2.0+10				
F	6.600nF			1pF	—	3.0+40			1000 V DC AC eff / rms Sine wave	10 Sec.
	66.00nF			10pF		2.0+10				
	660.0nF			100pF		2.0+10				
	6.600μF			1nF		2.0+10				
	66.00μF			10nF		2.0+10				
	660.0μF			100nF		5.0+10				
	6.600mF			1 μF		5.0+10				
	40.00mF			10 μF		5.0+10				
Hz	66.00Hz			0.01Hz	10 Hz (Fmin)	0.2 + 2 ³⁾				
	660.0Hz			0.1Hz						
	6.600KHz			1Hz						
	66.00KHz			10Hz	—					
	660.0KHz			100Hz						
	6.600MHz			1KHz						
10.00MHz			10KHz							
%	1.0...98.90%			0.01 %		10 Hz... 1kHz ± 5 Digit ³⁾ 1 kHz ... 10 kHz; ± 5 Digit / kHz ³⁾				
C/ F	0...1300°C, 32°F...2372°F	●	●	1°C, 1°F	—	2.0+3 ⁴⁾				
Peak (V AC/A AC)		●	●			3.0+300	-	-		


1) At 0°C ... + 40°C, 32 °F...+104°F

2) At input ≥3.5Vrms, Square wave, Bipolar inputs.

3) For <10 Khz, Square wave, Bipolar inputs

4) Without sensor

Influence Quantities


Influence Quantity	Range of Influence	Measured Quantity / Measuring Range	Variation ¹⁾ ± (...% of rdg. + ...digits)
Temperature	0 °C +21 °C and +25 °C...+40°C	VDC	1 X Intrinsic error / K
		VAC	
		ADC	
		AAC	
		Ω	
		Diode	
		F	
		Hz	
		°C	
Frequency of the Measured quantity	20 Hz...< 50 Hz	660mV~	1.0+3
	> 50Hz... 200 Hz		5.0+3
	20 Hz...< 50 Hz	6.6.....1000V ~	1.0+3
	> 50Hz... 2 KHz		5.0+7
	20 Hz...< 50 Hz	A~	1.0+3
	> 50Hz... 2 KHz		5.0+7
Waveform of the Measured quantity ²⁾	Crest Factor CF	V ^{~3)} , A ^{~3)}	± 1 % of rdg
			± 5 % of rdg
Battery Voltage	 ⁴⁾ ... < 2.49 V > 2.49 V ... 3 V	VDC	5 Digit
		V~, ADC	10 Digit
		AAC	6 Digit
		600 Ω	4 Digit
		6.600kΩ - 66 MΩ	3 Digit
		nF, μF, mF	5 Digit
		Hz	5 Digit
		%	5 Digit
Relative Humidity	75%	V~, VDC	1 x intrinsic error
	3 Days	A~, ADC	
		Ω	
	Meter off	F	
		Hz	
		°C	

1) With temperature: Error data apply per 10 K change in temperature.

With frequency: Error data apply to a display from 300 digits onwards.

2) With unknown waveform (crest factor CF > 2), measure with manual range selection

3) With the exception of sinusoidal waveform.

4) After the "" symbol is displayed.

Influence Quantities

Influence Quantity	Range of Influence	Measured Quantity/ Measuring Range	Attenuation
Common Mode interference voltage	Noise quantity max. 1000 V dc	VDC	> 100 dB
		V~	> 100 dB
	Noise quantity max. 1000 V ~ 50 Hz, 60 Hz sinusoidal	VDC	>100 dB
		V~	> 50 dB
Normal Mode interference voltage	Noise quantity V ~ Value of the measuring range at a time Max. 1000V~ ,50Hz, 60Hz Sinusoidal	660mVDC, 6.6VDC, 660VDC,1000VDC	> 43 dB
		66 VDC	> 35 dB
	Noise quantity max. 1000 V dc	V~	> 45 dB

Response time (After manual range selection)

Measured Quantity/ Measured range	Response Time		Attenuation
	Of Analog indication	Of digital indication	
VDC ,VAC, °C	0.1S	1.0S	From 0 to 80 % of upper range limit.
A~,ADC	0.1S	1.0S	From 0 to 50 % of upper range limit.
660Ω...6.6 MΩ	0.1S	1.0S	
66 MΩ	0.2S	2.0S	From 0 to 80 % of upper range limit.
Diode	0.1S	1.0S	
6.6nF... 66μF	0.7S	Max.1S	
660μF...6.6 mF	1.4S	Max.3S	
66 mF	7.0S	Max.15S	
660 Hz,6.6KHz	2.0S	Max.2S	
66 KHz,660 Khz,1MHz	0.5S	Max.1S	
% (10 Hz)	0.7S	Max.2.5S	

Display


LCD display field 58 mm X 31.4 mm with digital display, analog scale and with display of measurement unit, and Various special functions.

Digital

Display	7 segment
Character height	Main Display Character : 12mm Sub Display Character : 7mm
Number of digits/Counts	4 digits 6600 steps
Overrange display	"OL" is displayed
Polarity display	"-" sign is displayed when positive pole at "1"
Sampling rate	2.8 times /sec

Analog

Indication	LCD scale Analog Bar graph
Scale length	55 mm
Scaling	0 to 60 with 66 scale divisions
Polarity Indication	"-" sign on scale digits
Over range indication	By triangle
Sampling rate	28 times/sec

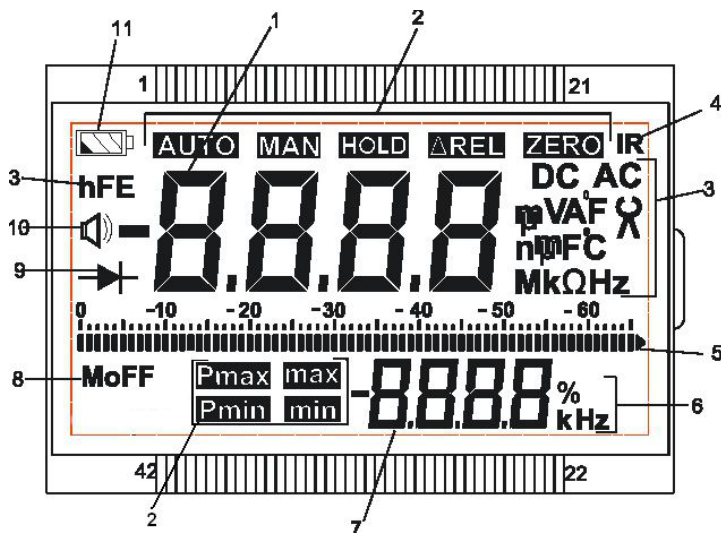

Multimeter display :

1. Digital Main display with decimal point and polarity
2. Display for Automatic, manual range Selection, HOLD, Relative, Zero Peak, Max, Min.
3. Measurement unit of main display
4. Display for IR mode indication
5. Display for Analog scale.
6. Measurement unit of Sub display.
7. Digital Sub display with decimal point and polarity
8. Display for Auto off indication (After 15 Min meter will turn OFF)
9. Diode test Display.
10. Continuity test display.
Speaker symbol appears when acoustic signal is switched on
11. Low battery indication.

Fuse **Mechanical Design**

Fuse for ranges up to 660 mA	1.6 A / 1000V; 6.3 mm x 32 mm	Protection	Instruments: IP 50
Fuse for 10 A range	16 A / 1000V; 10 mm x 38 mm	Connector sockets: IP 20	
		Dimensions	W x H x D:
		With Holster	86 mm x 188 mm x 53 mm
		Without Holster	79 mm x 174 mm x 38 mm
		Weight	Approx. 0.480 Kg with battery

Ambient Conditions **Standard Scope Of Supply**

Operating temperature range	0 °C ... + 50°C, 32 °F...122 °F	1 Multimeter
Storage temperature range	- 25°C ... + 70°C (without batteries), -13°F...158°F	1 Cable set
Relative humidity	45 ... 75 %	1 Copy Operating Instructions
Elevation	up to 2000 m	1 Protective Case (Holster)



Simpson Electric Company
 520 Simpson Avenue
 Lac Du Flambeau, WI 54538-0099 (USA)
 Web: www.simpsonelectric.com
 Contact: +1 715-588-3311