

VOJ-93C-(Size)

Tech Wear Style Sheet



This ESD jacket is designed to ground the garment and wearer through a ground cord connected at the 4mm stainless steel hip pocket snap. This allows for hands-free movement without tethering one hand, which is required when using a wrist strap connected to a ground cord. The light-weight fabric makes this style one of our most popular garments.

Surface resistivity of the fabric is $1x10^5$ and the sleeve-to-sleeve resistance of the garment is guaranteed to stay below $3.5x10^7$ for 100 washes or 2 years.

Part Number VOJ-93C-(Size)
Style V-neck Jacket

Colors Black (plus 8 other colors)
Sleeve Long sleeve with ESD knit cuffs

Closure Front Snap

Length Shorter hip-length Jacket Size range Small thru 5X-Large

Fabric OFX-100

Content 87% Poly/Carbon 13% Fabric Weight 2.3 ounces per square yard Specification ANSI/ESD STM2.1-Cat. 3

Guarantee 100 wash Country of Manufacture USA




VOJ-93C-(Size)

This V-neck jacket comes with 4mm male ground snaps on the hip pockets. This snap connection is for attaching a standard ground cord. Using the garment in this way eliminates the need for a wrist strap. This connection is also used for testing and/or monitoring that the garment and the wearer are grounded. The "Reaching Hand Symbol" next to the breast pocket indicates that this garment is a tool for the prevention of static discharge. This garment is available in most colors for immediate shipment.

Part numbers by color:

Blue	VOJ-23C-(Size)
White	VOJ-13C-(Size)
Burgundy	VOJ-33C-(Size)
Pink	VOJ-73C-(Size)
Teal	VOJ-83C-(Size)
Black	VOJ-93C-(Size)
Digi-camo	VOJ-D3C-(Size)
HiViz Yellow	VOJ-HVO3C-(Size)
HiViz Orange	VOJ-HVY3C-(Size)



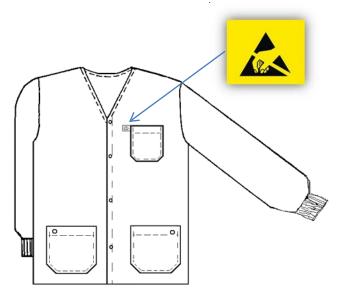

Dimensions for V-neck Styles											
Size		SML	MED	LRG	XL	2XL	3XL	4XL	5XL		
Fits Chest		34-36	38-40	42-44	46-48	50-52	54-56	58-60	62-64		
Finished Chest		41	45	48	51	55	59	63	67		
Finished Sleeve		31	32	34	35	36	36	36	37		
Jacket Length		32	32	32	32	32	32	33	33		

Note:

All measurements are rounded to the nearest inch. Length measurements are measured from center b Finished sleeve is measured from center back of ne