



TECHNICAL DATA SHEET




PRODUCT INFORMATION

DuPont™ Tyvek® IsoClean® Sleeve. Bound Seams. Covered Elastic at Both Ends. 21" Long. Thumb Loop. White.
[Certificates of Sterility Available Here](#)

ATTRIBUTES

Full Part Number	IC502BWHxx0100yy (xx=size) ?
Fabric/Materials	Tyvek® IsoClean®
Design	Sleeve
Seam	Bound
Color	White
Quantity/Box	100 per case
Sizes	00
Option Codes	CS

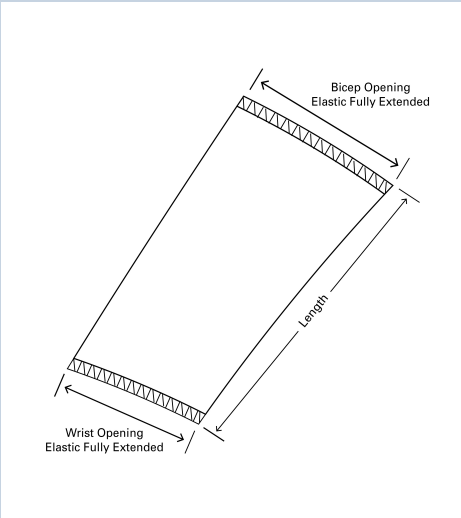

SIZE TABLE

SIZE	SLEEVE LENGTH	WRIST OPENING	BICEP OPEN
UN	21 1/4	6	10

PHYSICAL PROPERTIES

PROPERTY	TEST METHOD	TYPICAL RESULT	STDDEV
Basis Weight	ASTM D3776	1.33 oz/yd ²	0.06 oz/yd ²
Burst Strength - Mullen	ASTM D774	44 psi	7 psi
Breaking Strength - Grab (MD)	ASTM D5034	14 lb _f	2 lb _f
Breaking Strength - Grab (CD)	ASTM D5034	20 lb _f	3 lb _f
Particle Shedding (Helmke Drum)	IEST-RP-CC003.3	Category I	
Bacterial Filtration Efficiency (3.0 micron)	ASTM F2101	98.4%	0.9%
Hydrostatic Head	AATCC 127	74 cm H ₂ O	10 cm H ₂ O
Wearing Apparel Flammability	16 CFR 1610	Class 1	

WARNING


As of January 2023, all DuPont Personal Protection products are manufactured under specifications that exclude components containing natural rubber latex. Tyvek® 500, Tyvek® 600 and Tyvek® 800 styles made before January 2023 contain natural rubber latex, which may cause allergic reactions in some sensitized individuals. Anyone who begins to exhibit an allergic response during the use of DuPont products should immediately cease using these products and should report it to DuPont at +1 (888) 439-2988 so that an investigation can be initiated.

CLEANROOM WARNINGS

Warning: Cleanroom apparel should not be used around heat, flames, sparks or in potentially flammable or explosive environments. Cleanroom fabrics should have slip-resistant materials on the outer sole of boots, shoe covers, or other garment surfaces in conditions where slipping could occur. Silicone Statement: All DuPont Personal Protection products are manufactured under specifications that do not contain silicone, with some exceptions. Tyvek® friction-coated shoe covers or Tyvek® garments with friction-coated shoe covers might contain silicone. This includes styles TY122, TY121, FC450 and FC454. Tychem® 6000 AL styles TF630 and TF640T contain a silicone valve diaphragm. End users who are consuming these styles and who have concerns about silicone contamination should conduct their own testing to ensure they are suitable for their application(s). Latex statement: As of January 2023, all DuPont Personal Protection products are manufactured under specifications that exclude components containing natural rubber latex. Tyvek® 500, Tyvek® 600 and Tyvek® 800 styles made before January 2023 contain natural rubber latex, which may cause allergic reactions in some sensitized individuals. Anyone who begins to exhibit an allergic response during the use of DuPont products should immediately cease using these products and should report it to DuPont at +1 (888) 439-2988 so that an investigation can be initiated. As of January 2023, Tyvek® 500, Tyvek® 600 and Tyvek® 800 are manufactured under specifications that exclude components containing natural rubber latex.

DuPont™ SafeSPEC™ - We're here to help

Our powerful web-based tool can assist you with finding the appropriate DuPont garments for chemical and controlled environment hazards.

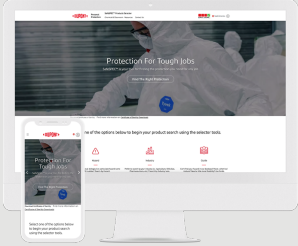

DUPONT

DuPont - SafeSPEC

DuPont Personal Protection

SafeSPEC™

in.

DuPont Personal Protection

DuPont Personal Protection

CREATED ON: JANUARY 23, 2026