



Buy this item and view more at www.ironplanet.com or call 800-211-3983

Item #14097194 - 2018 Genie S-65 4WD Diesel Telescopic Boom Lift



Item Details:

- Features: 65 ft Max Platform Height, 500 lb Max Weight Capacity, Jib, Power to Platform, Onboard Generator, 2018 US EPA Label, Deutz 4 Cylinder 35.4 kW 2.9 L Diesel Engine, 355/55D625 Tires
- Meter Reading: 0 Miles
- Serial #: S60H-38611
- Inspection Completed: 11/14/25

Shipping Details:

- Location Michigan (Monroe County)
- Loading Dock Available: No
- Pickup Hours: null-null
- You will need a copy of your IronPlanet Item Release to pick the item up. Please call one day in advance to schedule pickup.

Inspection Report

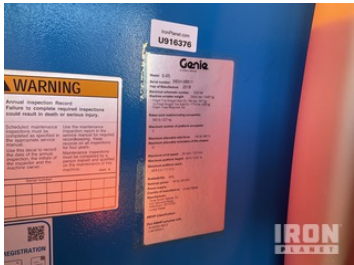
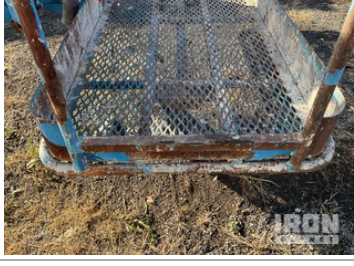
Note: This condition inspection report is the result of an impartial, systematic, documented process focused on the establishment of the general, overall mechanical condition of a piece of equipment, or of a vehicle, at a specific time. The purpose of the inspection is to establish the "as is" operational capability of the machine. It is not a performance or load test on the item.

Inspection Ratings Key

★★★★	Limited use or recently replaced. Free of visible wear or defects.
★★★☆☆	Performs within the tolerances expected for age and type of item
★★☆☆☆	Although performing, shows indication of needing repair or replacement
★☆☆☆☆	Needs immediate repair/replacement. Requires work if it is to perform as expected

General Appearance

Item	Assessment	Photo
Picture, Left Front Corner		
Picture, Left Rear Corner		
Picture, Right Rear Corner		
Picture, Right Front Corner		

Serial Number / VIN	S60H-38611	
Hour Meter / Odometer	0 mi, Meter inoperable	
Paint	No visible damage	
Body Panels	Engine compartment door damaged	
Steps/Ladders		
Basket / Safety Railing	No visible damage or missing components	
General Appearance #1		

General Appearance #2



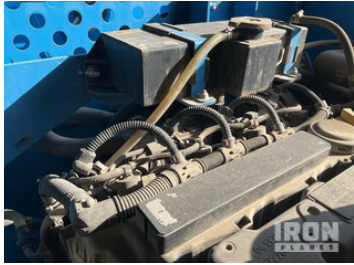
Safety		
Item	Assessment	Photo
Travel Alarm	Operational	
Horn	Operational	
Swing Brake	Operational	
Current Safety Manual	No	
Current Operator/Maintenance Manual	No	

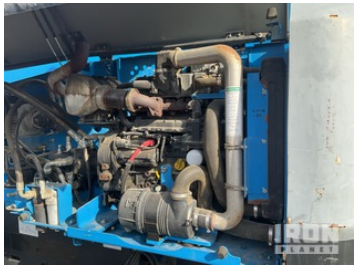
Control Station Ground		
Item	Assessment	Photo
Gauges	inoperable gauges are inoperable	
Function Controls	★★★★☆	
Oil Pressure	Gauge inoperable	
Warning Lights	Inoperable	
Limited Function Check	The main components are in place and operational as noted.	

Control Station

Pin connection pivot point wear inspections are limited to sound, sight and feel observations. Dial indicator testing is not performed.

Item	Assessment	Photo
Control Console	No visible damage or missing components	 A photograph of the control console, showing a blue metal frame with various controls and a red emergency stop button. The console is mounted on a lift platform.
Emergency Shut Off Switch	Operational	 A close-up photograph of the emergency shut off switch, which is a red button with a white label, mounted on a blue metal plate.
Safety Control Hand/Foot Switch	★★★★☆ Operational	 A photograph of the safety control hand/foot switch, which is a black metal plate with a red emergency stop button and a yellow foot pedal, mounted on a blue metal frame.
Function Controls	★★★★☆	 A photograph of the function controls, which are a blue metal plate with various buttons and levers, mounted on a blue metal frame.
Engine Warning Lights	Operational	
Limited Function Check	The main components are in place and operational as noted.	

Engine		
Item	Assessment	Photo
Emission Label		
Blow-by (subjective visual observation)	Cannot obtain	
Starter	Operational	
Fuel System	Operational	
Exhaust System	No visible damage or missing components	
Radiator	☆☆☆☆	
Onboard Generator	Not operationally checked	
Engine - Left Side		

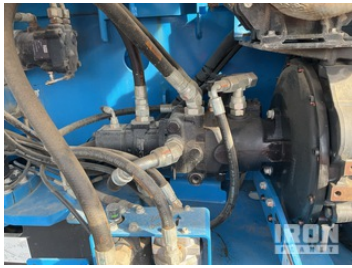
Engine - Right Side		
Limited Function Check	After jump starting, the engine ran.	

Drivetrain

Operational test is limited to low speed in a confined flat area without load. Differential interlocks, full transmission shifting and functionality of all drive axles cannot be fully verified. Inspector listens for abnormal noises, observes leaks and notes physical damage.

Item	Assessment	Photo
Left Front Final Drive	★★★★☆	
Left Front Drive Motor	★★★★☆	
Left Rear Final Drive	★★★★☆	
Left Rear Drive Motor	★★★★☆	
Right Rear Final Drive	★★★★☆	
Right Rear Drive Motor	★★★★☆	

Right Front Final Drive	☆☆☆☆	
Right Front Drive Motor	☆☆☆☆	
Limited Function Check	The drivetrain was operational.	

Hydraulics		
See photos for condition		
Item	Assessment	Photo
Pumps (Hydraulics)	★★★★☆	
Valves	★★★★☆	
Hydraulic Tank	★★★★☆	
Hoses (Hydraulic)	★★★★☆	
Steering Cylinders	★★★★☆	
Boom Lift Cylinder	★★★★☆	

Secondary Boom Cylinder	★★★★☆	
Boom Extension Cylinder	★★★★☆	
Jib Cylinder	★★★★☆	
Basket Tilt Cylinder	★★★★☆	
Basket Rotator Motor	★★★★☆	
Frame Leveling Cylinders	★★★★☆	
Limited Function Check	The hydraulic system was operational.	
Hydraulics #1		

Chassis		
Item	Assessment	Photo
Steering Linkage	★★★★☆	
Frame Condition	★★★★☆	
Brake System	★★★★☆	
Left Front Tire	Cracks	
Left Rear Tire	Cracks, Chunks missing	
Right Rear Tire	Cracks, Chunks missing	
Right Front Tire	Cracks, Chunks missing	

Wheel Condition	No visible damage or missing components	
Turntable Bearing	★★★★☆	
Bottom Covers		
Swing Motor	★★★★☆	
Hydraulic Center Swivel	★★★★☆	
Boom Condition	★★★★☆	
Left Side of Boom		

Right Side of Boom		
Boom Wear Guides	★★★★☆	
Jib Condition	★★★★☆	
Cable Tray Ladder		
Work Basket		
Chassis #1		
Chassis #2		

Buy this item and view more at www.ironplanet.com or call 800-211-3983

IronPlanet , Inc. © 2012 All Rights Reserved