



Buy this item and view more at www.ironplanet.com or call 800-211-3983

Item #14251161 - 2006 JLG 660SJ 4WD Diesel Telescopic Boom Lift



Item Details:

- Features: 66 ft Max Platform Height, 500 lb Max Weight Capacity, Jib, Power to Platform, Onboard Generator, 2006 US EPA Label, Deutz F4M2011 4 Cylinder 48.5 kW 3.1 L Diesel Engine, 15-19.5 NHS Tires
- Meter Reading: 1,070 Hours
- Serial # : 0300095334
- Inspection Completed: 11/9/25

Shipping Details:

- Location Illinois (Grundy County)
- Loading Dock Available: No
- Pickup Hours: null-null
- You will need a copy of your IronPlanet Item Release to pick the item up. You must call at least 24 hours in advance to schedule pickup

Inspection Report

Note: This condition inspection report is the result of an impartial, systematic, documented process focused on the establishment of the general, overall mechanical condition of a piece of equipment, or of a vehicle, at a specific time. The purpose of the inspection is to establish the "as is" operational capability of the machine. It is not a performance or load test on the item.

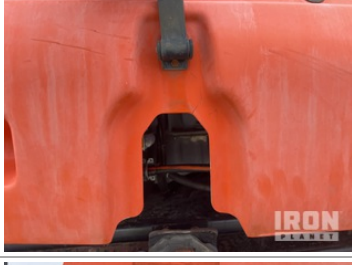
Inspection Ratings Key

★★★★	Limited use or recently replaced. Free of visible wear or defects.
★★★☆☆	Performs within the tolerances expected for age and type of item
★★☆☆☆	Although performing, shows indication of needing repair or replacement
★☆☆☆☆	Needs immediate repair/replacement. Requires work if it is to perform as expected

General Appearance

Item	Assessment	Photo
Picture, Left Front Corner		
Picture, Left Rear Corner		
Picture, Right Rear Corner		
Picture, Right Front Corner		

Serial Number / VIN	0300095334	
Hour Meter / Odometer	1070 hrs	
Paint	No visible damage	
Body Panels	Engine compartment door damaged, Hydraulic compartment door damaged	
Basket / Safety Railing	Left railing bent, Right railing bent, Front railing bent, Rear railing bent	
General Appearance #1		
General Appearance #2		

General Appearance #3		 A rear view of the orange JLG 660SJ 4WD Diesel Telescopic Boom Lift. The lift is parked on a gravel lot, and its telescopic boom is extended upwards. The JLG logo and model number are visible on the rear panel.
General Appearance #4		 A side view of the orange JLG 660SJ 4WD Diesel Telescopic Boom Lift. The lift is parked on a gravel lot, and its telescopic boom is extended upwards. The JLG logo and model number are visible on the side panel.
General Appearance #5		 A front view of the orange JLG 660SJ 4WD Diesel Telescopic Boom Lift. The lift is parked on a gravel lot, and its telescopic boom is extended upwards. The JLG logo and model number are visible on the front panel.
General Appearance #6		 A close-up view of the orange body of the JLG 660SJ 4WD Diesel Telescopic Boom Lift. The image shows a section of the lift's frame with some wear and a black hose attached to it.
General Appearance #7		 A close-up view of the orange body of the JLG 660SJ 4WD Diesel Telescopic Boom Lift. The image shows a section of the lift's frame with some wear and a black hose attached to it.
General Appearance #8		 A close-up view of the orange body of the JLG 660SJ 4WD Diesel Telescopic Boom Lift. The image shows a section of the lift's frame with some wear and a black hose attached to it.
General Appearance #9		 A close-up view of the orange body of the JLG 660SJ 4WD Diesel Telescopic Boom Lift. The image shows a section of the lift's frame with some wear and a black hose attached to it.

General Appearance #10		 A photograph showing the front of an orange JLG 660SJ 4WD Diesel Telescopic Boom Lift. The lift is parked on a gravel lot, and its telescopic boom is extended upwards. The JLG logo is visible on the side of the platform.
General Appearance #11		 A photograph showing the side of the JLG 660SJ 4WD Diesel Telescopic Boom Lift. The lift is parked on a gravel lot, and its telescopic boom is extended upwards. The JLG logo is visible on the side of the platform.
General Appearance #12		 A photograph showing the rear of the JLG 660SJ 4WD Diesel Telescopic Boom Lift. The lift is parked on a gravel lot, and its telescopic boom is extended upwards. The JLG logo is visible on the side of the platform.
General Appearance #13		 A close-up photograph of the platform of the JLG 660SJ 4WD Diesel Telescopic Boom Lift. The platform is made of metal grating and has the JLG logo on the side.
General Appearance #14		 A close-up photograph of the platform of the JLG 660SJ 4WD Diesel Telescopic Boom Lift. The platform is made of metal grating and has the JLG logo on the side.

Safety		
Item	Assessment	Photo
Travel Alarm	Operational	
Horn	Operational	
Swing Brake	Operational	
Current Safety Manual	Yes	
Current Operator/Maintenance Manual	Yes	
ANSI Guidelines	Yes	

Control Station Ground		
Item	Assessment	Photo
Function Controls	★★★★☆	
Oil Pressure	The fault indicator shuts off after the engine oil pressure rises.	
Warning Lights	Operational	
Limited Function Check	The main components are in place and operational as noted.	

Control Station

Pin connection pivot point wear inspections are limited to sound, sight and feel observations. Dial indicator testing is not performed.

Item	Assessment	Photo
Control Console	No visible damage or missing components	
Emergency Shut Off Switch	Operational	
Safety Control Hand/Foot Switch	★★★★☆ Operational	
Function Controls	★★★☆☆ adjustable speed dial inop goes slow only. inoperable	
Engine Warning Lights	Operational	
Limited Function Check	The main components are in place and operational as noted.	

Engine		
Item	Assessment	Photo
Emission Label		
Blow-by (subjective visual observation)	Too small	
Starter	Operational	
Fuel System	Operational	
Exhaust System	No visible damage or missing components	
Onboard Generator	Not operationally checked	
Engine - Left Side		
Engine - Right Side		
Limited Function Check	The engine started and ran.	

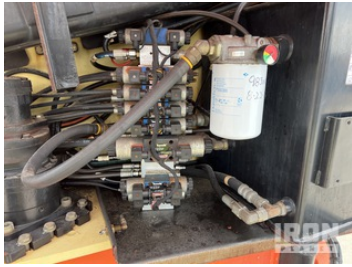
Engine #1



Drivetrain

Operational test is limited to low speed in a confined flat area without load. Differential interlocks, full transmission shifting and functionality of all drive axles cannot be fully verified. Inspector listens for abnormal noises, observes leaks and notes physical damage.

Item	Assessment	Photo
Left Front Drive Motor	★★★★☆	
Left Rear Drive Motor	★★★★☆	
Right Rear Drive Motor	★★★★☆	
Right Front Drive Motor	★★★★☆	
Limited Function Check	The drivetrain was operational.	

Hydraulics		
See photos for condition		
Item	Assessment	Photo
Pumps (Hydraulics)	★★★★☆	
Valves	★★★★☆	
Hydraulic Tank	★★★★☆	
Hoses (Hydraulic)	★★★★☆	
Steering Cylinders	★★★★☆ Right side cylinder seepage	
Boom Lift Cylinder	★★★★☆	
Boom Extension Cylinder	★★★★☆	

Jib Cylinder	★★★★☆	
Basket Tilt Cylinder	★★★★☆	
Basket Rotator Motor	★★★★☆	
Frame Leveling Cylinders	★★★★☆	
Limited Function Check	The hydraulic system was operational.	
Hydraulics #1		
Hydraulics #2		
Hydraulics #3		

Hydraulics #4		
Hydraulics #5		
Hydraulics #6		

Chassis		
Item	Assessment	Photo
Steering Linkage	★★★☆☆	
Frame Condition	★★★☆☆	
Left Front Tire	Cracks, Chunks missing, Tears	
Left Rear Tire	Cracks, Chunks missing, Tears	
Right Rear Tire	Cracks, Chunks missing, Tears	
Right Front Tire	Cracks, Chunks missing, Tears	
Wheel Condition	No visible damage or missing components	

Turntable Bearing	★★★★☆	
Swing Motor	★★★★☆	
Hydraulic Center Swivel	★★★☆☆ Dripping leak	
Boom Condition	★★★★☆	
Left Side of Boom		
Right Side of Boom		
Boom Wear Guides	★★★★☆	

Jib Condition	★★★☆☆	
Cable Tray Ladder		
Work Basket		
Chassis #1		
Chassis #2		
Chassis #3		
Chassis #4		

Chassis #5		
Chassis #6		
Chassis #7		
Chassis #8		

Buy this item and view more at www.ironplanet.com or call 800-211-3983

IronPlanet, Inc. © 2012 All Rights Reserved