



Buy this item and view more at www.ironplanet.com or call 800-211-3983

Item #13811350 - 2016 JLG 600S 4WD Diesel Telescopic Boom Lift



Item Details:

- Features: 60 ft Max Platform Height, 1000 lb Max Weight Capacity, Power to Platform, Onboard Generator, 2016 US EPA Label, Deutz TD 2.9 L4 4 Cylinder 67 hp 2.92 L Diesel Engine, 39X15-22.5 Foam-Filled Tires
- Meter Reading: 5,371 Hours
- Serial # : 0300219467
- Inspection Completed: 9/29/25

Shipping Details:

- Location Georgia (Atlanta area)
- Loading Dock Available: No
- Pickup Hours: null-null
- You will need a copy of your IronPlanet Item Release to pick the item up. Please call one day in advance to schedule pickup.

Inspection Report

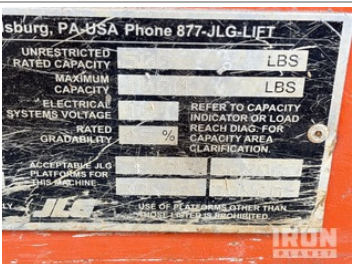
Note: This condition inspection report is the result of an impartial, systematic, documented process focused on the establishment of the general, overall mechanical condition of a piece of equipment, or of a vehicle, at a specific time. The purpose of the inspection is to establish the "as is" operational capability of the machine. It is not a performance or load test on the item.

Inspection Ratings Key	
★★★★	Limited use or recently replaced. Free of visible wear or defects.
★★★☆☆	Performs within the tolerances expected for age and type of item
★★☆☆☆	Although performing, shows indication of needing repair or replacement
★☆☆☆☆	Needs immediate repair/replacement. Requires work if it is to perform as expected

General Appearance

Item	Assessment	Photo
Picture, Left Front Corner		
Picture, Left Rear Corner		
Picture, Right Rear Corner		
Picture, Right Front Corner		

Serial Number / VIN	0300219467	
CE Mark	No CE mark found	
Hour Meter / Odometer	5371 hrs	
Paint	Concrete residue	
Body Panels	Engine compartment door damaged, Hydraulic compartment door damaged	
Basket / Safety Railing	No visible damage or missing components	
General Appearance #1		
General Appearance #2		

General Appearance #3		
General Appearance #4		
General Appearance #5		
General Appearance #6		

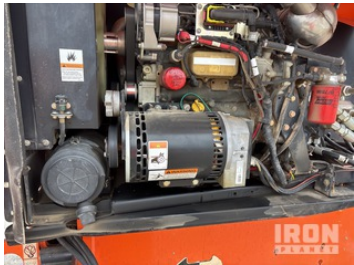
Safety		
Item	Assessment	Photo
Travel Alarm	Operational	
Horn	Operational	
Swing Brake	Operational	
Current Safety Manual	No	
Current Operator/Maintenance Manual	Yes	
ANSI Guidelines	Yes	

Control Station Ground		
Item	Assessment	Photo
Function Controls	★★★★☆	
Oil Pressure	The fault indicator shuts off after the engine oil pressure rises.	
Warning Lights	Operational	
Limited Function Check	The main components are in place and operational as noted., Doesn't have a key, used personal key to perform inspection	

Control Station

Pin connection pivot point wear inspections are limited to sound, sight and feel observations. Dial indicator testing is not performed.

Item	Assessment	Photo
Control Console	Material buildup Concrete residue	
Emergency Shut Off Switch	Operational	
Safety Control Hand/Foot Switch	★★★★☆	
Function Controls	★★★★☆ Damaged boots	
Engine Warning Lights	Operational, Difficulty seeing warning lights on start	
Limited Function Check	The main components are in place and operational as noted.	

Engine		
Item	Assessment	Photo
Emission Label		
Blow-by (subjective visual observation)	No noticeable vapor or pressure	
Starter	Operational	
Fuel System	Operational	
Exhaust System	No visible damage or missing components	
Radiator	★★★★☆	
Oil Leaks	Oil dripping from behind the onboard generator	
Fuel Leaks	No dripping leaks	
Cooling System Leaks	No dripping leaks	
Onboard Generator	Not operationally checked	

Engine - Left Side		
Limited Function Check	The engine started and ran. Loose battery negative terminal. Possible electrical connection issues as the lift shut down and had to turn the switch on /off multiple times to re-start the engine.	
Engine #1		

Drivetrain

Operational test is limited to low speed in a confined flat area without load. Differential interlocks, full transmission shifting and functionality of all drive axles cannot be fully verified. Inspector listens for abnormal noises, observes leaks and notes physical damage.

Item	Assessment	Photo
Left Front Final Drive	★★★★☆	 A close-up photograph of the left front final drive assembly, showing a black tire mounted on a white rim with a central hub and bolts.
Left Front Drive Motor	★★★★☆	 A close-up photograph of the left front drive motor, showing a white hydraulic cylinder and a black hose connected to a red metal frame.
Left Rear Final Drive	★★★★☆	 A close-up photograph of the left rear final drive assembly, showing a black tire mounted on a white rim with a central hub and bolts.
Left Rear Drive Motor	★★★★☆	 A close-up photograph of the left rear drive motor, showing a white hydraulic cylinder and a black hose connected to a red metal frame.
Right Rear Final Drive	★★★★☆	 A close-up photograph of the right rear final drive assembly, showing a black tire mounted on a white rim with a central hub and bolts.
Right Rear Drive Motor	★★★☆☆ Dripping leak	 A close-up photograph of the right rear drive motor, showing a white hydraulic cylinder and a black hose connected to a red metal frame, with a visible dripping leak from the motor.

Right Front Final Drive	☆☆☆☆	
Right Front Drive Motor	☆☆☆☆	
Limited Function Check	The drivetrain was operational.	

Hydraulics		
See photos for condition		
Item	Assessment	Photo
Pumps (Hydraulics)	★★★★☆	
Valves	★★★★☆	
Hydraulic Tank	★★★★☆	
Hoses (Hydraulic)	★★★☆☆ Cracked rubber on multiple hoses	
Steering Cylinders	★★★☆☆ Dripping leak on the right cylinder	
Boom Lift Cylinder	★★★★☆	
Boom Extension Cylinder	★★★★☆	

Basket Tilt Cylinder	★ ★ ★ ☆	
Basket Rotator Motor	★ ★ ★ ☆	
Frame Leveling Cylinders	★ ★ ★ ☆	
Limited Function Check	The hydraulic system was operational.	
Hydraulics #1		

Chassis		
Item	Assessment	Photo
Steering Linkage	★★★★☆	
Frame Condition	★★★★☆	
Brake System	★★★★☆ The brake system functioned, stopping and holding the machine.	
Left Front Tire	Cracks, Chunks missing, Tears	
Left Rear Tire	Cracks, Chunks missing, Tears	
Right Rear Tire	Cracks, Chunks missing, Tears	
Right Front Tire	Cracks, Chunks missing, Tears	

Wheel Condition	No visible damage or missing components	
Turntable Bearing	★★★★☆	
Swing Motor	★★★★☆	
Hydraulic Center Swivel	★★★★☆	
Boom Condition	★★★★☆	
Left Side of Boom		
Right Side of Boom		

Boom Wear Guides	★ ★ ☆ ☆ Cracked	
Cable Tray Ladder		
Work Basket		
Chassis #1		
Chassis #2		
Chassis #3		
Chassis #4		

Chassis #5		
Chassis #6		
Chassis #7		
Chassis #8		
Chassis #9		
Chassis #10		
Chassis #11		

Chassis #12		
Chassis #13		
Chassis #14		
Chassis #15		

Buy this item and view more at www.ironplanet.com or call 800-211-3983

IronPlanet , Inc. © 2012 All Rights Reserved