



Buy this item and view more at www.ironplanet.com or call 800-211-3983

Item #14251150 - 2007 Genie S40 4WD Gasoline Telescopic Boom Lift



Item Details:

- Features: 40 ft Max Platform Height, 500 lb Max Weight Capacity, Power to Platform, 2006 US EPA Label, Engine Distributors Inc. DSG423 4 Cylinder 75 hp 2.3 L Gasoline Engine, 12-16.5 Tires
- Meter Reading: 2,952 Hours
- Serial # : S4007-11879
- Inspection Completed: 12/16/25

Shipping Details:

- Location Illinois (Grundy County)
- Loading Dock Available: No
- Pickup Hours: null-null
- You will need a copy of your IronPlanet Item Release to pick the item up. You must call at least 24 hours in advance to schedule pickup

Inspection Report

Note: This condition inspection report is the result of an impartial, systematic, documented process focused on the establishment of the general, overall mechanical condition of a piece of equipment, or of a vehicle, at a specific time. The purpose of the inspection is to establish the "as is" operational capability of the machine. It is not a performance or load test on the item.

Inspection Ratings Key

★★★★	Limited use or recently replaced. Free of visible wear or defects.
★★★☆☆	Performs within the tolerances expected for age and type of item
★★☆☆☆	Although performing, shows indication of needing repair or replacement
★☆☆☆☆	Needs immediate repair/replacement. Requires work if it is to perform as expected

General Appearance

Item	Assessment	Photo
Picture, Left Front Corner		
Picture, Left Rear Corner		
Picture, Right Rear Corner		
Picture, Right Front Corner		

Serial Number / VIN	S4007-11879	
CE Mark	No CE mark found	
Hour Meter / Odometer	2952 hrs	
Paint	Other unknown material Rust damage. Appears to be silicone or something similar on the upper controls.	
Body Panels	No visible damage or missing components	
Basket / Safety Railing	Front railing bent	
General Appearance #1		
General Appearance #2		

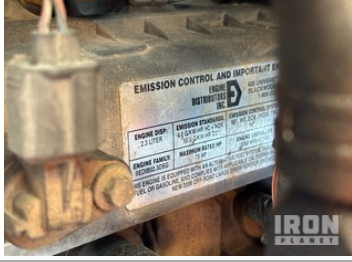
Safety		
Item	Assessment	Photo
Travel Alarm	Inoperable	
Horn	Operational	
Current Safety Manual	No	
Current Operator/Maintenance Manual	No	
ANSI Guidelines	No	

Control Station Ground		
Item	Assessment	Photo
Function Controls	★★★★☆	
Oil Pressure	The fault indicator shuts off after the engine oil pressure rises.	
Warning Lights	Operational	
Limited Function Check	The main components are in place and operational as noted.	

Control Station

Pin connection pivot point wear inspections are limited to sound, sight and feel observations. Dial indicator testing is not performed.

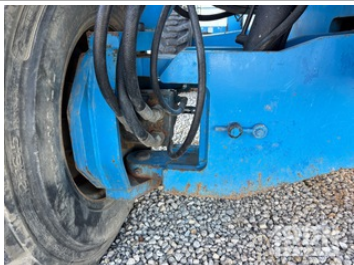
Item	Assessment	Photo
Control Console	No visible damage or missing components	
Emergency Shut Off Switch	Operational	
Safety Control Hand/Foot Switch	★★★★☆ Operational	
Function Controls	★★★☆☆ Left stick boot is missing.	
Engine Warning Lights	Operational	
Limited Function Check	The main components are in place and operational as noted.	

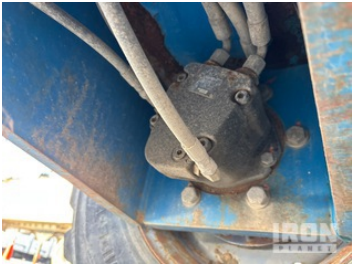
Engine		
Item	Assessment	Photo
Engine #1		
Engine #2		
Engine #3		
Emission Label		
Starter	Operational	
Fuel System	Operational	
Exhaust System	No visible damage or missing components	

Radiator	★★★★☆	
Oil Leaks	No dripping leaks	
Fuel Leaks	No dripping leaks	
Cooling System Leaks	No dripping leaks	
Engine - Right Side		
Limited Function Check	The engine started and ran.	

Drivetrain

Operational test is limited to low speed in a confined flat area without load. Differential interlocks, full transmission shifting and functionality of all drive axles cannot be fully verified. Inspector listens for abnormal noises, observes leaks and notes physical damage.

Item	Assessment	Photo
Left Front Final Drive	★★★★☆	
Left Front Drive Motor	★★★★☆	
Left Rear Final Drive	★★★★☆	
Left Rear Drive Motor	★★★★☆	
Right Rear Final Drive	★★★★☆	
Right Rear Drive Motor	★★★★☆	

Right Front Final Drive	☆☆☆☆	
Right Front Drive Motor	☆☆☆☆	
Limited Function Check	The drivetrain was operational.	

Hydraulics		
See photos for condition		
Item	Assessment	Photo
Pumps (Hydraulics)	★★★★☆	
Valves	★★★★☆	
Hydraulic Tank	★★★★☆	
Hoses (Hydraulic)	★★★★☆	
Steering Cylinders	★★★★☆	
Boom Lift Cylinder	★★★★☆	

Secondary Boom Cylinder	☆☆☆☆	
Boom Extension Cylinder	☆☆☆☆	
Basket Tilt Cylinder	☆☆☆☆	
Basket Rotator Motor	☆☆☆☆	
Frame Leveling Cylinders	☆☆☆☆	
Limited Function Check	The hydraulic system was operational.	

Chassis		
Item	Assessment	Photo
Steering Linkage	★★★★☆	
Frame Condition	★★★★☆	
Brake System	★★★★☆ The brake system functioned, stopping and holding the machine.	
Left Front Tire	Cracks, Chunks missing, Tears	
Left Rear Tire	Cracks, Tears	
Right Rear Tire	Cracks, Tears	

Right Front Tire	Cracks, Chunks missing, Tears	
Wheel Condition	No visible damage or missing components	
Turntable Bearing	★★★★☆	
Bottom Covers		
Swing Motor	★★★★☆	
Boom Condition	★★★★☆	
Left Side of Boom		

Right Side of Boom		 A photograph showing the right side of the blue telescopic boom of a Genie S40 lift. The boom is extended, and a large black trailer is visible in the background. The ground is covered in snow. An "IRON PLANET" watermark is visible in the bottom right corner.
Boom Wear Guides	☆☆☆☆	 A close-up photograph of the boom wear guides on the blue telescopic boom. The guides are visible as a series of parallel lines along the length of the boom. An "IRON PLANET" watermark is visible in the bottom right corner.
Work Basket		 A photograph of the work basket of the Genie S40 lift. The basket is blue and has a metal frame. It is positioned on a snowy surface. An "IRON PLANET" watermark is visible in the bottom right corner.

Buy this item and view more at www.ironplanet.com or call 800-211-3983

IronPlanet, Inc. © 2012 All Rights Reserved