



Buy this item and view more at www.ironplanet.com or call 800-211-3983

Item #14340499 - 2017 Skyjack SJ66T 4WD Diesel Telescopic Boom Lift



Item Details:

- Features: 66 ft Max Platform Height, 500 lb Max Weight Capacity, Jib, Power to Platform, 2016 US EPA Label, Deutz TD 2.9 L4 4 Cylinder 74 hp 2.925 L Diesel Engine, 385/65D19.5 Foam-Filled Tires
- Meter Reading: 3,062 Hours
- Serial # : 97002094
- Inspection Completed: 11/25/25

Shipping Details:

- Location Georgia (Atlanta area)
- Loading Dock Available: No
- Pickup Hours: null-null
- You will need a copy of your IronPlanet Item Release to pick the item up. You must call at least 24 hours in advance to schedule pickup

Inspection Report

Note: This condition inspection report is the result of an impartial, systematic, documented process focused on the establishment of the general, overall mechanical condition of a piece of equipment, or of a vehicle, at a specific time. The purpose of the inspection is to establish the "as is" operational capability of the machine. It is not a performance or load test on the item.

Inspection Ratings Key

★★★★	Limited use or recently replaced. Free of visible wear or defects.
★★★☆☆	Performs within the tolerances expected for age and type of item
★★☆☆☆	Although performing, shows indication of needing repair or replacement
★☆☆☆☆	Needs immediate repair/replacement. Requires work if it is to perform as expected

General Appearance

Item	Assessment	Photo
Picture, Left Front Corner		
Picture, Left Rear Corner		
Picture, Right Rear Corner		
Picture, Right Front Corner		

Serial Number / VIN	97002094	
CE Mark	No CE mark found	
Hour Meter / Odometer	3062 hrs	
Paint	No visible damage	
Body Panels	Engine compartment door damaged	
Basket / Safety Railing	No visible damage or missing components	

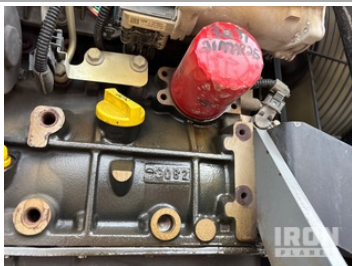
Safety		
Item	Assessment	Photo
Travel Alarm	Inoperable	
Horn	Operational	
Swing Brake	Operational	
Current Safety Manual	Yes	
Current Operator/Maintenance Manual	Yes	
ANSI Guidelines	No	
Safety #1		

Control Station Ground		
Item	Assessment	Photo
Function Controls	★★★★☆	
Oil Pressure	Gauge inoperable Fault light is not flashing during start	
Warning Lights	Inoperable, Warning lights are not flashing during start cycle	
Limited Function Check	The main components are in place and operational as noted.	

Control Station

Pin connection pivot point wear inspections are limited to sound, sight and feel observations. Dial indicator testing is not performed.

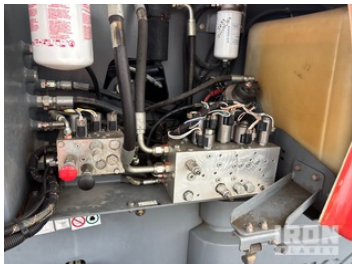
Item	Assessment	Photo
Control Console	No visible damage or missing components	
Emergency Shut Off Switch	Operational	
Safety Control Hand/Foot Switch	★★★★☆ Operational	
Function Controls	★★★☆☆ Damaged boots, Controls stick, Start switch sticks, jib and few basket functions did not function unless I switch back and forth between travel speeds	
Engine Warning Lights	Operational	
Limited Function Check	The main components are in place and operational as noted.	
Control Station #1		

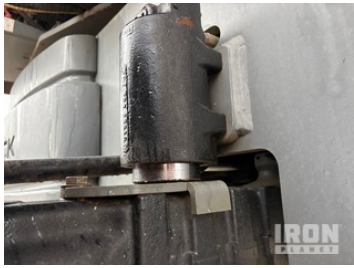
Engine		
Item	Assessment	Photo
Emission Label		
Starter	Operational	
Fuel System	Operational	
Exhaust System	No visible damage or missing components	
Radiator	★★★★☆	
Oil Leaks	Oil filter	
Fuel Leaks	No dripping leaks	
Cooling System Leaks	No dripping leaks	
Engine - Right Side		
Limited Function Check	The engine started and ran.	

Drivetrain

Operational test is limited to low speed in a confined flat area without load. Differential interlocks, full transmission shifting and functionality of all drive axles cannot be fully verified. Inspector listens for abnormal noises, observes leaks and notes physical damage.

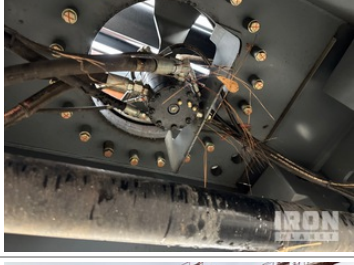
Item	Assessment	Photo
Front Center Drive Motor	★★★★☆	
Rear Center Drive Motor	★★★★☆	
Limited Function Check	The drivetrain was operational.	
Drivetrain #1		
Drivetrain #2		

Hydraulics		
See photos for condition		
Item	Assessment	Photo
Pumps (Hydraulics)	★★★★☆	
Valves	★★★★☆	
Hydraulic Tank	★★★★☆	
Hoses (Hydraulic)	★★★★☆	
Steering Cylinders	★★★★☆	
Boom Lift Cylinder	★★★★☆	

Secondary Boom Cylinder	★★★★☆	
Boom Extension Cylinder	★★★★☆	
Jib Cylinder	★★★★☆	
Basket Tilt Cylinder	★★★★☆	
Basket Rotator Motor	★★★★☆	
Frame Leveling Cylinders	★★★★☆	
Limited Function Check	The hydraulic system was operational.	
Hydraulics #1		

Chassis		
Item	Assessment	Photo
Chassis #1		
Chassis #2		
Chassis #3		
Chassis #4		
Chassis #5		
Chassis #6		

Chassis #7		
Chassis #8		
Steering Linkage	★★☆☆ Damaged boots	
Frame Condition	★★★★	
Brake System	★★★★ The brake system functioned, stopping and holding the machine.	
Left Front Tire	Cracks, Chunks missing, Tears	
Left Rear Tire	Cracks, Chunks missing, Tears	

Right Rear Tire	Cracks, Chunks missing, Tears	
Right Front Tire	Cracks, Chunks missing, Tears	
Wheel Condition	No visible damage or missing components	
Turntable Bearing	★★★★☆	
Swing Motor	★★★★☆	
Hydraulic Center Swivel	★★★★☆	
Boom Condition	★★★★☆	

Left Side of Boom		
Right Side of Boom		
Boom Wear Guides	☆☆☆☆	
Jib Condition	☆☆☆☆	
Cable Tray Ladder		
Work Basket		

Buy this item and view more at www.ironplanet.com or call 800-211-3983

IronPlanet, Inc. © 2012 All Rights Reserved