



Buy this item and view more at www.ironplanet.com or call 800-211-3983

Item #14094975 - 2018 Genie GTH-1056 Telehandler



Item Details:

- Features: Enclosed Cab, 56 ft Max Lift Height, 10000 lb Max Lift Capacity, Requires Diesel Exhaust Fluid, 72 in Forks, Manual Coupler, Outriggers, Frame Leveling, Auxiliary Hydraulic Plumbing
- Meter Reading: 2,271 Hours
- Serial # : GTH10E-12890
- Inspection Completed: 9/25/25

Shipping Details:

- Location Ohio (Dayton-Springfield area)
- Loading Dock Available: No
- Pickup Hours: null-null
- You will need a copy of your IronPlanet Item Release to pick the item up. You must call at least 24 hours in advance to schedule pickup

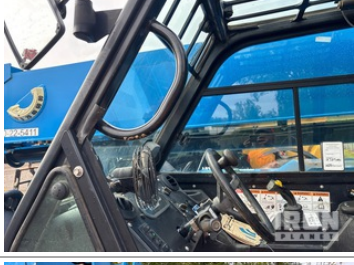
Inspection Report

Note: This condition inspection report is the result of an impartial, systematic, documented process focused on the establishment of the general, overall mechanical condition of a piece of equipment, or of a vehicle, at a specific time. The purpose of the inspection is to establish the "as is" operational capability of the machine. It is not a performance or load test on the item.

Inspection Ratings Key	
★★★★	Limited use or recently replaced. Free of visible wear or defects.
★★★☆☆	Performs within the tolerances expected for age and type of item
★★☆☆☆	Although performing, shows indication of needing repair or replacement
★☆☆☆☆	Needs immediate repair/replacement. Requires work if it is to perform as expected

General Appearance

Item	Assessment	Photo
Picture, Left Front Corner		
Picture, Left Rear Corner		
Picture, Right Rear Corner		
Picture, Right Front Corner		

Serial Number / VIN	GTH10E-12890	
Paint	No visible damage	
Body Panels	No visible damage or missing components Missing bolt on radiator cover	
Fenders	No visible damage or missing components.	
Steps	No visible damage or missing components	
Hand Rails	No visible damage or missing components	
Exterior Lights	All lights operational	

General Appearance #1		
General Appearance #2		
General Appearance #3		
General Appearance #4		
General Appearance #5		
General Appearance #6		
General Appearance #7		

General Appearance #8

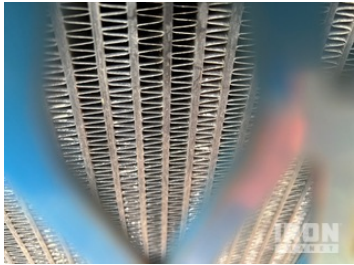


Safety		
Item	Assessment	Photo
Travel Alarm	Operational	
Horn	Operational	
Seat Belts	Operational	
Safety Lock Out/Stop	Operational	
Current Safety Manual	Yes	
Current Operator/Maintenance Manual	No	
Safety #1		

Control Station		
Item	Assessment	Photo
Control Station #1		
Control Station #2		
Control Station #3		
Control Station #4		
Control Station #5		
Control Station #6		

Seat/Armrests	Operator seat cover torn	
Glass	No visible damage or missing components	
Mirrors	Damaged shell	
Cab Door	No visible damage or missing components	
Steering Control	★★★★☆	
Hydraulic Controls	★★★★☆	
Drivetrain Controls	★★★★☆	

Transmission Disconnect Control	★★★★☆	
Load Charts	Chart book in cab	
Engine Oil Pressure	The fault indicator shuts off after the engine oil pressure rises.	
Warning Lights	Operational	
Gauges	Operational	
Hour Meter / Odometer	2271 hrs	
Heater	Operational	
Limited Function Check	The main components are in place and operational as noted.	

Engine		
Item	Assessment	Photo
Engine	No US EPA Label Present Requires Diesel Exhaust Fluid, Unable to find tag on top of engine	
Blow-by (subjective visual observation)	Recirculating system	
Starter	Operational	
Exhaust System	No visible damage or missing components	
Radiator	★★★★☆	
Oil Leaks	No dripping leaks	
Fuel Leaks	No dripping leaks	
Cooling System Leaks	No dripping leaks	
Engine - Left Side		
Engine - Right Side		
DEF / AdBlue Tank		
Limited Function Check	The engine started and ran.	

Drivetrain

Operational test is limited to low speed in a confined flat area without load. Differential interlocks, full transmission shifting and functionality of all drive axles cannot be fully verified. Inspector listens for abnormal noises, observes leaks and notes physical damage.

Item	Assessment	Photo
Transmission	★★☆☆ Operational	
Transfer Case / Drop Box	★★☆☆ Operational	
Front Drive Axle	★★☆☆	
Front Axle Oscillating Pin	★★☆☆	
Rear Drive Axle	★★☆☆	
Rear Axle Oscillating Pin	★★☆☆	

Final Drives	★★★★☆	
Limited Function Check	The drivetrain was operational.	
Drivetrain #1		
Drivetrain #2		
Drivetrain #3		
Drivetrain #4		
Drivetrain #5		

Hydraulics		
Item	Assessment	Photo
Pumps (Hydraulics)	★★★★☆	
Valves	★★★★☆	
Hydraulic Tank	★★★★☆	
Hoses (Hydraulics)	★★★★☆	
Auxiliary Hydraulic Plumbing	Not operationally checked, Front	
Boom Lift Cylinder(s)	★★★★☆	

Telescopic Boom Cylinders	★★★★☆	
Carriage Tilt Cylinder	★★★★☆	
Frame Leveling Cylinders	★★★★☆	
Outrigger Cylinders	★★★★☆	
Steering Cylinders	★★★★☆	
Limited Function Check	The hydraulic system was operational.	
Hydraulics #1		
Hydraulics #2		

Hydraulics #3		
Hydraulics #4		
Hydraulics #5		
Hydraulics #6		
Hydraulics #7		
Hydraulics #8		

Chassis

IronPlanet pin connection pivot point wear inspections are limited to sound, sight and feel observations. Dial indicator testing is not performed.

Item	Assessment	Photo
Chassis #1		
Chassis #2		
Chassis #3		
Chassis #4		
Chassis #5		
Chassis #6		

Chassis #7		
Chassis #8		
Chassis #9		
Chassis #10		
Boom Condition	★★★★☆	
Left Side of Boom		
Right Side of Boom		

Chain / Tensioners	☆☆☆☆	
Rollers and Guides	☆☆☆☆	
Boom Wear Guides	☆☆☆☆	
Outriggers	☆☆☆☆	

Telehandler*

IronPlanet pin connection pivot point wear inspections are limited to sound, sight and feel observations. Dial indicator testing is not performed.

Item	Assessment	Photo
Steering Linkage	★★★★☆	
Frame Condition	★★★★☆	
Limited Function Check	The main chassis components functioned during a limited check.	
Master Cylinder	★★★★☆	
Brake Control	★★★★☆	
Brake Lines/Hoses	★★★★☆	
Park Brake	★★★★☆	
Limited Function Check - Brakes	The service brakes are operational, The park brake is operational.	
Left Front Tire	Size: 14.00-24 Brand: Solid Boss Model: TH Tread Depth: 64/32	

Left Rear Tire	Size: 14.00-24 Brand: Solid Boss Model: TH Tread Depth: 64/32	
Right Rear Tire	Size: 14.00-24 Brand: Solid Boss Model: TH Tread Depth: 64/32	
Right Front Tire	Size: 14.00-24 Brand: Solid Boss Model: TH Tread Depth: 64/32	
Wheel Condition	No visible damage or missing components	
Telehandler* #1		
Telehandler* #2		
Telehandler* #3		

Telehandler* #4		
Telehandler* #5		
Telehandler* #6		
Telehandler* #7		
Telehandler* #8		
Telehandler* #9		
Telehandler* #10		

Telehandler* #11		
Loader Quick Coupler	Not operationally checked	
Load Back Rest	★★★★ Bent metal	
Forks	★★★★	

Buy this item and view more at www.ironplanet.com or call 800-211-3983

IronPlanet, Inc. © 2012 All Rights Reserved