



Buy this item and view more at www.ironplanet.com or call 800-211-3983

Item #14096212 - 2017 SkyTrak 8042 Telehandler



Item Details:

- Features: Open Operator Station, 42 ft 0 in Max Lift Height, 8000 lb Max Lift Capacity, Tier 4, 60 in Forks, Manual Coupler, Frame Leveling, Auxiliary Hydraulic Plumbing
- Meter Reading: 4,069 Miles
- Serial # : 0160080973
- Inspection Completed: 10/21/25

Shipping Details:

- Location California (Riverside County)
- Loading Dock Available: No
- Pickup Hours: null-null
- You will need a copy of your IronPlanet Item Release to pick the item up. Please call one day in advance to schedule pickup.

Inspection Report

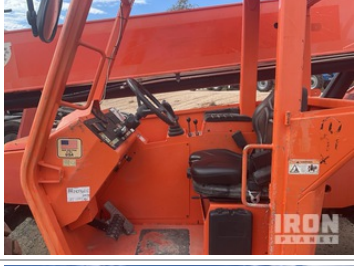
Note: This condition inspection report is the result of an impartial, systematic, documented process focused on the establishment of the general, overall mechanical condition of a piece of equipment, or of a vehicle, at a specific time. The purpose of the inspection is to establish the "as is" operational capability of the machine. It is not a performance or load test on the item.

Inspection Ratings Key

★★★★	Limited use or recently replaced. Free of visible wear or defects.
★★★☆☆	Performs within the tolerances expected for age and type of item
★★☆☆☆	Although performing, shows indication of needing repair or replacement
★☆☆☆☆	Needs immediate repair/replacement. Requires work if it is to perform as expected

General Appearance

Item	Assessment	Photo
Picture, Left Front Corner		
Picture, Left Rear Corner		
Picture, Right Rear Corner		
Picture, Right Front Corner		

Serial Number / VIN	0160080973	
Paint	Damage	
Body Panels	Grille damaged	
Steps	No visible damage or missing components	
Hand Rails	No visible damage or missing components	
Exterior Lights	All lights operational	
General Appearance #1		

General Appearance #2		
General Appearance #3		
General Appearance #4		

Safety		
Item	Assessment	Photo
Travel Alarm	Operational	
Horn	Operational	
Seat Belts	Operational	
Safety Lock Out/Stop	Operational	
Current Safety Manual	No	
Current Operator/Maintenance Manual	No	
Safety #1		

Control Station		
Item	Assessment	Photo
Seat/Armrests	No visible damage or missing components	
Mirrors		
Steering Control	★★★★☆	
Hydraulic Controls	★★★★☆	
Drivetrain Controls	★★☆☆☆ Boot damaged	
Load Charts	Chart book in cab	

Engine Oil Pressure	The fault indicator shuts off after the engine oil pressure rises.	
Warning Lights	Operational	
Gauges	Operational	
Hour Meter / Odometer	4069 mi	
Limited Function Check	The main components are in place and operational as noted.	
Control Station #1		

Engine		
Item	Assessment	Photo
Engine	No US EPA Label Present	
Blow-by (subjective visual observation)	No noticeable vapor or pressure	
Starter	Operational	
Exhaust System	No visible damage or missing components	
Radiator	★★★★☆	
Oil Leaks	No dripping leaks	
Fuel Leaks	No dripping leaks	
Cooling System Leaks	No dripping leaks	
Engine - Left Side		

Engine - Right Side		 A photograph showing the engine compartment of a red telehandler. The engine is visible, along with various hoses and components. The "IRON PLANET" logo is visible on the red metal housing.
Limited Function Check	The engine started and ran.	
Engine #1		 A photograph showing a close-up of the engine area, specifically the cooling fan and surrounding components. A gloved hand is visible, possibly adjusting or inspecting a part. The "IRON PLANET" logo is visible on the red metal housing.

Drivetrain

Operational test is limited to low speed in a confined flat area without load. Differential interlocks, full transmission shifting and functionality of all drive axles cannot be fully verified. Inspector listens for abnormal noises, observes leaks and notes physical damage.

Item	Assessment	Photo
Transmission	★★☆☆ Operational	
Transfer Case / Drop Box	★★☆☆ Operational	
Front Drive Axle	★★☆☆	
Front Axle Oscillating Pin	★★☆☆	
Rear Drive Axle	★★☆☆	
Rear Axle Oscillating Pin	★★☆☆	

Final Drives	★★★★☆	
Limited Function Check	The drivetrain was operational.	
Drivetrain #1		
Drivetrain #2		
Drivetrain #3		
Drivetrain #4		

Hydraulics		
Item	Assessment	Photo
Pumps (Hydraulics)	★★★★☆	
Valves	★★★★☆	
Hydraulic Tank	★★★★☆	
Hoses (Hydraulics)	★★★★☆	
Auxiliary Hydraulic Plumbing	Capped off, Not operationally checked, Front	
Boom Lift Cylinder(s)	★★★★☆	

Telescopic Boom Cylinders	★★★★☆	
Carriage Tilt Cylinder	★★★★☆	
Frame Leveling Cylinders	★★★★☆	
Steering Cylinders	★★★★☆	
Limited Function Check	The hydraulic system was operational.	
Hydraulics #1		
Hydraulics #2		
Hydraulics #3		

Hydraulics #4		
Hydraulics #5		

Chassis

IronPlanet pin connection pivot point wear inspections are limited to sound, sight and feel observations. Dial indicator testing is not performed.

Item	Assessment	Photo
Boom Condition	★★★★☆	
Left Side of Boom		
Right Side of Boom		
Chain / Tensioners	★★★★☆	
Boom Wear Guides	★★★★☆	
Chassis #1		

Telehandler*

IronPlanet pin connection pivot point wear inspections are limited to sound, sight and feel observations. Dial indicator testing is not performed.

Item	Assessment	Photo
Steering Linkage	★★★★☆	
Frame Condition	★★★★☆	
Limited Function Check	The main chassis components functioned during a limited check.	
Master Cylinder	★★★★☆	
Brake Control	★★★★☆	
Brake Lines/Hoses	★★★★☆	
Park Brake	★★★★☆ Stopped from a slow roll	
Limited Function Check - Brakes	The service brakes are operational, The park brake is operational.	
Left Front Tire	Size: 370/75-28 Brand: Maxam Model: MS915 Tread Depth: 31/32	

Left Rear Tire	Size: 370/75-28 Brand: TR Model: Lightning Tread Depth: 27/32	
Right Rear Tire	Size: 370/75-28 Brand: TR Model: Lightning Tread Depth: 27/32	
Right Front Tire	Size: 370/75-28 Brand: Maxam Model: MS915 Tread Depth: 31/32	
Wheel Condition	No visible damage or missing components	
Loader Quick Coupler	★★★★☆ JLG Coupler, Not operationally checked	
Load Back Rest	★★★★☆	
Forks	★★★★☆	

Telehandler* #1		
Telehandler* #2		
Telehandler* #3		
Telehandler* #4		
Telehandler* #5		
Telehandler* #6		
Telehandler* #7		

Telehandler* #8		
-----------------	--	---

Buy this item and view more at www.ironplanet.com or call 800-211-3983

IronPlanet , Inc. © 2012 All Rights Reserved