




Enterprise Equipment Inspection

General Info

Category	Compact Track Loader
Travel System	Track Undercarriage
Comments	
Year	2017
Make	Bobcat
Model	T450
Fleet ID	P13389NF
Serial Number	AUVP13389
Serial Number Plate	
Hour Meter Reading	1,648 Hours
Hour Meter Photo	
Previous Application	Rental

Enterprise Equipment Inspection

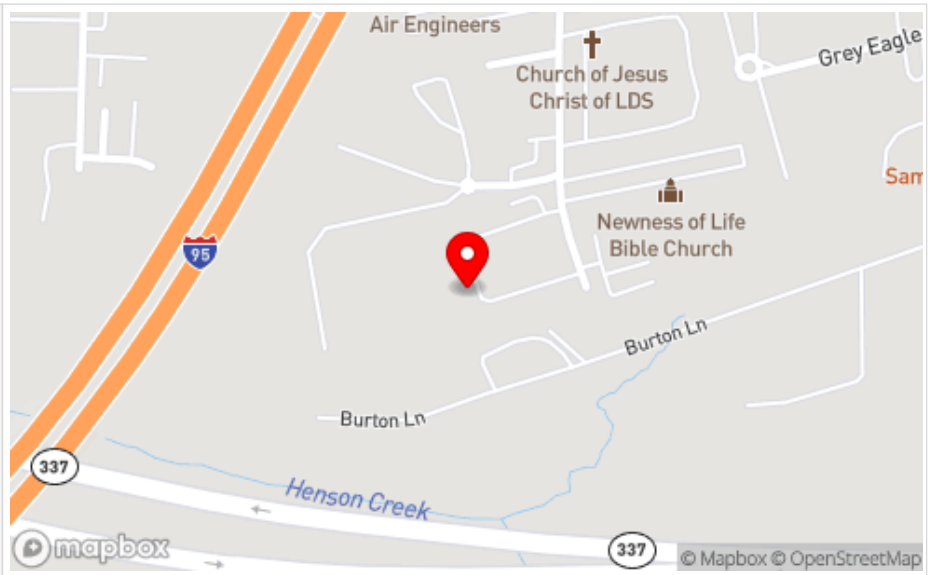Location / GPS	
	Lat: 38.8322008 Long: -76.8686852

Features & Configuration

Control Station Type	Open Cab (OROPS)
Comments	
Drive Type	
Comments	
A/C	
Heat	
Radio	
Reverse Camera	
High Flow	No
Pilot Controls	Yes
Auxiliary Hydraulics	Yes
Quick Coupler	No
Hydraulic Thumb	No
Bucket	Yes
Bucket Size	67"
Blade	No
Forks	No
Outriggers	No
OMM (Operator & Maintenance Manual)	No
Other Configuration Details / Attachment Specs	


Enterprise Equipment Inspection

360 Walkaround Photos

Exterior Walkaround Photos



Enterprise Equipment Inspection

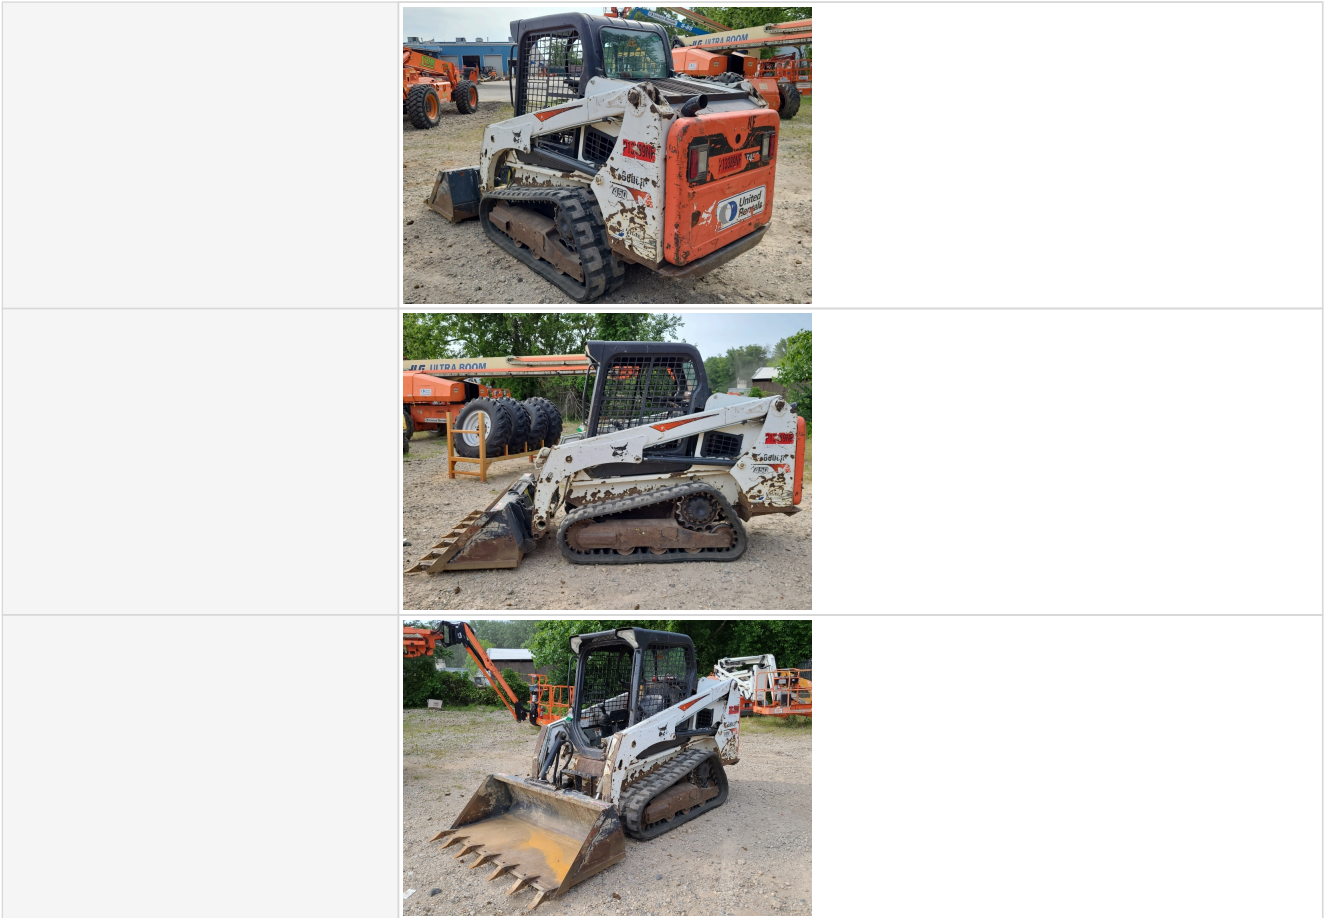

Inspection Rating Criteria

Inspection Rating Criteria	Rating Scale	Explanation
	1 - Service Required	Requires immediate repairs to function as expected.
	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.
	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.
	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.
	5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.

General Appearance






Enterprise Equipment Inspection




Enterprise Equipment Inspection

	 <p>Rear bumper dented at corners</p>
	
Exterior Rating	3 - Normal Wear & Tear
Exterior Comments	Scuff marks all around. Rear bumper corners dented.

Control Station

Control Station	
	
	

Enterprise Equipment Inspection

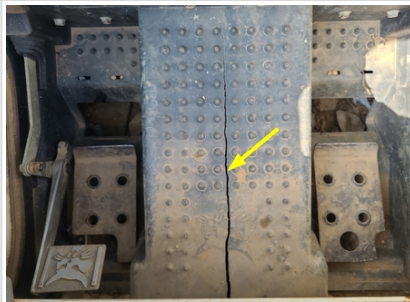

Cab floor cover cracked



Enterprise Equipment Inspection








Enterprise Equipment Inspection

		
		
		
		
Control Station Rating	3 - Normal Wear & Tear	
Control Station Overall Comments	Normal wear and tear interior. Bottom interior cover cracked down the middle.	



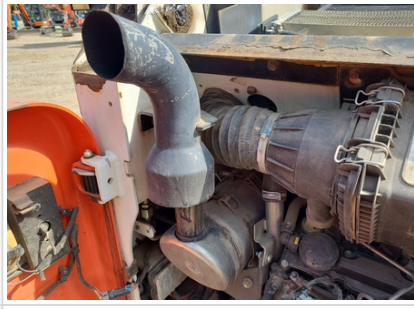


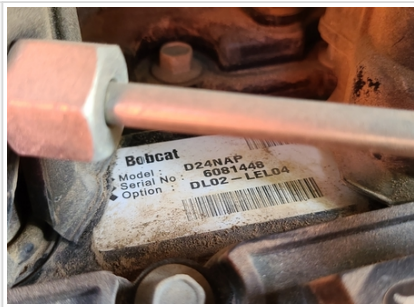Engine

Engine Data Plate		
--------------------------	---	--



Enterprise Equipment Inspection

<p>Engine Compartment</p>	 <p>Bobcat Model: D24NAP Serial No: 6001448 Option: DL02 - LE10A</p>	
	 <p>Bobcat, EMISSION CONTROL GS-2074 E4 24 - 077 030545 L20 010036</p>	
	 <p>Bobcat, EMISSION CONTROL INFORMATION THIS ENGINE MEETS COMPARABLE EMISSIONS AND PERFORMANCE REQUIREMENTS FOR THE FOLLOWING APPLICATIONS: BACKHOES, SKID STEER LOADERS, COMPACT TRACK LOADERS CHANGING OIL REGULARLY IS CRITICAL TO PROPER OPERATION CHANGING AIR FILTERS REGULARLY IS CRITICAL TO PROPER OPERATION CHANGING WATER FILTERS REGULARLY IS CRITICAL TO PROPER OPERATION CHANGING COOLANT REGULARLY IS CRITICAL TO PROPER OPERATION CHECK TIRE PRESSURE REGULARLY CHECK BATTERY CHARGE REGULARLY CHECK FLUID LEVELS REGULARLY CHECK FOR LEAKS REGULARLY CHECK FOR WEAR REGULARLY CHECK FOR DAMAGE REGULARLY CHECK FOR CORROSION REGULARLY CHECK FOR CRACKS REGULARLY CHECK FOR BULGES REGULARLY CHECK FOR SWELLING REGULARLY CHECK FOR DEFORMATION REGULARLY CHECK FOR DISCOLORATION REGULARLY CHECK FOR UNUSUAL NOISES REGULARLY CHECK FOR UNUSUAL VIBRATIONS REGULARLY CHECK FOR UNUSUAL SMELLS REGULARLY CHECK FOR UNUSUAL TASTES REGULARLY CHECK FOR UNUSUAL TOUCHES REGULARLY CHECK FOR UNUSUAL SOUNDS REGULARLY CHECK FOR UNUSUAL FEELS REGULARLY CHECK FOR UNUSUAL TASTES REGULARLY CHECK FOR UNUSUAL TOUCHES REGULARLY CHECK FOR UNUSUAL SOUNDS REGULARLY CHECK FOR UNUSUAL FEELS REGULARLY</p>	
		
		

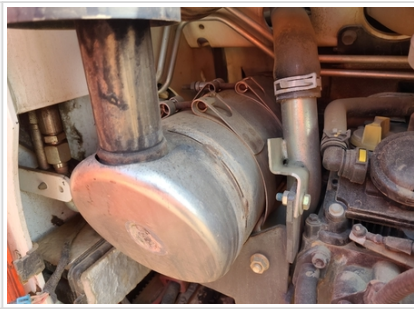

Enterprise Equipment Inspection

Enterprise Equipment Inspection

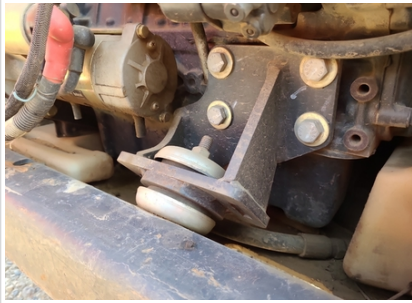		
		
Engine Type (Make, Model, Cylinders, Hp)	Bobcat - 2.4L - 4Cyl. - 74HP	
Emissions Tier	Tier 4F	
Engine Rating	3 - Normal Wear & Tear	
Engine Overall Comments	Engine runs well under load and no active leaks observed.	





Drivetrain Components

Drivetrain Photos		
		
Hydrostatic Transmission?	Yes	
2 Speed?	No	
Hydrostatic Drive Configuration	Split Transmission	
Comments		



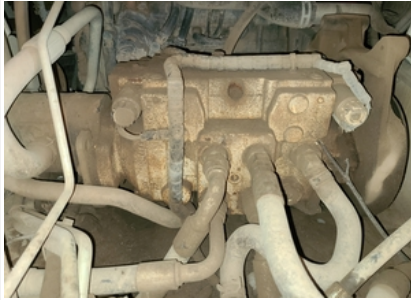


Enterprise Equipment Inspection

Transmission Info (Make/Model/Speeds)	
Drivetrain Rating	3 - Normal Wear & Tear
Drivetrain Comments	Machine travels well in all directions.

Hydraulics






Hydraulic Pump/Fittings/Hoses		
		
		
		Hydraulic seepage buildup around pump and hoses

Enterprise Equipment Inspection




Hydraulic Cylinders & Mounting Pins		
		
		
		
		
Hydraulic System Rating	3 - Normal Wear & Tear	
Hydraulic System Comments	Hydraulics working well and no active leaks observed from any cylinders.	

Chassis

Enterprise Equipment Inspection

Chassis Photos		
		
		
		
		






Enterprise Equipment Inspection

		
		
		
Chassis Rating	3 - Normal Wear & Tear	
Comments	Frame and Loader Arms in great shape	






Track Undercarriage Inspection Points

Undercarriage Photos		
		



Enterprise Equipment Inspection

Enterprise Equipment Inspection

Enterprise Equipment Inspection

		
		
Undercarriage Rating	4 - Very Light or Minimal Wear	
Undercarriage Comments	Tracks have over 85% of life left. Rollers, bogies, and sprockets in great condition.	

Undercarriage Inspection Points

Underbody Photos	
Underbody Rating	0
Underbody Comments	

Attachments

Attachment Photos		
		

Enterprise Equipment Inspection

	
Attachment Rating	3 - Normal Wear & Tear
Attachment Comments	Bucket and teeth in good shape.

Functionality Assessment

Operating Video	Click to Download
Additional Video	
Engine	3 - Normal Wear & Tear
Transmission/Drivetrain	3 - Normal Wear & Tear
Travel (Forward/Reverse/Steering)	4 - Very Light or Minimal Wear
Brakes	4 - Very Light or Minimal Wear
Hydraulic System	4 - Very Light or Minimal Wear
Controls	4 - Very Light or Minimal Wear
Safety Systems	4 - Very Light or Minimal Wear
Attachments	3 - Normal Wear & Tear
Overall Functional Test Comments	All machine's functions operating normal with no issues observed.

Overall Assessment

Overall Assessment

Inspection Rating Criteria	<table border="1"> <thead> <tr> <th>Rating Scale</th> <th>Explanation</th> </tr> </thead> <tbody> <tr> <td>1 - Service Required</td> <td>Requires immediate repairs to function as expected.</td> </tr> <tr> <td>2 - Above Average Wear & Tear</td> <td>Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.</td> </tr> <tr> <td>3 - Normal Wear & Tear</td> <td>Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.</td> </tr> <tr> <td>4 - Very Light or Minimal Wear</td> <td>Exhibits very minimal wear. Operation is better than expected given age and usage.</td> </tr> <tr> <td>5 - Like New, Recently Replaced</td> <td>Excellent condition, free of visible wear or damage. Operation is within factory specifications.</td> </tr> </tbody> </table>	Rating Scale	Explanation	1 - Service Required	Requires immediate repairs to function as expected.	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.	5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.
	Rating Scale	Explanation											
	1 - Service Required	Requires immediate repairs to function as expected.											
	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.											
	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.											
	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.											
5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.												
Exterior Rating	3 - Normal Wear & Tear												
Interior Rating	3 - Normal Wear & Tear												
Safety Rating	4 - Very Light or Minimal Wear												
Quality Rating	4 - Very Light or Minimal Wear												
Functionality Rating	4 - Very Light or Minimal Wear												
Overall Rating	3 - Normal Wear & Tear												



Enterprise Equipment Inspection

What's Great About the Machine	All main core functions operate well and undercarriage has plenty of life left. Machine has less than 2000 hours. Powertrain and implements have well maintained appearance.
What Needs Work	Cosmetic damage all around. Possible minor hydraulic leak underneath cab.
Any Additional Info from the Seller?	
Date/Time	05-19-2023