



DEKRA Services Inc.

Customer Service 770-257-0107

TRACTOR LIMITED INSPECTION

CLIENT

1808 - Boom and Bucket Inc

INSP DATE

06/16/2023

FLEET NAME

UNIT NUMBER

VIN (LAST 8)

PO NUMBER

INSPECTOR: 5725

INSPECTION ID

158333

Year, Make:	2014 KENWORTH	Frame:	STEEL
Model:	T800	Bumper:	CHROME
Full VIN:	1XKDDP9X2EJ420217	Exhaust:	SINGLE VERTICAL
Unit Number:	126182	Air Cleaners:	INTERNAL
Engine Make/ Model:	PACCAR MX13	Air Horns:	SINGLE
Engine Serial number:	Y040584	Fuel Tanks:	1
Horse Power:	450	Tank Capacity:	120 (1) (2) (3) (4)
ECU Horse Power:	450	Identification:	NONE
Clean air idle sticker:	Yes	Power Windows:	RH
Odometer:	387991	Front Wheels:	
ECU Mileage:	387991	Rear Wheels:	
Engine Hours:	9477	5th Wheel:	AIR SLIDE
Engine Brake:	EXHAUST	Power Steering	Yes
CARB Equipment:	DPF (Passed Snap Test)	Tilt Steering:	Yes
Trans Make:	EATON/FULLER	Air Cond:	Yes
Trans Model:	FRO15210C	Cruise Control:	Yes
Trans Type:	MANUAL	Radio:	AM/FM
Trans Speed:	10	Seat Suspension:	LH AIR
Suspension:	AIR RIDE	Seat Hi-Back:	DUAL
Rear Ratio:	3.7	Refrigerator:	No
Front Axle (lbs):	13200	Brakes Type:	ABS, AIR, DRUM
Rear Axle (lbs):	40000	Backing Plates:	FRONT N / REAR N
Axle Type:	TANDEM AXLE		
Wheelbase (Inches):	224	Steer Axle Brakes:	80% 80%
Sleeper:	NO	Drive Axle Brakes:	80% 80% (1)
Sleeper Size (Inches):			(3)
Dual Bunks	N/A		(4)
Tire Size (F):	11 R22.5		(5)
Tire Size (R):			
Tire Detail (F):			
Tire Detail (R):			

	STEER AXLE	DRIVE AXLE #1	DRIVE AXLE #2
		19 / 32nd LUG / R1	19 / 32nd LUG / R1
RIGHT	18 / 32nd HIGHWAY / V		
			
FRONT		19 / 32nd LUG / R1	19 / 32nd LUG / R1
		19 / 32nd LUG / R1	19 / 32nd LUG / R1
LEFT	18 / 32nd HIGHWAY / V		
			
		19 / 32nd LUG / R1	19 / 32nd LUG / R1

Brake Legend

BD = DRUM HAS MORE THAN 1/16 INCH LIP

CL = CRACKED LINING

LS = LEAKING SEAL(S)

Tire Legend

C = CUT D = DRY ROT F = FLAT

M = MISMATCHED TIRES/CASING

MA = MISMATCHED AXLES (FRONT vs. REAR)

V = VIRGIN W = IRREGULAR WEAR

R = RECAP: 1 = ONCE, 2 = TWICE, 3 = 3 TIMES

Tread Legend

H = HIGHWAY L = LUG

Additional Services	Requested	Status	Comments
---------------------	-----------	--------	----------

 DEKRA Services Inc. Customer Service 770-257-0107	TRACTOR LIMITED INSPECTION				INSPECTOR: 5725	
	CLIENT				INSPECTION ID	
	1808 - Boom and Bucket Inc				158333	
	INSP DATE	FLEET NAME	UNIT NUMBER	VIN (LAST 8)	PO NUMBER	
06/16/2023		126182	EJ420217			

RECONDITIONING AND SUPPLEMENTAL ESTIMATE

ITEM	DESCRIPTION / COMMENTS
THERE IS A DENT ON THE PASSENGER SIDE STEP	
THE HOOD IS CRACKED ON THE PASSENGER SIDE WHERE	MIRROR BRACKET WOULD BE MOUNTED
ACTIVE FAULT	

COMMENTS:



DEKRA Services Inc.
Customer Service 770-257-0107

TRACTOR LIMITED INSPECTION

CLIENT

1808 - Boom and Bucket Inc

INSP DATE

06/16/2023

FLEET NAME

UNIT NUMBER

126182

VIN (LAST 8)

EJ420217

PO NUMBER


INSPECTOR: 5725

INSPECTION ID

158333




1

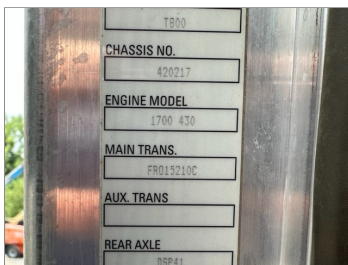

2




3

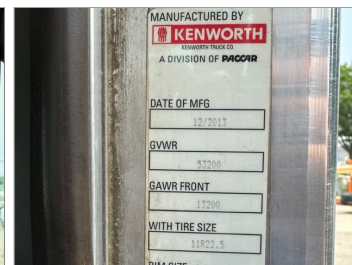

4



5

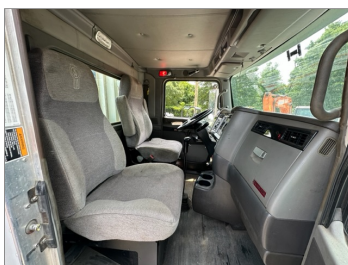

6



7




8



9



10

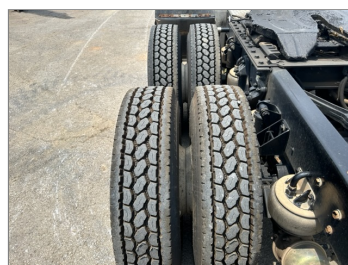

11



12




13



14



15

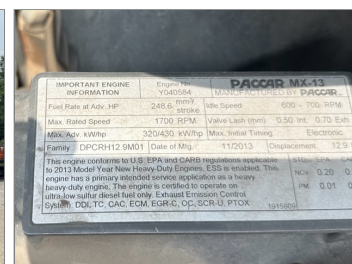

16



DEKRA Services Inc.
Customer Service 770-257-0107

TRACTOR LIMITED INSPECTION

CLIENT

1808 - Boom and Bucket Inc

INSP DATE

06/16/2023

FLEET NAME

UNIT NUMBER

126182

VIN (LAST 8)

EJ420217

PO NUMBER

INSPECTOR: 5725

INSPECTION ID

158333



17



18



19



20



21



22



23



24



25



26



27



28



29



30



31



32



DEKRA Services Inc.
Customer Service 770-257-0107

TRACTOR LIMITED INSPECTION

CLIENT

1808 - Boom and Bucket Inc

INSP DATE

06/16/2023

FLEET NAME

UNIT NUMBER

126182

VIN (LAST 8)

EJ420217

PO NUMBER


INSPECTOR: 5725

INSPECTION ID

158333



33

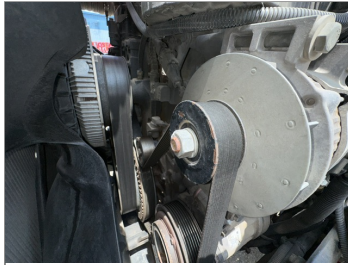

34



35



36



37



38



39



40



41



42



43



44



45



46



47



48



DEKRA Services Inc.
Customer Service 770-257-0107

TRACTOR LIMITED INSPECTION

CLIENT

1808 - Boom and Bucket Inc

INSP DATE

06/16/2023

FLEET NAME

UNIT NUMBER

126182

VIN (LAST 8)

EJ420217

PO NUMBER

INSPECTOR: 5725

INSPECTION ID

158333



49




50



51



52

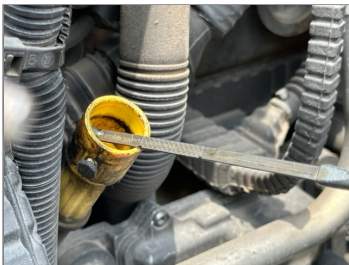

53



54



55



56




57



58



59

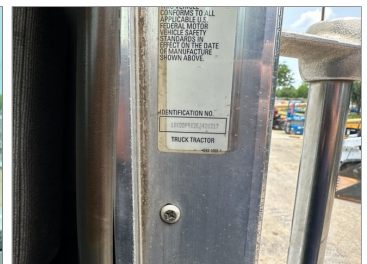

60



61



62



63



64



DEKRA Services Inc.
Customer Service 770-257-0107

TRACTOR LIMITED INSPECTION

CLIENT

1808 - Boom and Bucket Inc

INSP DATE

06/16/2023

FLEET NAME

UNIT NUMBER

126182

VIN (LAST 8)

EJ420217

PO NUMBER

INSPECTOR: 5725

INSPECTION ID

158333



65



66



67



68



69



70



71



72



73



74



75



76



77



78



79



80



DEKRA Services Inc.
Customer Service 770-257-0107

TRACTOR LIMITED INSPECTION

CLIENT				INSPECTOR: 5725	
1808 - Boom and Bucket Inc				INSPECTION ID	
				158333	
INSP DATE	FLEET NAME	UNIT NUMBER	VIN (LAST 8)	PO NUMBER	
06/16/2023		126182	EJ420217		



81



82

