

Inspection Report (Bulldozer)

General Info

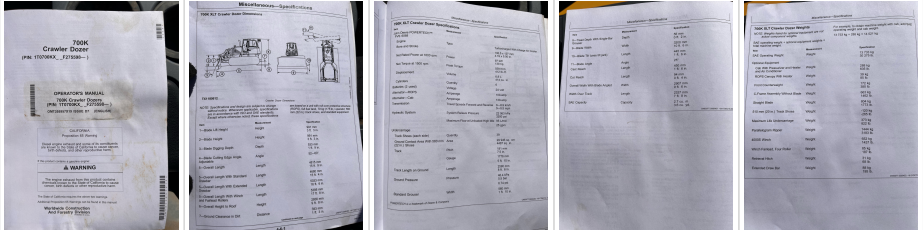
B&B Stock Number	A0374671
Year	2017
Make	John Deere
Model	700K XLT
Serial Number	1T0700KXEHF316329
Hour Meter Reading	1828.6
Previous Application (e.g., earth moving, mining, demolition, etc)	Earth moving

Features and Configuration

Blade	Yes
Blade Type	S
Blade Specs	120"
Ripper	Yes
Ripper Specs	40"
Heat	No
A/C	No
Radio	No
Backup Camera	No
Grade Control System	No
Telematics	No
OMM (Operator & Maintenance Manual)	Yes

OMM Specifications

OMM Specifications

Detail Specifications	Take photos of the detailed spec pages included in the operator's manual
OMM Spec Photos	

Exterior Walkaround Photos

360 Walkaround & Operating Video

Walkaround Photos & Operating Video



























Inspection Report (Bulldozer)

Exterior Walkaround Photos					
					
Operating Video	Click to Download				

General Appearance Inspection Points

General Appearance

General Appearance Photos

Close-up Exterior Photos					
					
					
					
					
					

General Appearance Inspection Points

Inspection Report (Bulldozer)

Inspection Rating Criteria	Rating Scale	Explanation
	1 - Service Required	Requires immediate repairs to function as expected.
	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.
	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.
	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.
	5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.
Body Panels	4 - Very Light or Minimal Wear	
Body Panel Condition	No visible damage, good paint condition and panel fitment	
Doors / Canopy Latches	3 - Normal Wear & Tear	
Doors / Canopy Latches Condition	No visible damage	
Steps / Ladders	3 - Normal Wear & Tear	
Steps / Ladders Condition	Steps/ladders are fully intact and appear structurally sound	
Handrails	3 - Normal Wear & Tear	
Handrails Condition	Handrails are fully intact and appear structurally sound	
Glass	0	
Mirrors	3 - Normal Wear & Tear	
Mirror Condition	Mirrors present and intact, no visible damage	
Exterior Lights	3 - Normal Wear & Tear	
Exterior Lights Condition	No visible damage, lighting system is operational	
Overall Exterior	3 - Normal Wear & Tear	
Comments	Normal wear and tear No major issues to report	





Control Station Inspection Points

Control Station

Control Station Photos

Control Station Photos


Inspection Report (Bulldozer)

	
	
Serial Number Plate	
Hour Meter/Odometer	
Control Station Type	Open Cab (OROPS)
Seat	2 - Above Average Wear & Tear
Seat Condition	Seat(s) have minor surface staining or small tears, Seat belt secures properly
Comments	Rips to seat bottom and backrest
Cabin Lights	0
Safety Lock Out / Stop	3 - Normal Wear & Tear
Safety Lock Out / Stop Condition	Safety lock out device is present, in good condition, and functional
Controls & Switches	3 - Normal Wear & Tear
Controls & Switches Condition	All switches are installed and functional
Hour Meter Activity	3 - Normal Wear & Tear
Hour Meter Condition	Hour meter is functional and in good condition


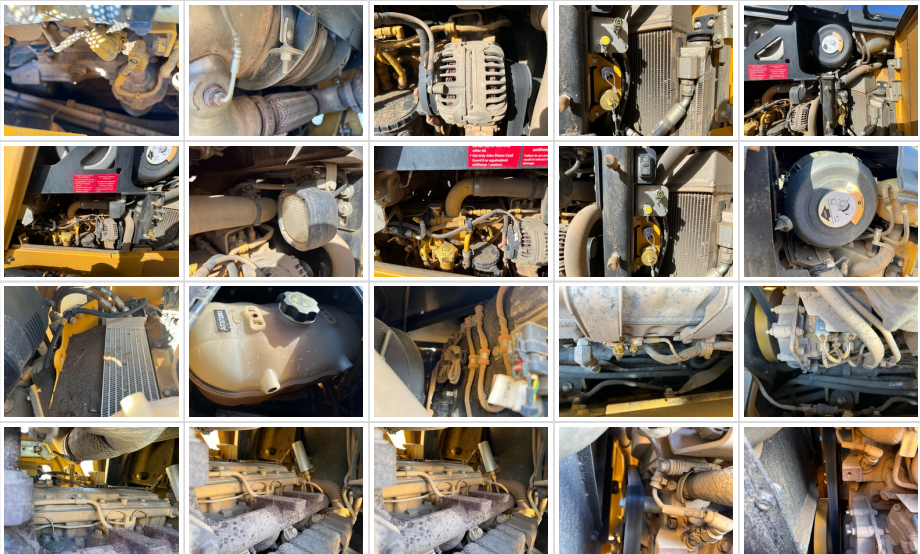
Inspection Report (Bulldozer)

Other Gauge Activity	3 - Normal Wear & Tear
Other Gauge Condition	All cockpit gauges are functional and in good condition
Heater & A/C	0
Travel Alarm	3 - Normal Wear & Tear
Travel Alarm Condition	Travel alarm is installed and functioning as expected
Horn	3 - Normal Wear & Tear
Horn Condition	Horn is installed and functioning as expected
Backup Camera	0
Control Station Overall Rating	3 - Normal Wear & Tear
Control Station Overall Condition	Good cabin appearance, solid floors, panels, and ceiling















Engine Inspection Points

Engine

Engine Compartment Photos

Engine Data Plate					
Engine Compartment Photos					

Inspection Report (Bulldozer)

	    
	    
	   
Engine Type (Make, Model, Cylinders, Hp)	John Deere
Emissions Tier	Tier 4F
Engine Serial Number	PE6068U052133
Engine Fuel Type	Diesel
Blow-by (Visual Observation Check)	No
Unusual Noises (Upon Start-up, Idle, Shutdown)	No
Engine Smoke (Upon Start-up, Idle, Shutdown)	No
Engine Exhaust Color	Clear
Battery	3 - Normal Wear & Tear
Battery Condition	Dusty & dirty appearance
Radiator	3 - Normal Wear & Tear
Radiator Condition	Radiator fins & components appear to be in good working order, no signs of damage or leaks
Belts	3 - Normal Wear & Tear
Belt Condition	Belts appear in good condition & alignment with proper tension
Hoses	3 - Normal Wear & Tear
Hose Condition	Firm, pliant hoses with no signs of wear or leaks
Water Pump	3 - Normal Wear & Tear
Water Pump Condition	No unusual pump noises heard
Cooling System Leaks	No
Coolant Appearance	3 - Normal Wear & Tear
Coolant Appearance Notes	Normal Translucent appearance, no visual signs of contamination
Oil Leaks	No
Oil Appearance	3 - Normal Wear & Tear


Inspection Report (Bulldozer)

Oil Appearance Notes	Clean oil appearance, no signs of cross contamination
Fuel Leaks	No
Equipped with DPF (Diesel Particulate Filter)	Yes
DPF Condition	3 - Normal Wear & Tear
DPF Condition Notes	Filter housing is intact with no signs of damage or malfunction, DPF indicator is not illuminated
Requires DEF (Diesel Exhaust Fluid)	Yes
DEF Tank	3 - Normal Wear & Tear
Overall Engine Rating	3 - Normal Wear & Tear
Overall Engine Appearance	Dusty & dry
Overall Engine Comments	Normal wear and tear no major issues to report

Drivetrain Inspection Points

Drivetrain

Drivetrain Inspection Points

Drivetrain Photos	
Hydrostatic Transmission?	Yes
Speeds	Unable to Verify
Drive Type	N/A (Track Undercarriage)
Transmission Components	3 - Normal Wear & Tear
Transmission Condition	Good forward and reverse function
Drive Motors	3 - Normal Wear & Tear
Parking Brake	3 - Normal Wear & Tear
Overall Drivetrain Rating	3 - Normal Wear & Tear
Overall Drivetrain Comments	Normal wear and tear no major issues to report

Undercarriage Inspection Points

Track Undercarriage








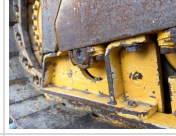





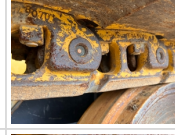




















Basic Information

OEM System Configuration (Ex. CAT SystemOne)	Unable to verify
High Drive Configuration	No
Sealed and Lubricated Track Undercarriage (SALT)?	N/A

Inspection Report (Bulldozer)

Oil Filled?	No
Grease Filled?	Yes
Low Ground Pressure (LGP)?	No
Track Shoe Width (inches)	22"
Length of Track on Ground (ft and inches)	114"
Number of Carrier Rollers (per side)	1
Number of Rollers (per side)	7
Number of Shoes (per side)	39

Undercarriage Photos

Undercarriage Photos					
					
					
					
					
					
					


Undercarriage Inspection Points

Sprocket Teeth	3 - Normal Wear & Tear
Track Bushings	3 - Normal Wear & Tear
Track Frames	3 - Normal Wear & Tear

Inspection Report (Bulldozer)

Pivot Shafts	3 - Normal Wear & Tear
Equalizer Bar & Joints	3 - Normal Wear & Tear
Front Idler	3 - Normal Wear & Tear
Track Tensioner	3 - Normal Wear & Tear
Track links	3 - Normal Wear & Tear
Bottom Rollers	3 - Normal Wear & Tear
Carrier Rollers	3 - Normal Wear & Tear
Overall Undercarriage	3 - Normal Wear & Tear
Overall Percent Estimate	50%
Overall Undercarriage Comments	Normal wear tear no major issues to report

Chassis Inspection Points









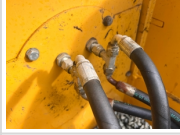








Chassis Photos					
Push Arm / C-Frame Condition	3 - Normal Wear & Tear				
Push Arm Pivot / C-Frame Trunnions Condition	3 - Normal Wear & Tear				
Tilt Linkage Pin & Bushings	3 - Normal Wear & Tear				
Angle Linkage Pin & Bushings	3 - Normal Wear & Tear				
Blade Trunnions / Bushings	3 - Normal Wear & Tear				
Frame Condition	3 - Normal Wear & Tear				
Belly Pans	3 - Normal Wear & Tear				
Overall Chassis	3 - Normal Wear & Tear				
Overall Chassis Comments	Normal wear and tear no major issues to report				

Hydraulics Overall Inspection Points



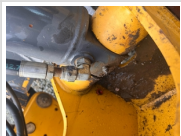















Hydraulics Overall

Inspection Report (Bulldozer)

Hydraulic System Inspection Points

Hydraulic System Photos	    
	    
	    
	 
Wet or Damp Hydraulic Lines / Fittings	No
Hydraulic Lines/Fittings	3 - Normal Wear & Tear
Hydraulic Lines / Fittings Condition	Hydraulic lines & fittings are clean and in good condition
Hydraulic Pump(s)	3 - Normal Wear & Tear
Unusual Noises	No
Hydraulic Pump Notes	No unusual noises heard during operation

Hydraulic Cylinder Inspection Points

Hydraulic Cylinder Photos	    
	    
	    
	  
Mounting Pins	3 - Normal Wear & Tear
Cylinder Oil Leaks	No
Hydraulic System Overall	3 - Normal Wear & Tear

Inspection Report (Bulldozer)

Comments	Normal wear and tear no major issues to report
----------	--

Functional Test

Functionality Assessment

Functionality Assessment

Engine	3 - Normal Wear & Tear
Transmission/Drivetrain	3 - Normal Wear & Tear
Travel (Forward/Reverse/Steering)	3 - Normal Wear & Tear
Brakes	3 - Normal Wear & Tear
Hydraulic System	3 - Normal Wear & Tear
Electric Operating System	3 - Normal Wear & Tear
Controls	3 - Normal Wear & Tear
Safety Systems	3 - Normal Wear & Tear
Core Functions	3 - Normal Wear & Tear
Attachments	3 - Normal Wear & Tear
Overall Functional Test Comments	Normal wear and tear no major issues to report

Inspection Summary

Overall Assessment

Inspection Rating Criteria	<table border="1"> <thead> <tr> <th>Rating Scale</th> <th>Explanation</th> </tr> </thead> <tbody> <tr> <td>1 - Service Required</td> <td>Requires immediate repairs to function as expected.</td> </tr> <tr> <td>2 - Above Average Wear & Tear</td> <td>Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.</td> </tr> <tr> <td>3 - Normal Wear & Tear</td> <td>Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.</td> </tr> <tr> <td>4 - Very Light or Minimal Wear</td> <td>Exhibits very minimal wear. Operation is better than expected given age and usage.</td> </tr> <tr> <td>5 - Like New, Recently Replaced</td> <td>Excellent condition, free of visible wear or damage. Operation is within factory specifications.</td> </tr> </tbody> </table>	Rating Scale	Explanation	1 - Service Required	Requires immediate repairs to function as expected.	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.	5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.
	Rating Scale	Explanation											
	1 - Service Required	Requires immediate repairs to function as expected.											
	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.											
	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.											
	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.											
5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.												
Exterior Rating	3 - Normal Wear & Tear												
Interior Rating	3 - Normal Wear & Tear												
Safety Rating	3 - Normal Wear & Tear												
Quality Rating	4 - Very Light or Minimal Wear												
Functionality Rating	3 - Normal Wear & Tear												
Overall Rating	3 - Normal Wear & Tear												
Summary Video	Click to Download												
What's Great About the Machine	Starts right up No abnormal noise heard while engine is running												
What Needs Work	Ripped seat												



Inspection Report (Bulldozer)

Date/Time	02-01-2024
Inspector Name	Javier Bocanegra