

2014 BROCE BROOM KR350 / 0

Specifications	
Year	2014
Make	Broce
Model	KR350
Date of Inspection	03/26/2024
Location of Inspection	612 Kaye Lani Avenue , Monroe, MI, 48161, USA
Serial Number	408514
Cylinders	No Damages Observed
Engine Hours	1,684
EMS Warning Lights	No Active Warnings
Transmission Type	Automatic
Operator's Seat	No Damages Observed
Mirrors	N/A
Radio	No
A/C	Yes
Steering Wheel	No Damages Observed
Pedals	No Damages Observed
Floorboard	No Damages Observed
Power Mirrors	No
Heated Mirrors	No
Switches and Controls	See Notes
Steps	No Damages Observed
Handrails	No Damages Observed
Oil Dipstick	Good Level / Good Color
Engine Compartment	See Notes
Exhaust	No Damages Observed
Axles	No Damages Observed
ROPS	No Damages Observed
Front Lights	No Damages Observed
Rear Lights	No Damages Observed
Front Left Tire Condition	See Notes
Front Left Tire Brand	Could Not Be Located
Front Left Tire Size	LT225/75R16 115/112S
Rear Left Tire Condition	No Damages Observed
Rear Left Tire Brand	Bridgestone
Rear Left Tire Size	LT225/75R16 115/112R
Front Right Tire Condition	See Notes
Front Right Tire Brand	Could Not Be Located
Front Right Tire Size	LT225/75R16 115/112S
Rear Right Tire Condition	See Notes
Rear Right Tire Brand	Bridgestone
Rear Right Tire Size	LT225/75R16 115/112R
Attachments - Snow Blade	See Notes

Equipment Photo



Video Inspection Link

<https://app.aspenfieldservices.com/jobs/video/qdpGH9C5zq4e4uydp>

Notes / Description

The unit runs and drives. The snow blade has a dent in the face of it. The fuel tank may have a dent in it. The control on the right side in the cab appears to be oily and could possibly have a leak under the cover. The front left wheel hub dust cap is missing the outside cover. There is a bolt missing from the A/C unit. The front tie rod appears to be bent. The front left tire has paint on the sidewall. The rear right tire has cuts on the sidewall. The front right tire has cuts on the sidewall, and the tire is low on air pressure. The backup alarm did not operate in the video.



Aspen Field Services

Job #: 69631 /

VIN: 408514

Aspen Field Services



Front Left / 03-26-2024



Front / 03-26-2024

Aspen Field Services



Right / ROPS / 03-26-2024



Rear Right / 03-26-2024

Aspen Field Services



Rear / 03-26-2024



Rear Left / 03-26-2024

Aspen Field Services



Left / 03-26-2024



Serial Number: 408514 / 03-26-2024

Aspen Field Services



Attachment / 03-26-2024



Attachment / 03-26-2024

Aspen Field Services




Attachment / 03-26-2024




Front Left Tire Condition / 03-26-2024

Aspen Field Services

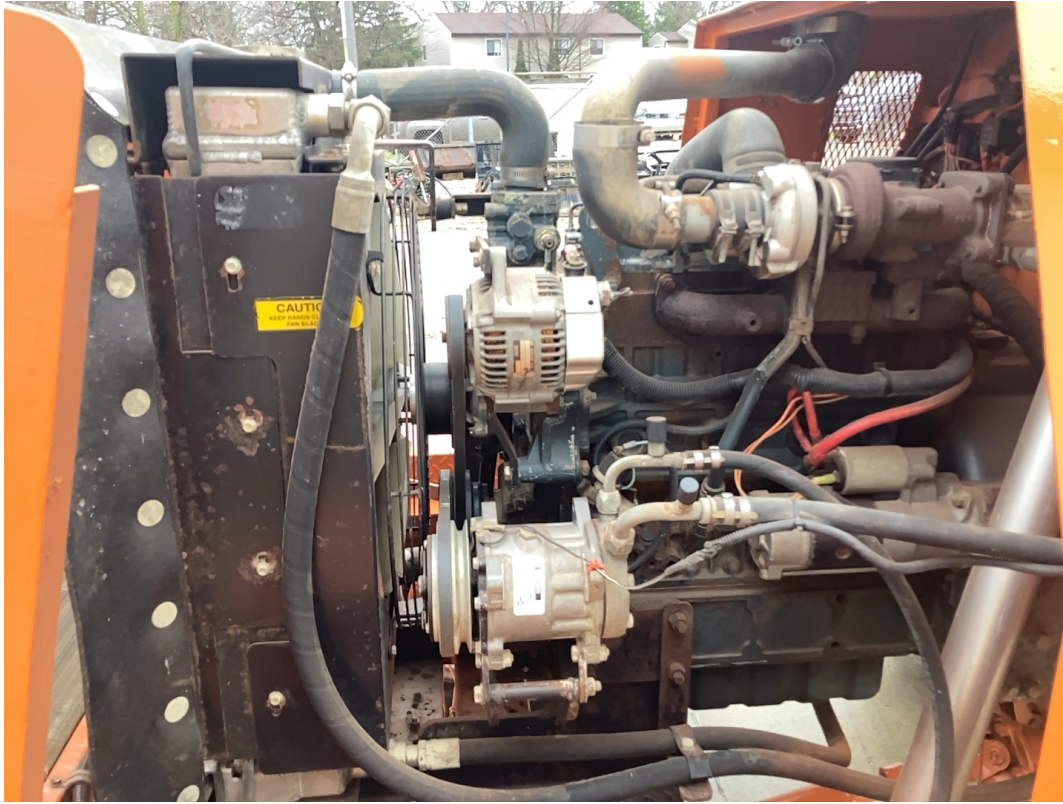

Engine Compartment / 03-26-2024

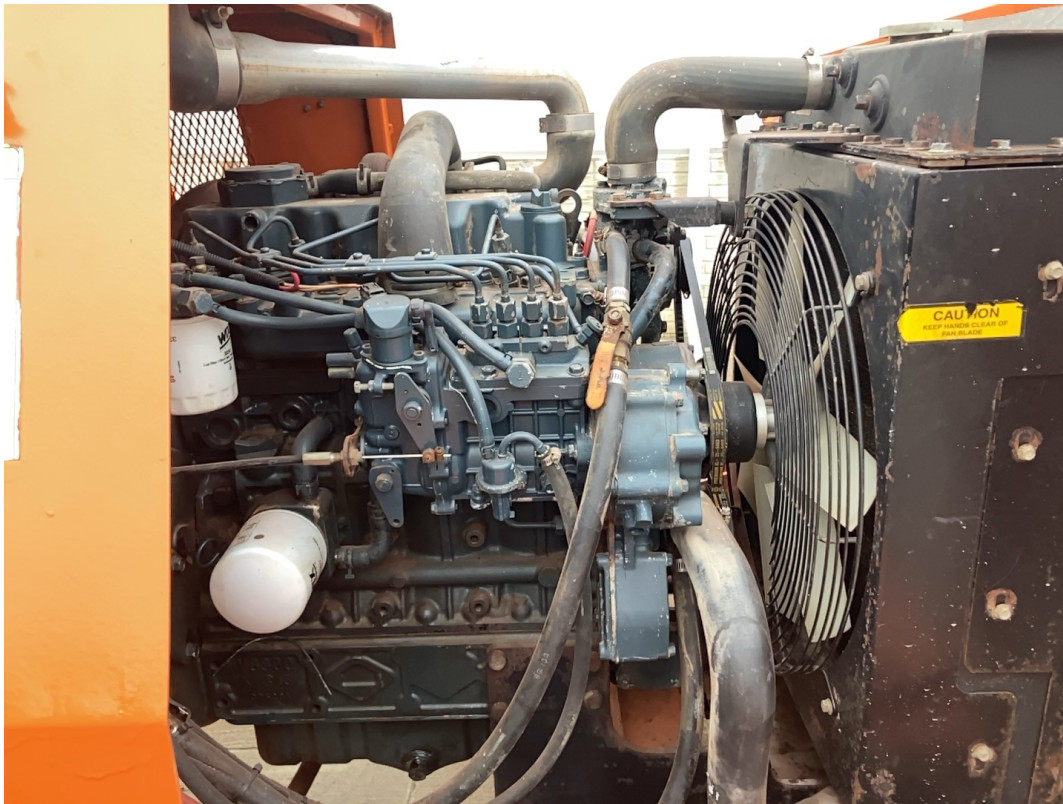

Engine Compartment / 03-26-2024

Aspen Field Services



Battery Compartment / 03-26-2024



Oil Dipstick / 03-26-2024

Aspen Field Services



Steps / 03-26-2024



Operator's Seat / 03-26-2024

Aspen Field Services



Steering Wheel / 03-26-2024



Floorboard / 03-26-2024

Aspen Field Services



Pedals / 03-26-2024



Switches and Controls / 03-26-2024

Aspen Field Services



Switches and Controls / Engine Hours: 1,684 / 03-26-2024



EMS Warning Lights / Transmission Shifter / 03-26-2024

Aspen Field Services



Switches and Controls / 03-26-2024



Handrails / 03-26-2024

Aspen Field Services



A/C / 03-26-2024



Cylinders / 03-26-2024

Aspen Field Services



Cylinders / 03-26-2024



Cylinders / 03-26-2024

Aspen Field Services



Cylinders / 03-26-2024



Exhaust / 03-26-2024

Aspen Field Services



Cylinders / 03-26-2024



Axle / 03-26-2024

Aspen Field Services



Axle / 03-26-2024



Axle / 03-26-2024

Aspen Field Services



Axle / 03-26-2024



Front Left Tire Condition / 03-26-2024

Aspen Field Services



Front Left Tire Size / 03-26-2024



Front Left Tire Brand / 03-26-2024

Aspen Field Services



Rear Left Tire Brand / 03-26-2024



Rear Left Tire Size / 03-26-2024

Aspen Field Services



Rear Left Tire Condition / 03-26-2024



Rear Left Tire Condition / 03-26-2024

Aspen Field Services



Rear Right Tire Condition / 03-26-2024



Rear Right Tire Brand / 03-26-2024

Aspen Field Services



Rear Right Tire Size / 03-26-2024



Rear Right Tire Condition / 03-26-2024

Aspen Field Services



Front Right Tire Condition / 03-26-2024



Front Right Tire Brand / 03-26-2024

Aspen Field Services



Front Right Tire Size / 03-26-2024



Front Right Tire Condition / 03-26-2024