



## Inspection Report (Skid Steer/Track Loader)

### General Info

B&B Stock Number	A0216480
Year	2021
Make	John Deere
Model	325G
Serial Number	1T0325GMLMJ394652
Serial Plate Photo	
Hour Meter Reading	1614
Hour Meter Photo	

### Dimensions

A. Length (ft and inches)	10ft 1in
B. Width (ft and inches)	6ft 3in
C. Height (ft and inches)	6ft 8in

### Features and Configuration

Travel System	Track Undercarriage
Bucket	Yes
Bucket Specs	Not available at time of inspection
Additional Attachment(s)?	No


## Inspection Report (Skid Steer/Track Loader)

Auxiliary Hydraulics	Yes
High Flow	Yes
Heat	Yes
A/C	Yes
Radio	Yes
Backup Camera	Yes
OMM (Operator & Maintenance Manual)	No
Telematics	No

### Exterior 360 Walkaround

#### 360 Walkaround & Operating Video

#### Walkaround Photos & Operating Video

Exterior Walkaround Photos	
Operating Video	<a href="#">Click to Download</a>
Additional Video	<a href="#">Click to Download</a>

### General Appearance Inspection Points

#### General Appearance

#### General Appearance Photos

Close-up Exterior Photos	
--------------------------	--

## Inspection Report (Skid Steer/Track Loader)



### General Appearance Inspection Points

Inspection Rating Criteria	Rating Scale	Explanation
	1 - Service Required	Requires immediate repairs to function as expected.
	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.
	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.
	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.
	5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.
Body Panels	3 - Normal Wear & Tear	
Body Panel Condition	Visible chipped paint or dents	
Comments	Scratches and dents expected with usage	
Doors / Canopy Latches	3 - Normal Wear & Tear	
Doors / Canopy Latches Condition	Other (see comments)	
Comments	Door will be included but not installed at time of inspection	
Steps / Ladders	3 - Normal Wear & Tear	
Handrails	2 - Above Average Wear & Tear	
Handrails Condition	Bent or broken railings	
Comments	Bent hand rails but still structurally sound	
Glass	3 - Normal Wear & Tear	
Glass Condition	Glass intact, no visible damage	
Mirrors	3 - Normal Wear & Tear	
Exterior Lights	4 - Very Light or Minimal Wear	
Overall Exterior	3 - Normal Wear & Tear	
Comments	Expected wear and tear in a unit that's been used.	


### Control Station Inspection Points

#### Control Station

#### Control Station Photos



## Inspection Report (Skid Steer/Track Loader)





	
<b>Control Station Type</b>	Enclosed Cab (EROPS)
<b>Control Type</b>	Pilot Controls
<b>Control Configuration</b>	Unable to confirm
<b>Comments</b>	Enclosed cab, door will be included at sale
<b>Seat</b>	3 - Normal Wear & Tear
<b>Seat Condition</b>	Seat(s) in good condition, no stains or tears in upholstery
<b>Cabin Lights</b>	3 - Normal Wear & Tear
<b>Cabin Lights Condition</b>	Cabin lights are installed with all light covers in place, bulbs are installed and working properly
<b>Safety Lock Out / Stop</b>	3 - Normal Wear & Tear
<b>Controls &amp; Switches</b>	4 - Very Light or Minimal Wear
<b>Hour Meter Activity</b>	4 - Very Light or Minimal Wear
<b>Other Gauge Activity</b>	4 - Very Light or Minimal Wear
<b>Heater &amp; A/C</b>	3 - Normal Wear & Tear
<b>Heater &amp; A/C Condition</b>	Heater and A/C work as expected, A/C Blows cool - noticeably cooler than air temp
<b>Travel Alarm</b>	3 - Normal Wear & Tear
<b>Horn</b>	3 - Normal Wear & Tear
<b>Backup Camera</b>	3 - Normal Wear & Tear
<b>Control Station Overall Rating</b>	3 - Normal Wear & Tear
<b>Control Station Overall Condition</b>	Good cabin appearance, solid floors, panels, and ceiling

## Engine Inspection Points

### Engine

### Engine Compartment Photos

## Inspection Report (Skid Steer/Track Loader)

Engine Data Plate	
Engine Compartment Photos	
	
	
Engine Type (Make, Model, Cylinders, Hp)	Unable to confirm
Emissions Tier	Undetermined
Engine Fuel Type	Diesel
Blow-by (Visual Observation Check)	N/A
Unusual Noises (Upon Start-up, Idle, Shutdown)	No
Engine Smoke (Upon Start-up, Idle, Shutdown)	No
Engine Exhaust Color	Clear
Battery	0
Radiator	3 - Normal Wear & Tear
Radiator Condition	Radiator fins & components appear to be in good working order, no signs of damage or leaks
Belts	3 - Normal Wear & Tear
Hoses	3 - Normal Wear & Tear
Water Pump	0
Cooling System Leaks	No


## Inspection Report (Skid Steer/Track Loader)

Coolant Appearance	3 - Normal Wear & Tear
Oil Leaks	No
Oil Appearance	3 - Normal Wear & Tear
Oil Appearance Notes	Clean oil appearance, no signs of cross contamination, Appropriate oil level
Fuel Leaks	No
Equipped with DPF (Diesel Particulate Filter)	N/A
Requires DEF (Diesel Exhaust Fluid)	No
Overall Engine Rating	3 - Normal Wear & Tear
Overall Engine Appearance	Clean & dry
Overall Engine Comments	Right engine compartment that's hard to see into. But, engine fired up and had no unusual noises. See videos.

## Drivetrain Inspection Points

### Drivetrain


## Drivetrain Inspection Points

Drivetrain Photos	
Hydrostatic Transmission?	Yes
Speeds	Variable Speed
Drive Type	N/A (Track Undercarriage)
Transmission Components	3 - Normal Wear & Tear
Transmission Condition	No unusual noises or vibrations, Good forward and reverse function
Drive Motors	3 - Normal Wear & Tear
Parking Brake	3 - Normal Wear & Tear
Overall Drivetrain Comments	Looks to be in good shape

## Travel System Inspection Points

### Rubber Track Undercarriage

## Undercarriage Photos

Undercarriage Photos	
----------------------	--

## Inspection Report (Skid Steer/Track Loader)




### Inspection Points

Track Width (inches)	16in
Track Length (inches)	70 on ground
Roller Frames	3 - Normal Wear & Tear
Track Belt	3 - Normal Wear & Tear
Rubber Belt Drive Lugs	3 - Normal Wear & Tear
Track Tensioners	3 - Normal Wear & Tear
Front Idlers	3 - Normal Wear & Tear
Rear Idlers	3 - Normal Wear & Tear
Track Rollers	3 - Normal Wear & Tear
Sprockets	3 - Normal Wear & Tear
Overall Undercarriage Rating	3 - Normal Wear & Tear
Left Track Belt - Percent Remaining Estimate	50%
Right Track Belt - Percent Remaining Estimate	50%
Overall Comments	Appears to be in good shape.

### Chassis Photos



## Inspection Report (Skid Steer/Track Loader)

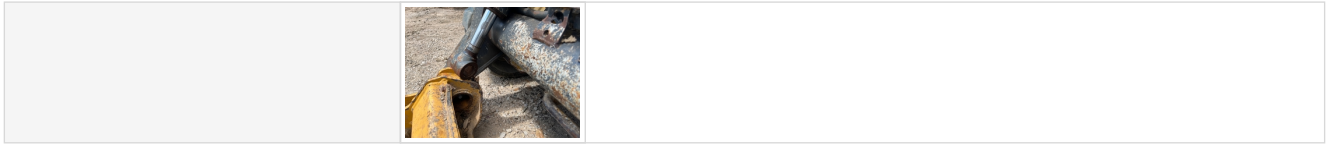


### Chassis Inspection Points

Frame	3 - Normal Wear & Tear
Stance	3 - Normal Wear & Tear
Lift Arms	3 - Normal Wear & Tear
Chassis to Arm Pins	3 - Normal Wear & Tear
Quick Coupler	3 - Normal Wear & Tear
Quick Coupler to Arms Pins	3 - Normal Wear & Tear
Overall Chassis	3 - Normal Wear & Tear
Overall Chassis Comments	Everything appears to be in good working order.


### Hydraulics Overall Inspection Points

#### Hydraulics Overall

#### Hydraulic System Inspection Points



Hydraulic System Photos					
Hydraulic Lines/Fittings	3 - Normal Wear & Tear				
Hydraulic Lines / Fittings Condition	Hydraulic lines & fittings are clean and in good condition				
Hydraulic Pump(s)	3 - Normal Wear & Tear				
Unusual Noises	No				
Hydraulic Pump Notes	No unusual noises heard during operation				

### Hydraulic Cylinder Inspection Points

Hydraulic Cylinder Photos					
---------------------------	--	--	--	--	--



## Inspection Report (Skid Steer/Track Loader)

	 	
Mounting Pins	3 - Normal Wear & Tear	
Cylinder Oil Leaks	No	
Hydraulic System Overall	3 - Normal Wear & Tear	
Comments	Unable to get a good look at the pump but no visible leaks or unusual noises	

### Bucket Inspection Points

Bucket	2 - Above Average Wear & Tear
Comments	Bucket will be included at the time of sale but wasn't available at inspection
Bucket Edge / Deflectors	0

### Functional Test

#### Functionality Assessment

#### Functionality Assessment

Engine	3 - Normal Wear & Tear
Transmission/Drivetrain	3 - Normal Wear & Tear
Travel (Forward/Reverse/Steering)	3 - Normal Wear & Tear
Brakes	3 - Normal Wear & Tear
Hydraulic System	3 - Normal Wear & Tear
Electric Operating System	3 - Normal Wear & Tear
Controls	3 - Normal Wear & Tear
Safety Systems	3 - Normal Wear & Tear
Core Functions	3 - Normal Wear & Tear
Attachments	0
Overall Functional Test Comments	Machine operates as expected with no unusual noises.

### Overall Assessment

#### Overall Assessment

Inspection Rating Criteria	<table border="1"> <thead> <tr> <th>Rating Scale</th> <th>Explanation</th> </tr> </thead> <tbody> <tr> <td>1 - Service Required</td> <td>Requires immediate repairs to function as expected.</td> </tr> <tr> <td>2 - Above Average Wear &amp; Tear</td> <td>Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.</td> </tr> <tr> <td>3 - Normal Wear &amp; Tear</td> <td>Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.</td> </tr> <tr> <td>4 - Very Light or Minimal Wear</td> <td>Exhibits very minimal wear. Operation is better than expected given age and usage.</td> </tr> <tr> <td>5 - Like New, Recently Replaced</td> <td>Excellent condition, free of visible wear or damage. Operation is within factory specifications.</td> </tr> </tbody> </table>	Rating Scale	Explanation	1 - Service Required	Requires immediate repairs to function as expected.	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.	5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.
	Rating Scale	Explanation											
	1 - Service Required	Requires immediate repairs to function as expected.											
	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.											
	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.											
	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.											
5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.												

## Inspection Report (Skid Steer/Track Loader)

Exterior Rating	3 - Normal Wear & Tear
Interior Rating	3 - Normal Wear & Tear
Safety Rating	3 - Normal Wear & Tear
Quality Rating	3 - Normal Wear & Tear
Functionality Rating	3 - Normal Wear & Tear
Overall Rating	3 - Normal Wear & Tear
Summary Video	<a href="#">Click to Download</a>
What's Great About the Machine	Machine appears to be well maintained. Starts up and idles smoothly. No unusual noises while operating. See video.
What Needs Work	Minor cosmetic scratches typical of use, some bends to handles and steps but nothing significant.
Any Additional Info from the Seller?	Door and bucket will be included at time of sale. Can verify ahead of time if specs are needed.
Date/Time	07-17-2024
Inspector Name	Ben