


Inspection Report (Skid Steer/Track Loader)

General Info

B&B Stock Number	A5195398
Year	2021
Make	John Deere
Model	325G
Serial Number	1T0325GKCMJ393942
Serial Plate Photo	
Hour Meter Reading	1621

Inspection Report (Skid Steer/Track Loader)

Hour Meter Photo	
Previous Application (e.g., earth moving, mining, demolition, etc)	General Rental

Features and Configuration

Travel System	Track Undercarriage
Bucket	Yes
Additional Attachment(s)?	No
Auxiliary Hydraulics	Yes
High Flow	No
Heat	No
A/C	No
Radio	No
Backup Camera	No
OMM (Operator & Maintenance Manual)	Yes
Telematics	Yes

Exterior 360 Walkaround

360 Walkaround & Operating Video

Walkaround Photos & Operating Video


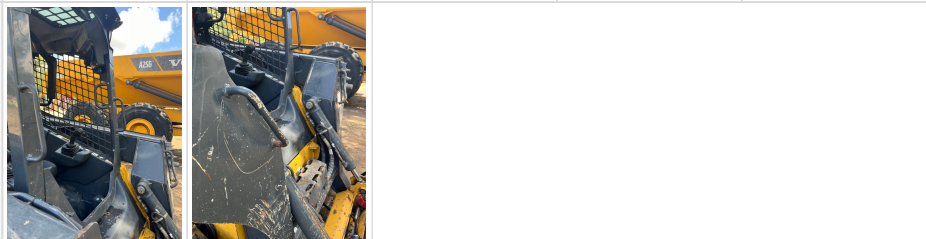
Inspection Report (Skid Steer/Track Loader)

Exterior Walkaround Photos	
	
Operating Video	Click to Download

General Appearance Inspection Points

General Appearance

General Appearance Photos

Close-up Exterior Photos	
	

General Appearance Inspection Points

Inspection Rating Criteria	
Body Panels	3 - Normal Wear & Tear
Body Panel Condition	Areas of surface rust observed, Visible chipped paint or dents
Comments	Normal wear and tear
Doors / Canopy Latches	3 - Normal Wear & Tear
Doors / Canopy Latches Condition	No visible damage
Steps / Ladders	4 - Very Light or Minimal Wear
Steps / Ladders Condition	Steps/ladders are fully intact and appear structurally sound
Handrails	3 - Normal Wear & Tear
Handrails Condition	Handrails are fully intact and appear structurally sound, Bent or broken railings
Glass	4 - Very Light or Minimal Wear
Glass Condition	Glass intact, no visible damage
Mirrors	4 - Very Light or Minimal Wear
Mirror Condition	Mirrors present and intact, no visible damage


Inspection Report (Skid Steer/Track Loader)

Exterior Lights	4 - Very Light or Minimal Wear
Exterior Lights Condition	No visible damage, lighting system is operational
Overall Exterior	3 - Normal Wear & Tear
Comments	Normal scratches and wear. Small bend and break on 1 hand rail but still structurally sound.

Control Station Inspection Points

Control Station

Control Station Photos

Control Station Photos	
Control Station Type	Open Cab (OROPS)
Control Type	Pilot Controls
Control Configuration	ISO (JD)
Seat	4 - Very Light or Minimal Wear
Seat Condition	Seat(s) in good condition, no stains or tears in upholstery, Seat adjustment controls move through full range of travel, Seat belt secures properly
Cabin Lights	1 - Service Required
Cabin Lights Condition	Cabin light system is not operational
Safety Lock Out / Stop	4 - Very Light or Minimal Wear
Safety Lock Out / Stop Condition	Safety lock out device is present, in good condition, and functional
Controls & Switches	4 - Very Light or Minimal Wear
Controls & Switches Condition	All switches are installed and functional
Hour Meter Activity	4 - Very Light or Minimal Wear
Hour Meter Condition	Hour meter is functional and in good condition
Other Gauge Activity	4 - Very Light or Minimal Wear
Other Gauge Condition	All cockpit gauges are functional and in good condition
Heater & A/C	0



Inspection Report (Skid Steer/Track Loader)

Travel Alarm	4 - Very Light or Minimal Wear
Travel Alarm Condition	Travel alarm is installed and functioning as expected
Horn	0
Backup Camera	0
Control Station Overall Rating	4 - Very Light or Minimal Wear
Control Station Overall Condition	Good cabin appearance, solid floors, panels, and ceiling

Engine Inspection Points

Engine

Engine Compartment Photos

Engine Data Plate					
Engine Compartment Photos					
Engine Type (Make, Model, Cylinders, Hp)	Deere				
Emissions Tier	Other (see comments)				
Comments	No DEF				
Engine Fuel Type	Diesel				


Inspection Report (Skid Steer/Track Loader)

Unusual Noises (Upon Start-up, Idle, Shutdown)	No
Engine Smoke (Upon Start-up, Idle, Shutdown)	No
Engine Exhaust Color	Clear
Cooling System Leaks	No
Oil Leaks	No
Fuel Leaks	No
Equipped with DPF (Diesel Particulate Filter)	No
Requires DEF (Diesel Exhaust Fluid)	No
Overall Engine Rating	4 - Very Light or Minimal Wear
Overall Engine Appearance	Clean & dry
Overall Engine Comments	Engine starts right up, no strange sounds or smoke.

Drivetrain Inspection Points

Drivetrain

Drivetrain Inspection Points

Drivetrain Photos	
Hydrostatic Transmission?	Yes
Speeds	Variable Speed
Drive Type	N/A (Track Undercarriage)
Parking Brake	5 - Like New, Recently Replaced
Overall Drivetrain Rating	3 - Normal Wear & Tear
Overall Drivetrain Comments	Normal wear and tear

Travel System Inspection Points

Rubber Track Undercarriage

Undercarriage Photos

Undercarriage Photos	
----------------------	--------------------------------------------------------------------------------------

Inspection Report (Skid Steer/Track Loader)



Inspection Points

Track Width (inches)	16
Track Length (inches)	74
Roller Frames	3 - Normal Wear & Tear
Track Belt	3 - Normal Wear & Tear
Rubber Belt Drive Lugs	3 - Normal Wear & Tear
Track Tensioners	3 - Normal Wear & Tear
Front Idlers	3 - Normal Wear & Tear
Rear Idlers	3 - Normal Wear & Tear
Track Rollers	3 - Normal Wear & Tear
Sprockets	3 - Normal Wear & Tear
Overall Undercarriage Rating	3 - Normal Wear & Tear
Left Track Belt - Percent Remaining Estimate	N/A
Right Track Belt - Percent Remaining Estimate	N/A
Overall Comments	Standard wear and tear

Chassis Photos



Chassis Inspection Points

Frame	4 - Very Light or Minimal Wear
-------	--------------------------------


Inspection Report (Skid Steer/Track Loader)

Stance	4 - Very Light or Minimal Wear
Lift Arms	4 - Very Light or Minimal Wear
Chassis to Arm Pins	4 - Very Light or Minimal Wear
Quick Coupler	4 - Very Light or Minimal Wear
Quick Coupler to Arms Pins	4 - Very Light or Minimal Wear
Overall Chassis	4 - Very Light or Minimal Wear
Overall Chassis Comments	Normal cosmetic wear and tear

Hydraulics Overall Inspection Points

Hydraulics Overall

Hydraulic System Inspection Points

Hydraulic System Photos					
Wet or Damp Hydraulic Lines / Fittings	No				
Hydraulic Lines/Fittings	3 - Normal Wear & Tear				
Hydraulic Lines / Fittings Condition	Worn, cut, or damaged hose covering, Hydraulic lines & fittings are clean and in good condition				
Hydraulic Pump(s)	0				
Unusual Noises	No				

Hydraulic Cylinder Inspection Points

Hydraulic Cylinder Photos					
Mounting Pins	4 - Very Light or Minimal Wear				
Cylinder Oil Leaks	No				

Inspection Report (Skid Steer/Track Loader)

Hydraulic System Overall	4 - Very Light or Minimal Wear
--------------------------	--------------------------------

Bucket Inspection Points

Bucket Photos	
---------------	------------------------------------------------------------------------------------

Bucket	4 - Very Light or Minimal Wear
--------	--------------------------------

Bucket Edge / Deflectors	4 - Very Light or Minimal Wear
--------------------------	--------------------------------

Functional Test

Functionality Assessment

Functionality Assessment

Engine	4 - Very Light or Minimal Wear
Transmission/Drivetrain	4 - Very Light or Minimal Wear
Travel (Forward/Reverse/Steering)	4 - Very Light or Minimal Wear
Brakes	0
Hydraulic System	4 - Very Light or Minimal Wear
Electric Operating System	4 - Very Light or Minimal Wear
Controls	4 - Very Light or Minimal Wear
Safety Systems	3 - Normal Wear & Tear
Core Functions	4 - Very Light or Minimal Wear
Attachments	4 - Very Light or Minimal Wear
Overall Functional Test Comments	No issues during operation. All functions work properly.

Overall Assessment

Overall Assessment

Inspection Rating Criteria	Rating Scale	Explanation
	1 - Service Required	Requires immediate repairs to function as expected.
	2 - Above Average Wear & Tear	Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed.
	3 - Normal Wear & Tear	Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.
	4 - Very Light or Minimal Wear	Exhibits very minimal wear. Operation is better than expected given age and usage.
	5 - Like New, Recently Replaced	Excellent condition, free of visible wear or damage. Operation is within factory specifications.
Exterior Rating	4 - Very Light or Minimal Wear	

Inspection Report (Skid Steer/Track Loader)

Interior Rating	4 - Very Light or Minimal Wear
Safety Rating	4 - Very Light or Minimal Wear
Quality Rating	4 - Very Light or Minimal Wear
Functionality Rating	4 - Very Light or Minimal Wear
Overall Rating	4 - Very Light or Minimal Wear
Summary Video	Click to Download
What's Great About the Machine	Unit is ready for the jobsite immediately.
What Needs Work	Minor cosmetic if desired.
Date/Time	07-17-2024
Inspector Name	Rex Walz