



## Inspection Report (Skid Steer/Track Loader)

### General Info

|                    |  |
|--------------------|--|
| B&B Stock Number   | A9870773   |
| Year               | 2021   |
| Make               | Bobcat   |
| Model              | T770   |
| Serial Number      | AT6331141  |
| Serial Plate Photo |   |
| Hour Meter Reading | 271  |
| Hour Meter Photo   |  |

### Features and Configuration

|                           |                     |
|---------------------------|---------------------|
| Travel System             | Track Undercarriage |
| Bucket                    | Yes                 |
| Additional Attachment(s)? | Yes                 |
| Auxiliary Hydraulics      | Yes                 |
| High Flow                 | Yes                 |
| Heat                      | Yes                 |
| A/C                       | Yes                 |
| Radio                     | Yes                 |


## Inspection Report (Skid Steer/Track Loader)

|                                     |   |
|-------------------------------------|---|
| Backup Camera                       | Yes   |
| OMM (Operator & Maintenance Manual) | Yes   |
| Telematics                          | Yes   |
| Other Configuration Details / Notes | Bucket included with machine. Additional attachments contact Boom & Bucket sales for pricing. |

### Exterior 360 Walkaround

#### 360 Walkaround & Operating Video

#### Walkaround Photos & Operating Video

|                            |   |
|----------------------------|---|
| Exterior Walkaround Photos |  |
| Operating Video            | <a href="#">Click to Download</a>   |
| Additional Video           | <a href="#">Click to Download</a>   |

### General Appearance Inspection Points

#### General Appearance

#### General Appearance Photos

|                          |  |
|--------------------------|--|
| Close-up Exterior Photos |  |
|--------------------------|--|

### General Appearance Inspection Points


## Inspection Report (Skid Steer/Track Loader)

| Inspection Rating Criteria    | Rating  | Explanation   |
|-------------------------------|---|---|
|                               | 5   | Light or minimal wear for its age                                   |
|                               | 4   | Expected wear and tear for its age, operates as expected            |
|                               | 3   | Above average wear and tear for its age, still operates as expected |
|                               | 2   | Heavy wear, is operable but needs attention                         |
|                               | 1   | Requires repair(s) to function as expected                          |
| <b>Body Panels</b>            | 4 - Expected Wear - Fully Operable  |   |
| <b>Body Panel Condition</b>   | Good paint condition and panel fitment, Expected chipped paint or dents for its age.            |   |
| <b>Doors / Canopy Latches</b> | 5 - Very Light or Minimal Wear  |   |
| <b>Steps / Ladders</b>        | 4 - Expected Wear - Fully Operable  |   |
| <b>Handrails</b>              | 5 - Very Light or Minimal Wear  |   |
| <b>Glass</b>                  | 5 - Very Light or Minimal Wear  |   |
| <b>Mirrors</b>                | 5 - Very Light or Minimal Wear  |   |
| <b>Exterior Lights</b>        | 5 - Very Light or Minimal Wear  |   |
| <b>Overall Exterior</b>       | 5 - Very Light or Minimal Wear  |   |
| <b>Comments</b>               | Lightly used machine and exterior is in good shape. Some minor scratches expected with its age. |   |

## Control Station Inspection Points

### Control Station

### Control Station Photos

|                               |  |  |  |  |  |
|-------------------------------|--|--|--|--|--|
| <b>Control Station Photos</b> |  |  |  |  |  |
| <b>Control Station Type</b>   | Enclosed Cab (EROPS)   |  |  |  |  |
| <b>Control Type</b>           | Pilot Controls   |  |  |  |  |
| <b>Control Configuration</b>  | Unable to confirm  |  |  |  |  |
| <b>Seat</b>                   | 5 - Very Light or Minimal Wear   |  |  |  |  |
| <b>Cabin Lights</b>           | 5 - Very Light or Minimal Wear   |  |  |  |  |
| <b>Safety Lock Out / Stop</b> | 5 - Very Light or Minimal Wear   |  |  |  |  |


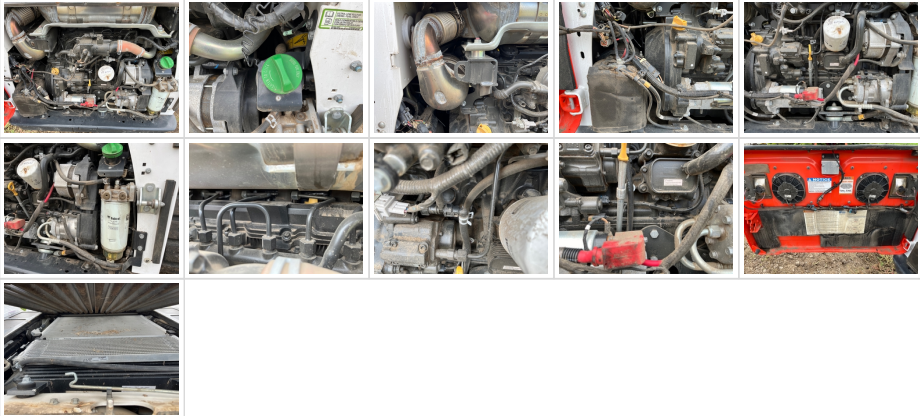
## Inspection Report (Skid Steer/Track Loader)

|                                |  |
|--------------------------------|--|
| Controls & Switches            | 5 - Very Light or Minimal Wear                 |
| Hour Meter Activity            | 5 - Very Light or Minimal Wear                 |
| Hour Meter Condition           | Hour meter is functional and in good condition |
| Other Gauge Activity           | 5 - Very Light or Minimal Wear                 |
| Heater & A/C                   | 5 - Very Light or Minimal Wear                 |
| Travel Alarm                   | 5 - Very Light or Minimal Wear                 |
| Horn                           | 0  |
| Backup Camera                  | 5 - Very Light or Minimal Wear                 |
| Control Station Overall Rating | 5 - Very Light or Minimal Wear                 |
|                                | 📍 29.682712, -97.653999                        |

## Engine Inspection Points

### Engine

### Engine Compartment Photos

|  |  |  |  |  |  |
|--|--|--|--|--|--|
| Engine Data Plate                        |  |  |  |  |  |
| Engine Compartment Photos                |  |  |  |  |  |
| Engine Type (Make, Model, Cylinders, Hp) | Na   |  |  |  |  |
| Emissions Tier                           | Undetermined   |  |  |  |  |
| Engine Serial Number                     | Na   |  |  |  |  |

## Inspection Report (Skid Steer/Track Loader)

|  |  |
|--|--|
| Engine Fuel Type                               | Diesel   |
| Blow-by (Visual Observation Check)             | No   |
| Unusual Noises (Upon Start-up, Idle, Shutdown) | No   |
| Engine Smoke (Upon Start-up, Idle, Shutdown)   | No   |
| Engine Exhaust Color                           | Clear  |
| Battery  | 4 - Expected Wear - Fully Operable   |
| Radiator                                       | 4 - Expected Wear - Fully Operable   |
| Belts  | 4 - Expected Wear - Fully Operable   |
| Hoses  | 4 - Expected Wear - Fully Operable   |
| Water Pump                                     | 4 - Expected Wear - Fully Operable   |
| Cooling System Leaks                           | No   |
| Coolant Appearance                             | 0  |
| Oil Leaks                                      | No   |
| Oil Appearance                                 | 4 - Expected Wear - Fully Operable   |
| Fuel Leaks                                     | No   |
| Equipped with DPF (Diesel Particulate Filter)  | Yes  |
| DPF Condition                                  | 4 - Expected Wear - Fully Operable   |
| Requires DEF (Diesel Exhaust Fluid)            | Yes  |
| DEF Tank                                       | 4 - Expected Wear - Fully Operable   |
| Overall Engine Rating                          | 4 - Expected Wear - Fully Operable   |
| Overall Engine Appearance                      | Clean & dry  |
| Overall Engine Comments                        | Low hour machine and the engine reflects that. Seems to be in great shape with no apparent audible or visual issues. |

## Drivetrain Inspection Points

### Drivetrain

## Drivetrain Inspection Points

|                         |   |
|-------------------------|---|
| Drivetrain Photos       |  |
| Drive Type              | N/A (Track Undercarriage)   |
| Transmission Components | 4 - Expected Wear - Fully Operable  |
| Transmission Condition  | No unusual noises or vibrations, Good forward and reverse function                  |


## Inspection Report (Skid Steer/Track Loader)

|                             |  |
|-----------------------------|--|
| Parking Brake               | 4 - Expected Wear - Fully Operable                       |
| Overall Drivetrain Rating   | 4 - Expected Wear - Fully Operable                       |
| Overall Drivetrain Comments | No signs of issues audibly or visually, runs as expected |

### Travel System Inspection Points

#### Rubber Track Undercarriage

#### Undercarriage Photos

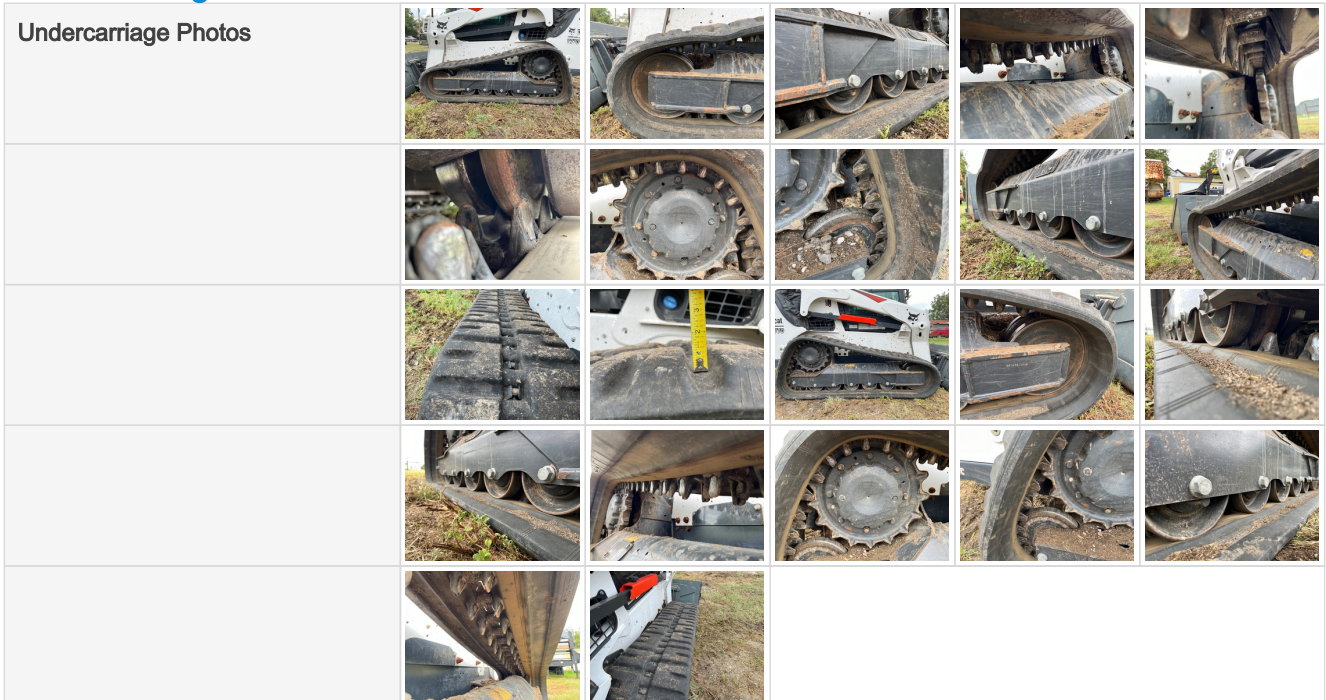


















#### Inspection Points

|  |                                    |
|--|------------------------------------|
| Track Width (inches)                         | 18                                 |
| Track Length (inches)                        | Na                                 |
| Roller Frames                                | 4 - Expected Wear - Fully Operable |
| Track Belt                                   | 4 - Expected Wear - Fully Operable |
| Rubber Belt Drive Lugs                       | 4 - Expected Wear - Fully Operable |
| Track Tensioners                             | 4 - Expected Wear - Fully Operable |
| Front Idlers                                 | 4 - Expected Wear - Fully Operable |
| Rear Idlers                                  | 4 - Expected Wear - Fully Operable |
| Track Rollers                                | 4 - Expected Wear - Fully Operable |
| Sprockets                                    | 0                                  |
| Overall Undercarriage Rating                 | 4 - Expected Wear - Fully Operable |
| Left Track Belt - Percent Remaining Estimate | 70%                                |

## Inspection Report (Skid Steer/Track Loader)

|   |   |
|---|---|
| Right Track Belt - Percent Remaining Estimate | 70%   |
| Overall Comments                              | Tracks appear lightly used and system is in good shape. |

### Chassis Photos

|                |   |   |  |   |   |
|----------------|---|---|--|---|---|
| Chassis Photos |    |  |  |  |  |
|                |    |  |  |  |  |
|                |    |  |  |  |  |
|                |   |   |  |   |   |
|                |  |   |  |   |   |

### Chassis Inspection Points

|                            |                                    |
|----------------------------|------------------------------------|
| Frame                      | 4 - Expected Wear - Fully Operable |
| Stance                     | 4 - Expected Wear - Fully Operable |
| Lift Arms                  | 4 - Expected Wear - Fully Operable |
| Chassis to Arm Pins        | 4 - Expected Wear - Fully Operable |
| Quick Coupler              | 4 - Expected Wear - Fully Operable |
| Quick Coupler to Arms Pins | 4 - Expected Wear - Fully Operable |
| Overall Chassis            | 4 - Expected Wear - Fully Operable |
| Overall Chassis Comments   | Chassis is in solid shape          |














### Hydraulics Overall Inspection Points

#### Hydraulics Overall







#### Hydraulic System Inspection Points

|                         |   |   |  |   |   |
|-------------------------|---|---|--|---|---|
| Hydraulic System Photos |  |  |  |  |  |
|-------------------------|---|---|--|---|---|

## Inspection Report (Skid Steer/Track Loader)

|   |  |
|---|--|
|   |      |
|   |      |
|   |      |
| <b>Hydraulic Lines/Fittings</b>             | 4 - Expected Wear - Fully Operable   |
| <b>Hydraulic Lines / Fittings Condition</b> | Hydraulic lines & fittings are clean and in good condition   |
| <b>Hydraulic Pump(s)</b>                    | 4 - Expected Wear - Fully Operable   |
| <b>Unusual Noises</b>                       | No   |
| <b>Hydraulic Pump Notes</b>                 | No unusual noises heard during operation   |

## Hydraulic Cylinder Inspection Points

|                                  |  |
|----------------------------------|--|
| <b>Hydraulic Cylinder Photos</b> |      |
|                                  |   |
| <b>Mounting Pins</b>             | 4 - Expected Wear - Fully Operable   |
| <b>Cylinder Oil Leaks</b>        | No   |
| <b>Hydraulic System Overall</b>  | 4 - Notable Wear - Fully Operable  |
| <b>Comments</b>                  | Hydraulic system is in great shape. See video, operates smoothly with no noises, powers all attachments as expected  |

## Bucket Inspection Points

|                                 |  |
|---------------------------------|--|
| <b>Bucket Photos</b>            |      |
|                                 |      |
| <b>Bucket</b>                   | 4 - Expected Wear - Fully Operable   |
| <b>Bucket Edge / Deflectors</b> | 4 - Expected Wear - Fully Operable   |


## Additional Attachments




## Inspection Report (Skid Steer/Track Loader)

### Additional Attachment(s)

#### Additional Attachments

|                         |  |
|-------------------------|--|
| Attachment Type         | Dozer blade  |
| Attachment Make         | Bobcat   |
| Attachment Size / Specs | 90" wide m, 24in tall  |
| Attachment Condition    | 5 - Very Light or Minimal Wear   |
| Comments                | Sold separately and not included in the advertised price. Contact Boom & Bucketsales for pricing |
| Attachment Photos       |               |

### Additional Attachments (1)

|                         |   |
|-------------------------|---|
| Attachment Type         | Mulcher   |
| Attachment Make         | Prinoth   |
| Attachment Size / Specs | See photo   |
| Attachment Condition    | 4 - Expected Wear - Fully Operable  |
| Comments                | One of the quick attach couplers is dented. Fully functions but doesn't connect smoothly. Easy replacement Sold separately and not included in the advertised price. Contact Boom & Bucketsales for pricing |
| Attachment Photos       |   |

### Functional Test

#### Functionality Assessment

#### Functionality Assessment

|                         |                                    |
|-------------------------|------------------------------------|
| Engine                  | 4 - Expected Wear - Fully Operable |
| Transmission/Drivetrain | 4 - Expected Wear - Fully Operable |

## Inspection Report (Skid Steer/Track Loader)

|                                   |   |
|-----------------------------------|---|
| Travel (Forward/Reverse/Steering) | 4 - Expected Wear - Fully Operable  |
| Brakes                            | 4 - Expected Wear - Fully Operable  |
| Hydraulic System                  | 4 - Expected Wear - Fully Operable  |
| Electric Operating System         | 4 - Expected Wear - Fully Operable  |
| Controls                          | 4 - Heavy Wear - Needs Attention  |
| Safety Systems                    | 4 - Expected Wear - Fully Operable  |
| Core Functions                    | 4 - Expected Wear - Fully Operable  |
| Attachments                       | 4 - Expected Wear - Fully Operable  |
| Overall Functional Test Comments  | <p>Low hours, operates fully as expected.</p> <p>Dozer blade and mulcher sold separately and not included in the advertised price. Contact Boom &amp; Bucketsales for pricing</p> |

## Overall Assessment

### Overall Assessment

|                                      |   |   |
|--------------------------------------|---|---|
| Inspection Rating Criteria           | <b>Rating Scale</b>   | <b>Explanation</b>  |
|                                      | 1 - Service Required  | Requires immediate repairs to function as expected.   |
|                                      | 2 - Above Average Wear & Tear   | Exhibits greater wear than expected given age and usage. While operable, further diagnosis may be needed. |
|                                      | 3 - Normal Wear & Tear  | Exhibits wear that is consistent with age and usage. Operation is normal, and as expected.                |
|                                      | 4 - Very Light or Minimal Wear  | Exhibits very minimal wear. Operation is better than expected given age and usage.                        |
|                                      | 5 - Like New, Recently Replaced   | Excellent condition, free of visible wear or damage. Operation is within factory specifications.          |
| Exterior Rating                      | 4 - Expected Wear - Fully Operable  |   |
| Interior Rating                      | 5 - Very Light or Minimal Wear  |   |
| Safety Rating                        | 4 - Expected Wear - Fully Operable  |   |
| Quality Rating                       | 4 - Expected Wear - Fully Operable  |   |
| Functionality Rating                 | 4 - Expected Wear - Fully Operable  |   |
| Overall Rating                       | 4 - Expected Wear - Fully Operable  |   |
| What's Great About the Machine       | <p>Low hours machine that is ready to work. Cab is in great shape with heat and AC, good radio. High flow hydraulics, hydraulic quick connect, quick couplers, and multiple attachments available individually.</p> <p>Dozer blade and mulcher sold separately and not included in the advertised price. Contact Boom &amp; Bucketsales for pricing</p> |   |
| What Needs Work                      | It's in great shape.  |   |
| Any Additional Info from the Seller? | Dozer blade and mulcher sold separately and not included in the advertised price. Contact Boom & Bucketsales for pricing  |   |
| Date/Time                            | 09-05-2024  |   |
| Inspector Name                       | Ben   |   |