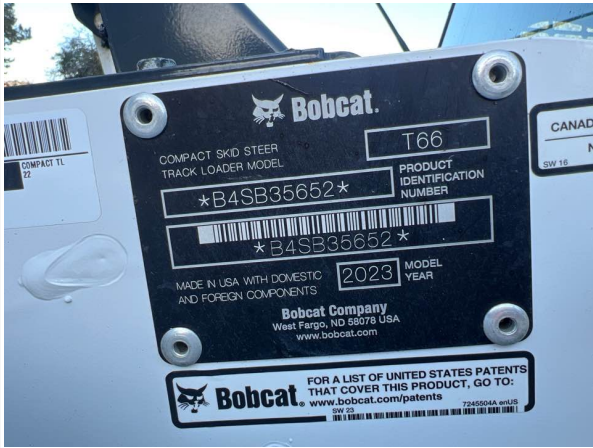



Inspection Report (Skid Steer/Track Loader)

General Info

| | |
|--|--|
| B&B Stock Number | A4309195 |
| Year | 2023 |
| Make | Bobcat |
| Model | T66 |
| Serial Number | B4SB35652 |
| Serial Plate Photo |  |
| Hour Meter Reading | 106 |
| Hour Meter Photo |  |
| Previous Application (e.g., earth moving, mining, demolition, etc) | Earth moving |

Features and Configuration

| | |
|---|---------------------|
| Travel System | Track Undercarriage |
| Bucket | Yes |
| Bucket Specs | 68" bucket |
| Additional Attachment(s)? | Yes |
| Auxiliary Hydraulics (visual inspection only) | Yes |
| High Flow (visual inspection only) | Yes |

Inspection Report (Skid Steer/Track Loader)

| | |
|-------------------------------------|---|
| Heat | Yes |
| A/C | Yes |
| Radio | Yes |
| Backup Camera | Yes |
| OMM (Operator & Maintenance Manual) | Yes |
| Telematics | No |
| Other Configuration Details / Notes | <p>auger attachment fits multiple machines in this seller's package - Buyer to confirm if the auger is included with this machine sale</p> <p>Enclosed cab Two speed Rear counter weights Bluetooth functionality</p> |

Exterior 360 Walkaround

360 Walkaround & Operating Video
















Walkaround Photos & Operating Video

| | |
|----------------------------|--|
| Exterior Walkaround Photos |      |
| |    |
| Operating Video | Click to Download |
| Additional Video | Click to Download |
| Additional Video | Click to Download |

General Appearance Inspection Points

General Appearance

General Appearance Photos

| | |
|--------------------------|--|
| Close-up Exterior Photos |      |
| |      |
| |      |

Inspection Report (Skid Steer/Track Loader)




General Appearance Inspection Points

| Inspection Rating Criteria | Rating | Explanation |
|----------------------------|---|---|
| | 5 | Light or minimal wear for its age |
| | 4 | Expected wear and tear for its age, operates as expected |
| | 3 | Above average wear and tear for its age, still operates as expected |
| | 2 | Heavy wear, is operable but needs attention |
| | 1 | Requires repair(s) to function as expected |
| Body Panels | 5 - Very Light or Minimal Wear | |
| Doors / Canopy Latches | 5 - Very Light or Minimal Wear | |
| Steps / Ladders | 5 - Very Light or Minimal Wear | |
| Handrails | 5 - Very Light or Minimal Wear | |
| Glass | 5 - Very Light or Minimal Wear | |
| Mirrors | 5 - Very Light or Minimal Wear | |
| Exterior Lights | 5 - Very Light or Minimal Wear | |
| Overall Exterior | 5 - Very Light or Minimal Wear | |
| Comments | Light to minimal wear no major issues to report | |


Control Station Inspection Points

Control Station

Control Station Photos

| | | | | | |
|------------------------|--|--|--|--|--|
| Control Station Photos |  | | | | |
| Control Station Type | Enclosed Cab (EROPS) | | | | |







Inspection Report (Skid Steer/Track Loader)

| | |
|--------------------------------|--|
| Control Type | Pilot Controls |
| Control Configuration | Configurable (SAE and ISO) |
| Seat | 5 - Very Light or Minimal Wear |
| Cabin Lights | 5 - Very Light or Minimal Wear |
| Safety Lock Out / Stop | 5 - Very Light or Minimal Wear |
| Controls & Switches | 5 - Very Light or Minimal Wear |
| Hour Meter Activity | 5 - Very Light or Minimal Wear |
| Hour Meter Condition | Hour meter is functional and in good condition |
| Other Gauge Activity | 5 - Very Light or Minimal Wear |
| Heater & A/C | 5 - Very Light or Minimal Wear |
| Travel Alarm | 5 - Very Light or Minimal Wear |
| Horn | 5 - Very Light or Minimal Wear |
| Backup Camera | 5 - Very Light or Minimal Wear |
| Control Station Overall Rating | 5 - Very Light or Minimal Wear |
| |  36.973130, -121.994460 |









Engine Inspection Points

Engine

Engine Compartment Photos

| | | | | | |
|---------------------------|--|---|--|---|---|
| Engine Data Plate |  | | | | |
| Engine Compartment Photos |  |  |  |  |  |

Inspection Report (Skid Steer/Track Loader)

| | |
|--|--|
| |      |
| |    |
| Engine Type (Make, Model, Cylinders, Hp) | Bobcat |
| Emissions Tier | Undetermined |
| Engine Serial Number | DM02-LEL00 |
| Engine Fuel Type | Diesel |
| Blow-by (Visual Observation Check) | No |
| Unusual Noises (Upon Start-up, Idle, Shutdown) | No |
| Engine Smoke (Upon Start-up, Idle, Shutdown) | No |
| Engine Exhaust Color | Clear |
| Battery | 5 - Very Light or Minimal Wear |
| Battery Condition | Inaccessible, unable to determine condition, Clean & dry appearance, tight connections |
| Radiator | 5 - Very Light or Minimal Wear |
| Radiator Condition | Radiator fins & components appear to be in good working order, no signs of damage or leaks |
| Belts | 5 - Very Light or Minimal Wear |
| Belt Condition | Belts appear in good condition & alignment with proper tension |
| Hoses | 5 - Very Light or Minimal Wear |
| Hose Condition | Firm, pliant hoses with no signs of wear or leaks |
| Water Pump | 5 - Very Light or Minimal Wear |
| Water Pump Condition | No unusual pump noises heard |
| Cooling System Leaks | No |
| Coolant Appearance | 5 - Very Light or Minimal Wear |
| Coolant Appearance Notes | Normal Translucent appearance, no visual signs of contamination |
| Oil Leaks | No |
| Oil Appearance | 5 - Very Light or Minimal Wear |
| Oil Appearance Notes | Clean oil appearance, no signs of cross contamination |

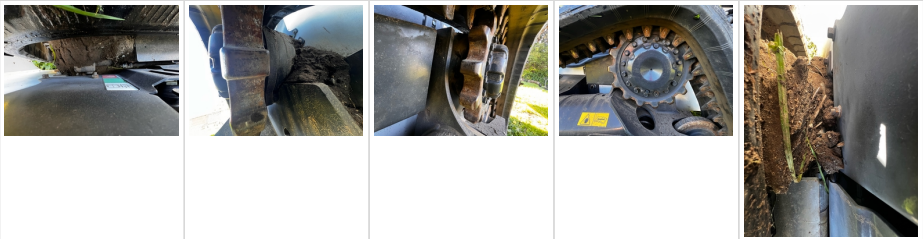

Inspection Report (Skid Steer/Track Loader)

| | |
|---|---|
| Fuel Leaks | No |
| Equipped with DPF (Diesel Particulate Filter) | No |
| Requires DEF (Diesel Exhaust Fluid) | No |
| Overall Engine Rating | 5 - Very Light or Minimal Wear |
| Overall Engine Appearance | Clean & dry |
| Overall Engine Comments | Light to minimal wear no major issues to report |

Drivetrain Inspection Points

Drivetrain

Drivetrain Inspection Points

| | | | | | |
|-------------------------------------|--|--|--|--|--|
| Drivetrain Photos |  | | | | |
| |  | | | | |
| Hydrostatic Transmission? | Yes | | | | |
| Speeds | 2 Speed | | | | |
| Drive Type | N/A (Track Undercarriage) | | | | |
| Transmission Components | 5 - Very Light or Minimal Wear | | | | |
| Transmission Condition | Good forward and reverse function, No unusual noises or vibrations | | | | |
| Drive Motors (first gear & reverse) | 5 - Very Light or Minimal Wear | | | | |
| Parking Brake | 5 - Very Light or Minimal Wear | | | | |
| Parking Brake Function | Good brake function | | | | |
| Overall Drivetrain Rating | 5 - Very Light or Minimal Wear | | | | |
| Overall Drivetrain Comments | Light to minimal wear. No major issues to report. | | | | |

Travel System Inspection Points

Rubber Track Undercarriage

Undercarriage Photos

| | | | | | |
|----------------------|--|--|--|--|--|
| Undercarriage Photos |  | | | | |
|----------------------|--|--|--|--|--|

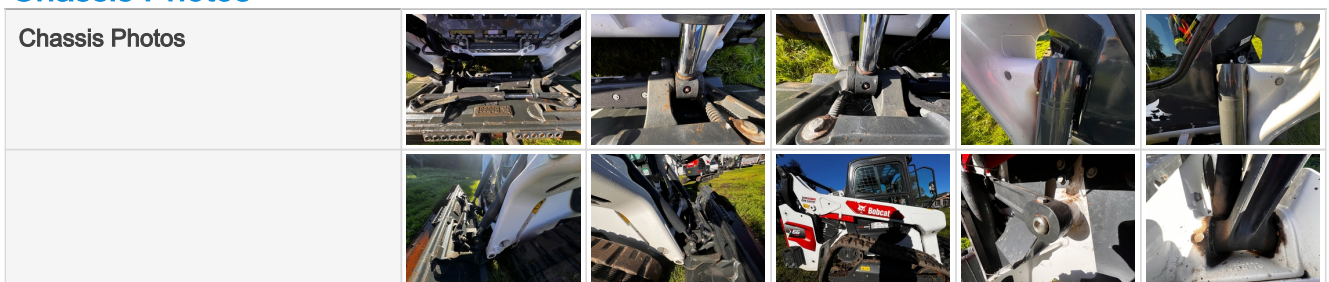
Inspection Report (Skid Steer/Track Loader)



Inspection Points

| | |
|---|---|
| Track Width (inches) | 13" |
| Roller Frames | 5 - Very Light or Minimal Wear |
| Track Belt | 5 - Very Light or Minimal Wear |
| Rubber Belt Drive Lugs | 5 - Very Light or Minimal Wear |
| Track Tensioners | 5 - Very Light or Minimal Wear |
| Front Idlers | 5 - Very Light or Minimal Wear |
| Rear Idlers | 5 - Very Light or Minimal Wear |
| Track Rollers | 5 - Very Light or Minimal Wear |
| Sprockets | 5 - Very Light or Minimal Wear |
| Overall Undercarriage Rating | 5 - Very Light or Minimal Wear |
| Left Track Belt - Percent Remaining Estimate | 90% |
| Right Track Belt - Percent Remaining Estimate | 90% |
| Overall Comments | Light to minimal wear no major issues to report |

Chassis Photos



Inspection Report (Skid Steer/Track Loader)








Chassis Inspection Points

| | |
|----------------------------|---|
| Frame | 5 - Very Light or Minimal Wear |
| Stance | 5 - Very Light or Minimal Wear |
| Lift Arms | 5 - Very Light or Minimal Wear |
| Chassis to Arm Pins | 5 - Very Light or Minimal Wear |
| Quick Coupler | 5 - Very Light or Minimal Wear |
| Quick Coupler to Arms Pins | 5 - Very Light or Minimal Wear |
| Overall Chassis | 5 - Very Light or Minimal Wear |
| Overall Chassis Comments | Light to minimal wear no major issues to report |

Hydraulics Overall Inspection Points

Hydraulics Overall





Hydraulic System Inspection Points

| | |
|--|--|
| Hydraulic System Photos |      |
| Wet or Damp Hydraulic Lines / Fittings | No |
| Hydraulic Lines/Fittings | 5 - Very Light or Minimal Wear |
| Hydraulic Lines / Fittings Condition | Hydraulic lines & fittings are clean and in good condition |
| Hydraulic Pump(s) | 5 - Very Light or Minimal Wear |
| Unusual Noises | No |
| Hydraulic Pump Notes | No unusual noises heard during operation |

Hydraulic Cylinder Inspection Points

| | |
|---------------------------|--|
| Hydraulic Cylinder Photos |      |
|---------------------------|--|

Inspection Report (Skid Steer/Track Loader)

| | | | | | |
|--------------------------|---|---|--|---|--|
| |  |  |  |  | |
| Mounting Pins | 5 - Very Light or Minimal Wear | | | | |
| Cylinder Oil Leaks | No | | | | |
| Hydraulic System Overall | 5 - Very Light or Minimal Wear | | | | |





Bucket Inspection Points

| | | | | | |
|--------------------------|--|--|---|---|---|
| Bucket Photos |  |  |  |  |  |
| |  |  |  | | |
| Bucket | 5 - Very Light or Minimal Wear | | | | |
| Bucket Edge / Deflectors | 5 - Very Light or Minimal Wear | | | | |






Additional Attachments

Additional Attachment(s)

Additional Attachments


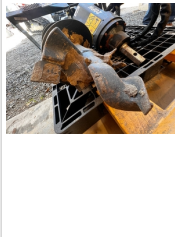


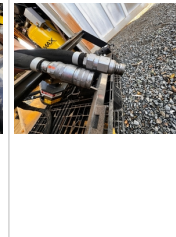

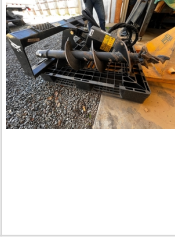
| | | | | | |
|-------------------------|---|---|--|---|--|
| Attachment Type | 4' forks | | | | |
| Attachment Make | Bobcat | | | | |
| Attachment Size / Specs | 4' forks adjustable positions | | | | |
| Attachment Condition | 5 - Very Light or Minimal Wear | | | | |
| Attachment Photos |  |  |  |  | |

Additional Attachments (1)

| | | | | | |
|----------------------|---|---|--|---|---|
| Attachment Type | Pintle hitch | | | | |
| Attachment Make | Titan | | | | |
| Attachment Condition | 5 - Very Light or Minimal Wear | | | | |
| Attachment Photos |  |  |  |  |  |

Additional Attachments (2)

Inspection Report (Skid Steer/Track Loader)

| | | | | |
|-------------------------|---|--|---|---|
| Attachment Type | Auger | | | |
| Attachment Make | Bobcat | | | |
| Attachment Size / Specs | 20PH | | | |
| Attachment Condition | 5 - Very Light or Minimal Wear | | | |
| Comments | auger attachment fits multiple machines in this seller's package - Buyer to confirm if the auger is included with this machine sale | | | |
| Attachment Photos |  |  |  |  |
| |  |  |  | |

Functional Test

Functionality Assessment

Functionality Assessment

| | |
|-----------------------------------|--|
| Engine | 5 - Very Light or Minimal Wear |
| Transmission/Drivetrain | 5 - Very Light or Minimal Wear |
| Travel (Forward/Reverse/Steering) | 5 - Very Light or Minimal Wear |
| Brakes | 5 - Very Light or Minimal Wear |
| Hydraulic System | 5 - Very Light or Minimal Wear |
| Electric Operating System | 5 - Very Light or Minimal Wear |
| Controls | 5 - Service Required - Inoperable |
| Safety Systems | 5 - Very Light or Minimal Wear |
| Core Functions | 5 - Very Light or Minimal Wear |
| Attachments | 5 - Very Light or Minimal Wear |
| Overall Functional Test Comments | This machine performed as designed no major issues to report |

Overall Assessment

Overall Assessment

Inspection Report (Skid Steer/Track Loader)

| Inspection Rating Criteria | Rating | Explanation |
|--------------------------------------|---|---|
| | 5 | Light or minimal wear for its age |
| | 4 | Expected wear and tear for its age, operates as expected |
| | 3 | Above average wear and tear for its age, still operates as expected |
| | 2 | Heavy wear, is operable but needs attention |
| | 1 | Requires repair(s) to function as expected |
| Exterior Rating | 5 - Very Light or Minimal Wear | |
| Interior Rating | 5 - Very Light or Minimal Wear | |
| Safety Rating | 5 - Very Light or Minimal Wear | |
| Quality Rating | 5 - Very Light or Minimal Wear | |
| Functionality Rating | 5 - Very Light or Minimal Wear | |
| Overall Rating | 5 - Very Light or Minimal Wear | |
| Summary Video | Click to Download | |
| What's Great About the Machine | The great thing about this machine is that it has low operating hours and no abnormal noises heard during functional test | |
| What Needs Work | The thing that needs to work on this machine is the paint scratches on the engine door | |
| Any Additional Info from the Seller? | auger attachment fits multiple machines in this seller's package - Buyer to confirm if the auger is included with this machine sale | |
| Date/Time | 02-26-2025 | |
| Inspector Name | Javier Bocanegra | |
| Assessment Details | Boom & Bucket provides an on-site visual inspection of the Unit. The inspection of mechanical components may be limited to starting and running the engine and basic hydraulic movements. Any operational tests are limited to low speeds and are not tested under load. The functionality of locking differentials, transmission shifting, all drive axels, brakes, and auxiliary or high flow hydraulics (unless required for an included attachment) cannot be fully verified. Additional information may be available on request. Please see the terms of services on our website for full details. | |