



Inspection Report (Excavator)

General Info

B&B Stock Number	A7564411
Year	2023
Make	Bobcat
Model	E35
Serial Number	B4P313554
Serial Plate Photo	
Hour Meter Reading	74.7
Hour Meter Photo	
Previous Application (e.g., earth moving, mining, demolition, etc)	Earth moving

Features and Configuration

Travel System	Rubber Track Undercarriage
Bucket	Yes
Bucket Specs	18" tooth bucket
Blade	Yes
Additional Attachment(s)	Yes
Hydraulic Coupler	Yes








Inspection Report (Excavator)

Auxiliary Hydraulics (visual inspection only)	Yes
Hydraulic Thumb	Yes
Heat	Yes
A/C	Yes
Radio	Yes
Backup Camera	No
GPS / Grade Control System	No
OMM (Operator & Maintenance Manual)	Yes
Telematics	No
Other Configuration Details / Notes	<p>auger attachment fits multiple machines in this seller's package - Buyer to confirm if the auger is included with this machine sale</p> <p>Bluetooth functionality Enclosed cab Angle Blade functionality</p>

Exterior Walkaround Photos

360 Walkaround & Operating Video











Walkaround Photos & Operating Video

Exterior Walkaround Photos	    
	 
Operating Video	Click to Download
Additional Video	Click to Download
Additional Video	Click to Download

General Appearance Inspection Points

General Appearance

General Appearance Photos

Close-up Exterior Photos	    
	    

Inspection Report (Excavator)







General Appearance Inspection Points

Inspection Rating Criteria	Rating	Explanation
	5	Light or minimal wear for its age
	4	Expected wear and tear for its age, operates as expected
	3	Above average wear and tear for its age, still operates as expected
	2	Heavy wear, is operable but needs attention
	1	Requires repair(s) to function as expected
Body Panels	5 - Very Light or Minimal Wear	
Doors / Canopy Latches	5 - Very Light or Minimal Wear	
Steps / Ladders	5 - Very Light or Minimal Wear	
Handrails	5 - Very Light or Minimal Wear	
Glass	5 - Very Light or Minimal Wear	
Mirrors	5 - Very Light or Minimal Wear	
Exterior Lights	5 - Very Light or Minimal Wear	
Overall Exterior	5 - Very Light or Minimal Wear	
Comments	Light to minimal wear no major issues to report	





Control Station Inspection Points

Control Station

Control Station Photos

Control Station Photos					
					
					







Inspection Report (Excavator)

	  	
Control Station Type	Enclosed Cab (EROPS)	
Control Type	Pilot Controls	
Control Configuration	Configurable (SAE and ISO)	
Seat	5 - Very Light or Minimal Wear	
Cabin Lights	5 - Very Light or Minimal Wear	
Safety Lock Out / Stop	5 - Very Light or Minimal Wear	
Controls & Switches	5 - Very Light or Minimal Wear	
Hour Meter Activity	5 - Very Light or Minimal Wear	
Hour Meter Condition	Hour meter is functional and in good condition	
Other Gauge Activity	5 - Very Light or Minimal Wear	
Heater & A/C	5 - Very Light or Minimal Wear	
Travel Alarm	5 - Very Light or Minimal Wear	
Horn	5 - Very Light or Minimal Wear	
Backup Camera	5 - Very Light or Minimal Wear	
Control Station Overall Rating	5 - Very Light or Minimal Wear	
	 36.973249, -121.994672	


Engine Inspection Points

Engine

Engine Compartment Photos

Engine Data Plate	
Engine Compartment Photos	    

Inspection Report (Excavator)

		
Engine Type (Make, Model, Cylinders, Hp)	Bobcat	
Emissions Tier	Undetermined	
Engine Serial Number	DMO1-LEEDA	
Engine Fuel Type	Diesel	
Blow-by (Visual Observation Check)	No	
Unusual Noises (Upon Start-up, Idle, Shutdown)	No	
Engine Smoke (Upon Start-up, Idle, Shutdown)	No	
Engine Exhaust Color	Clear	
Battery	5 - Very Light or Minimal Wear	
Battery Condition	Like new, recently replaced	
Radiator	5 - Very Light or Minimal Wear	
Radiator Condition	Radiator fins & components appear to be in good working order, no signs of damage or leaks	
Belts	5 - Very Light or Minimal Wear	
Belt Condition	Belts appear in good condition & alignment with proper tension	
Hoses	5 - Very Light or Minimal Wear	
Hose Condition	Firm, pliant hoses with no signs of wear or leaks	
Water Pump	5 - Very Light or Minimal Wear	
Water Pump Condition	No unusual pump noises heard	
Cooling System Leaks	No	
Coolant Appearance	5 - Very Light or Minimal Wear	
Coolant Appearance Notes	Normal Translucent appearance, no visual signs of contamination	
Oil Leaks	No	
Oil Appearance	5 - Very Light or Minimal Wear	
Oil Appearance Notes	Clean oil appearance, no signs of cross contamination	
Fuel Leaks	No	
Equipped with DPF (Diesel Particulate Filter)	No	
Requires DEF (Diesel Exhaust Fluid)	No	
Overall Engine Rating	5 - Very Light or Minimal Wear	







Inspection Report (Excavator)

Overall Engine Appearance	Clean & dry
Overall Engine Comments	Like to minimal wear no major issues to report

Drivetrain Inspection Points

Drivetrain
















Drivetrain Inspection Points

Drivetrain Photos	    
	
Hydrostatic Transmission?	Yes
Speeds	Variable Speed
Drive Type	N/A (Track Undercarriage)
Transmission Components	N/A
Drive Motors (first gear & reverse)	5 - Very Light or Minimal Wear
Parking Brake	5 - Very Light or Minimal Wear
Parking Brake Function	Good brake function
Overall Drivetrain Rating	5 - Very Light or Minimal Wear
Overall Drivetrain Comments	Like to minimal wear no major issues to report

Chassis Inspection Points

Chassis Photos	    
	    
	    
	    

Inspection Report (Excavator)

					
					
					
Boom Condition	5 - Very Light or Minimal Wear				
Stick Condition	5 - Very Light or Minimal Wear				
Boom Base Pin & Bushings	5 - Very Light or Minimal Wear				
Boom to Stick Pin & Bushings	5 - Very Light or Minimal Wear				
Stick to Bucket Pin & Bushings	5 - Very Light or Minimal Wear				
Turntable Bearing	5 - Very Light or Minimal Wear				
Bottom Covers	5 - Very Light or Minimal Wear				
Overall Chassis	5 - Very Light or Minimal Wear				


Travel System Inspection Points

Rubber Track Undercarriage

Undercarriage Photos

Undercarriage Photos					
					
					

Inspection Report (Excavator)

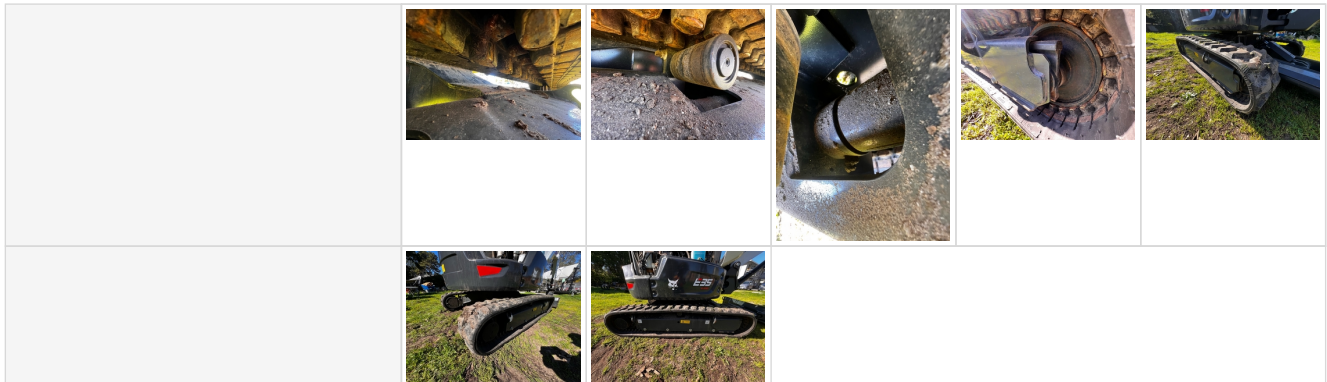


Inspection Points

Track Width (inches)	12"
Roller Frames	5 - Very Light or Minimal Wear
Track Belt	5 - Very Light or Minimal Wear
Rubber Belt Drive Lugs	5 - Very Light or Minimal Wear
Track Tensioners	5 - Very Light or Minimal Wear
Front Idlers	5 - Very Light or Minimal Wear
Rear Idlers	5 - Very Light or Minimal Wear
Track Rollers	5 - Very Light or Minimal Wear
Sprockets	5 - Very Light or Minimal Wear
Overall Undercarriage Rating	5 - Very Light or Minimal Wear
Left Track Belt - Percent Remaining Estimate	90%
Right Track Belt - Percent Remaining Estimate	90%
Overall Comments	Like to minimal wear no major issues to report

Hydraulics Overall Inspection Points

Hydraulics Overall

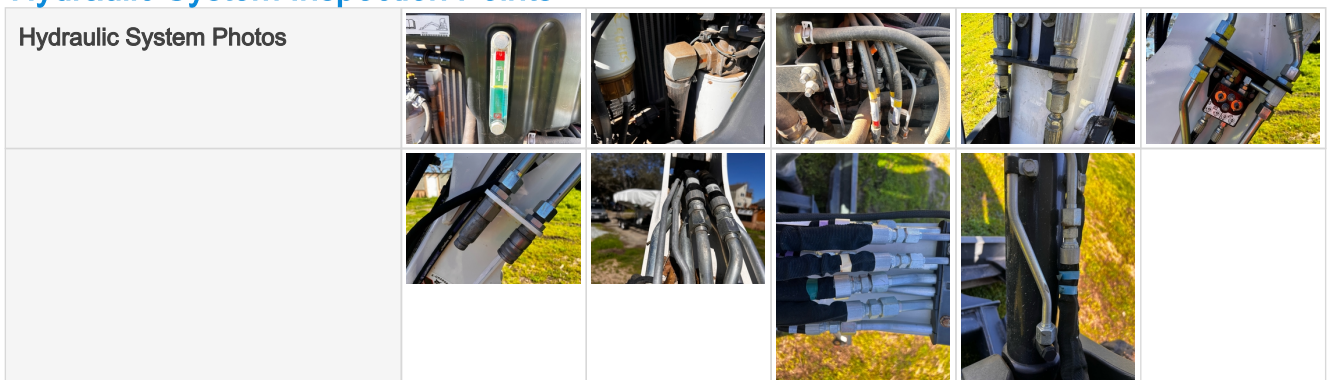


Hydraulic System Inspection Points



Inspection Report (Excavator)

Wet or Damp Hydraulic Lines / Fittings	No
Hydraulic Lines/Fittings	5 - Very Light or Minimal Wear
Hydraulic Lines / Fittings Condition	Hydraulic lines & fittings are clean and in good condition
Hydraulic Pump(s)	5 - Very Light or Minimal Wear
Unusual Noises	No
Hydraulic Pump Notes	No unusual noises heard during operation

Hydraulic Cylinder Inspection Points

Hydraulic Cylinder Photos					
					
					
Mounting Pins	5 - Very Light or Minimal Wear				
Cylinder Oil Leaks	No				
Hydraulic System Overall	5 - Very Light or Minimal Wear				

Bucket Inspection Points

Attachment Photos					
Bucket	5 - Expected Wear - Fully Operable				
Bucket Teeth	5 - Very Light or Minimal Wear				
Blade	5 - Very Light or Minimal Wear				

Additional Attachment Inspection Points

Additional Attachment(s)
















Additional Attachments

Attachment Type	Single ripper attachment
Attachment Make	Bobcat
Attachment Condition	5 - Very Light or Minimal Wear

Inspection Report (Excavator)

Attachment Photos					
					

Additional Attachments (1)

Attachment Type	Auger				
Attachment Make	Bobcat				
Attachment Size / Specs	20PH				
Attachment Condition	5 - Very Light or Minimal Wear				
Comments	auger attachment fits multiple machines in this seller's package - Buyer to confirm if the auger is included with this machine sale				
Attachment Photos					
					
					

Functional Test

Functionality Assessment

Functionality Assessment

Engine	5 - Very Light or Minimal Wear
Transmission/Drivetrain	5 - Very Light or Minimal Wear
Travel (Forward/Reverse/Steering)	5 - Very Light or Minimal Wear
Brakes	5 - Very Light or Minimal Wear

Inspection Report (Excavator)

Hydraulic System	5 - Very Light or Minimal Wear
Electric Operating System	5 - Very Light or Minimal Wear
Controls	5 - Service Required - Inoperable
Safety Systems	5 - Very Light or Minimal Wear
Core Functions	5 - Very Light or Minimal Wear
Attachments	5 - Very Light or Minimal Wear
Overall Functional Test Comments	Light to minimal wear no major issues to report

Overall Assessment

Overall Assessment

Inspection Rating Criteria	Rating	Explanation
	5	Light or minimal wear for its age
	4	Expected wear and tear for its age, operates as expected
	3	Above average wear and tear for its age, still operates as expected
	2	Heavy wear, is operable but needs attention
	1	Requires repair(s) to function as expected
Exterior Rating	5 - Very Light or Minimal Wear	
Interior Rating	5 - Very Light or Minimal Wear	
Safety Rating	5 - Very Light or Minimal Wear	
Quality Rating	5 - Very Light or Minimal Wear	
Functionality Rating	5 - Very Light or Minimal Wear	
Overall Rating	5 - Very Light or Minimal Wear	
What's Great About the Machine	The great thing about this machine is that it has low operation hours, and no abnormal noises were heard during the functional test	
What Needs Work	N/A	
Any Additional Info from the Seller?	auger attachment fits multiple machines in this seller's package - Buyer to confirm if the auger is included with this machine sale	
Date/Time	02-26-2025	
Inspector Name	Javier Bocanegra	
Assessment Details	Boom & Bucket provides an on-site visual inspection of the Unit. The inspection of mechanical components may be limited to starting and running the engine and basic hydraulic movements. Any operational tests are limited to low speeds and are not tested under load. The functionality of locking differentials, transmission shifting, all drive axels, brakes, and auxiliary or high flow hydraulics (unless required for an included attachment) cannot be fully verified. Additional information may be available on request. Please see the terms of services on our website for full details.	