



Citroen C5 Business Class

EZ 06/2013 | Estate | Diesel | Manual transmission | 220,391km

Taxation: Differential taxation (§25a UStG)

Vehicle location: 79***

Fahrzeug aufgenommen am: 23.07.2026



Vehicle data

Manufacturer Citroen	Type/Sales name C5 Business Class [DE - Kb5 1.6 HDi 110 FAP EU5, Business Class, 2010 - 2012]		
Category Estate	FIN VF7RW9HL0DL511908	Registration number -	Mileage 220,391km
Main inspection till / General inspection report available 04/2026 / Not available	Cushion Substance	Performance 114 PS (84 KW)	Fuel Diesel
Number of keys 2	Service booklet Yes	Full service history No	
Cubic capacity 1.560 ccm	Vehicle document folder is present	Last service 198,155km	Last service on 07/2022
Emissions class Euro 5b	Seats 5	Doors 4/5	Transmission type Manual transmission
EZ 06/2013	Colour Grey	Total number of known holders 2	
Import vehicle Not a reimport vehicle	CoC documents available Yes	Country of last approval Germany	
Unusual prior usage None		CO2 emissions 125g/km (NEDC)	Fuel consumption 4.8l/100 km (NEDC)

Notes on the status report

Viewing conditions

The present condition report and the evaluation of the technical components as well as the car service were based exclusively on a visual inspection. A proper visual inspection in difficult weather conditions or contamination of the body can only be carried out to a limited extent. In these cases, further damage cannot be excluded.

When viewing the vehicle, no test drive was carried out and no lifting platform was used. The vehicle may have defects corresponding to mileage and age. Previous damage was not known to CarOnSale, unless otherwise stated in the report.

Tyre condition

1. Set (Mounted)

Tyre type: Summer tyres
Rim: Light metal (Inches: 18)

Front left



(3 mm)

Scratch ,
Rust

Front right



(3 mm)

Scratch ,
Rust

Rear left



(3 mm)

Scratch ,
Rust

Rear right



(3 mm)

Scratch

2. Set

Tyre type: Winter tyres
Rim: Light metal (Inches: 17)

Front left



(3 mm)

Tyre damage: The rims are partially scratched.

Front right



(3 mm)

Rear left



(5 mm)

Rear right



(5 mm)

Paint values

 Anomaly

Vehicle part	Lacquer layer thickness (in µm)	Vehicle part	Lacquer layer thickness (in µm)
Driver door	145	Passenger door	210 
Mudguard front left	145	Mudguard front right	140
Door rear left	145	Door rear right	105
Side panel rear left	160	Side panel rear right	340 
Engine bonnet	115	Boot lid	175 
Roof	150		



Technical condition

Lower engine area	No abnormalities;
Manual/automatic transmission	No abnormalities;
Steering	No abnormalities;
Battery	No abnormalities;
Air conditioning	No abnormalities;
Differential	No abnormalities;

Other technical defects

None

Additional information

Service/Maintenance Due

Wear parts

Braking system	No abnormalities;
Clutch	No abnormalities;
Chassis	No abnormalities;



Standard equipment

- active curve lighting
- airbag driver side/passenger side
- antilock braking system (ABS)
- Audio system: radio with CD player incl. MP3 playback function (Bi-Tuner)
- automatic air-conditioning system, driver side/passenger side separately adjustable
- automatic switch-on for driving light
- body: 5-door
- cargo space partition (net)
- central locking system with remote control
- cruise control (cruise control)
- daytime running lights
- diesel particulate filter
- driver assistance system: emergency brake assist
- driver assistance system: hill start assist feature
- driver assistance system: lane assistant (AFIL)
- electronic stability program with traction control system
- engine 1,6 liter - 82 kW HDi FAP
- exterior mirror electrically adjustable and heated
- exterior mirror fold-up, both
- front fog lights
- hands-free system Bluetooth
- head airbag system
- immobilizer with transponder
- interior mirror with automatic dimming
- Isofix mounts for child seat at passenger seat
- Isofix mounts for child seat at rear seat
- kneebag driver side
- low emissions according to emission standard Euro 5 (PSA = L6)
- lumbar support seat front left, adjustable
- multi-functional display monochrome
- parking aid front and rear
- power steering electrohydraulic

- | | |
|--|--|
| • rear seat with armrest | • rear window wiper |
| • roof rails | • SCR system (AdBlue technology) |
| • seat covers/upholstery: cloth | • seat front left height-adjustable |
| • seat front right height-adjustable | • seat heating front |
| • sidebag front | • steering column (steering wheel) mech. height/length-adjustable |
| • steering wheel (leather) with decorative trim inserts aluminium look | • tire repair kit |
| • transmission 5-speed | • trim strip bumper chrome-plated |
| • trip computer | • window lifter electr. front with pulse trigger |
| • window lifter electr. rear with pulse trigger | • windshield (Sun-Protect) |
| • windshield wiper with rain sensor | • traction control system (ASR) |
| • Electronic Stability Control (ESP) | • driver assistance system: parking assistant (parking space detector) |
| • parking aid front | • parking aid rear |
- Original vehicle color: GRIS HARIA 2



Extras

- | | |
|-------------------------------|-----------------------------|
| • metallic paintwork | • navigation system: My Way |
| • hands-free system Bluetooth | |


The data of the standard and optional equipment will be taken from the DAT database. No liability can be assumed for the completeness and accuracy

Vehicle photos







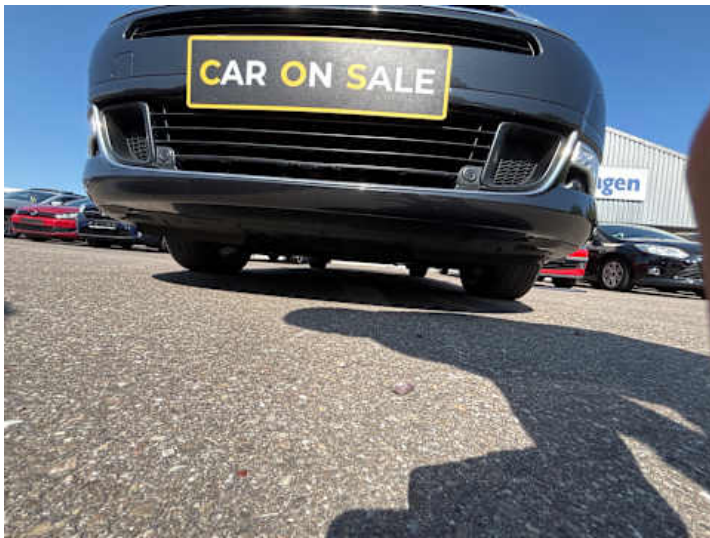



Zulassungsbescheinigung Teil I				18.06.2012 3001 APR000031				2	1	84/3600	190
M1				AC				4829-4829	1860-1860		
SUN-K-0-043/16-00006				VI7FWHLL00LS11908				1671-1512	1742-1742		
CITROËN				R				125	2153	2153	
R				RWDHLE				1250	1130	-	
RWDHLE				R				1250	1130	-	
C5				C5				73	2700	71	
CITROËN (P)				CITROËN (P)				1300	750	5	-
Fr.s. Pers. bef. b. 9 Sp1.				Fr.s. Pers. bef. b. 9 Sp1.				225/60R16 92U			
Kombi-Limousine				Kombi-Limousine				225/60R16 92U			
713/2007*566/2011F				713/2007*566/2011F							
EURO5/F1E1/C1; M; N1 1				EURO5/F1E1/C1; M; N1 1							
Diesel				Diesel							
0002				0002							
35FV				35FV							
1560				1560							
TECHN.FUL.GES.MASSE D. RUGROMINATION: 1153KG BEI 12% ST				TECHN.FUL.GES.MASSE D. RUGROMINATION: 1153KG BEI 12% ST							
RIG.OD.MAX. 3453KG BEI 10% STIG.*STUFE PM 5 AB TAG ERS				RIG.OD.MAX. 3453KG BEI 10% STIG.*STUFE PM 5 AB TAG ERS							
ZUL.				ZUL.							
76829 Landau				76829 Landau							
02/2016				12.02.2016							

Vehicle damage photos (exterior)



Headlight (left) (Opaque)



Headlight (right) (Opaque)



Engine bonnet (Chip)



Engine bonnet (Crack)



Wheel (Scratch , Rust)



Wheel (Scratch , Rust)



Wheel (Scratch , Rust)



Wheel (Scratch)



Driver door (Scratch)



Driver door (Scratch)



Passenger door (Scratch)



Door rear left (Scratch)



Door rear left (Scratch)



Roof (Delle)



Rear bumper (Scratch)



Rear bumper (Scratch)



Mudguard front right (Rust)



Mudguard front right (Scratch)



Side panel rear left (Bleached/Matte)



Boot lid (Scratch)

Vehicle damage photos (interior)



Interior (Pollution, Wear)



Interior (Pollution, Wear)



Interior (Pollution, Wear)



Interior (Pollution, Wear)