


Specifications

License Plate Number		Fuel Type	Gasoline
		VIN	WF0PXXGCHPSB18409
Manufacturer	FORD		
Model	Focus SW	Cylinder Capacity	1.000 ^{cm} 3
Model Versions	1.0 Fahrassistenz-Paket. Ganzjahresreifen. LED-Mat	Transmission Type	Automatisch geschakelde Transmissie
		First Admission	02-07-2025
Body Type	5 door hatchback	Odometer	36.252 ^{Km}
Color	Grey	Numer Of Keys	1
Paint Type	Metallic	Interior	Black
Production Year	2025	Number Headrests	5
KW	114		

Images



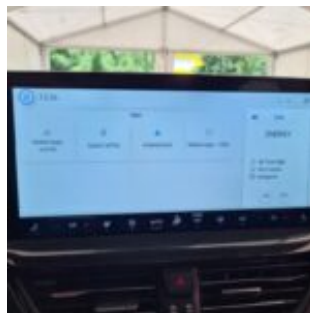

Accessories

ABS

Airbags

Alloy wheels

Audio System

Automatic air conditioning

Bluetooth car kit

Central door locking

Centre armrest

Cruise control

Electric rear windows

Electric windows front

Electrically adjustable exterior mirrors

Front & rear parking sensors

Leather steering wheel

Navigation system

Rear view camera

Roller cover / parcel shelf

Seat heating

Steering wheel multifunction

Steeringwheel – Heated

Windscreen – Heated

Condition

Condition exterior Adequate

Condition interior Adequate

Last Maintenance 08-05-2026

Last maintenance odometer 31.608

Previous Repairs Unknown

Tire Specifications

Tire	Profile	Brand	Width	Aspect Ratio	Radial	Type
Front Left	4 ^{mm}	Goodyear	215 ^{mm}	50 ^{mm}	17 ^{inch}	All Season
Rear Left	5 ^{mm}	Goodyear	215 ^{mm}	50 ^{mm}	17 ^{inch}	All Season
Front Right	4 ^{mm}	Goodyear	215 ^{mm}	50 ^{mm}	17 ^{inch}	All Season
Rear Right	5 ^{mm}	Goodyear	215 ^{mm}	50 ^{mm}	17 ^{inch}	All Season
Spare Tire Type	Compressor					

Damages



Damage Part

Damage Type

Repair Type

Acceptable

Reardoor – Right

Door-edge chipped

Acceptable

Yes



Damage Part

Damage Type

Repair Type

Acceptable

Fender – Rear Right

Stonechipping

Acceptable

Yes



Damage Part

Damage Type

Repair Type

Acceptable

Frontdoor – Right

Door-edge chipped

Acceptable

Yes



Damage Part

Damage Type

Repair Type

Acceptable

Alloy – Right Rear

Damaged

Rim repair

No



Damage Part

Damage Type

Repair Type

Acceptable

Alloy - Right Front

Damaged

Rim repair

No



Damage Part

Damage Type

Notes

Repair Type

Acceptable

Front

Dislocated / Loose

Linksvoor koplamp
vervangen

Repair

No



Damage Part

Damage Type

Repair Type

Acceptable

Frontdoor - Left

Door-edge chipped

Acceptable

Yes



Damage Part

Damage Type

Repair Type


Acceptable

spoiler RB

Scratch(es)

Spray

No

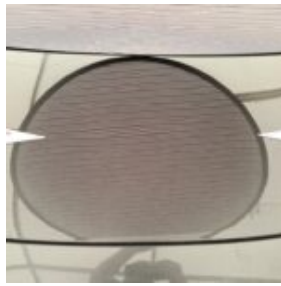

Damage Part

Damage Type

Repair Type

Acceptable

Hood

Dent(s)

Panelbeating & Spray

No



Damage Part

Damage Type

Repair Type

Acceptable

Interior

Stains & dirt

Cleaning

No